Inspect Minnesota & Midwest Soil Testing

| P.O. Box 383 Hugo, MN 55038 | | Brian Humpal | |
|---|------------------------|----------------------------------|--|
| 651-492-7550/Brian@midwestsoiltesting.com | | MPCA Licensed Advanced Inspector | |
| SUBSURFACE SEWAGE T | FREATMENT SYSTI | EM (SSTS) COMPLIANCE REPORT | |
| Date: March 21, 2016 | Time: 11:30 AM | Owner: Andrei Beletsky | |
| Inspection Address: 2211 Itasca Ave S, St. Mary's Point, MN 55043 | | | |

<u>REPORT SUMMARY</u>

I have performed an "MPCA Compliance Inspection" on this system and have reviewed the original design/permit records on file at Washington County. This system consists of two pre-cast septic tanks, a pre-cast lift tank, and a gravelless trench drainfield. This house is presently vacant.

Although not a compliance criteria, it should be noted that the inlet baffle on the first septic tank is missing and the inlet baffle and outlet baffle on the second tank are missing. These baffles should be replaced as soon as possible.

Predicated on my inspection of the system and my review of the original design/permit records, it is my opinion that this system presently meets MPCA minimum compliance inspection requirements.

Inspect Minnesota and Midwest Soil Testing have been hired to perform a compliance inspection of this SSTS for compliance with local ordinances pursuant to Minn. Stat. § 115.55 (2013). This compliance inspection covers only the criteria required by Minn. Stat. § 115.55 Subd. 5a (2013) and Minn. R. 7080.1500 (2011). A compliance inspection is an indication of the current compliance status of the system and does not guarantee the performance or longevity of this system beyond the date of inspection, as it is impossible to determine the future performance of any system. Inspect Minnesota and Midwest Soil Testing disclaim any use of this compliance inspection beyond determining SSTS compliance pursuant to Minn. Stat. § 115.55 Subd. 5a (2013) and Minn. R. 7080.1500 (2011).

Please contact me should you have any questions.

Brian Humpal Brian Humpal

| | Minnesota Pollution Control Agency 520 Lafayette Road North | - | e Inspection Form |
|--------------------------|---|---|---|
| | St. Paul, MN 55155-4194 | | (SSTS) |
| | | | Doc Type: Compliance and Enforcement |
| | ns: Inspection results based on Minnes its and attached forms – additional loca | 5,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,, | For local tracking purposes: |
| Submit co within 15 d | mpleted form to Local Unit of Gove days | rnment (LUG) and system owner | |
| System Syst | Status em status on date (mm/dd/yyyy): _ | 3/21/2016 | |
| (| Compliant – Certificate of Cor Valid for 3 years from report date, unle rame outlined in Local Ordinance.) | - | npliant – Notice of Noncompliance rade Requirements on page 3) |
| Reas | son(s) for noncompliance (check | k all applicable) | |
| |] Impact on Public Health (Compliance | e Component #1) – Imminent threat to | public health and safety |
| |] Other Compliance Conditions (Comp | pliance Component #3) – Imminent thr | eat to public health and safety |
| |] Tank Integrity (Compliance Compon | ent #2) – Failing to protect groundwat | er |
| |] Other Compliance Conditions (Comp | pliance Component #3) – Failing to pro | otect groundwater |
| |] Soil Separation (Compliance Compo | nent #4) – Failing to protect groundwa | ater |

Operating permit/monitoring plan requirements (Compliance Component #5) – Noncompliant

Property Information

| Parcel | ID# or | Sec/Tw | p/Range: |
|--------|--------|---------|------------|
| 1 0001 | | 000/11/ | pri tungo. |

| Property address: | 2211 Itasca Ave S, St. Mary's Point, MN 55043 | Reason for inspection: <u>Property Sale</u> |
|---|---|---|
| Property owner: | Andrei Beletsky | Owner's phone: 651-353-8888 |
| or | | |
| Owner's representation | ative: | Representative phone: |
| Local regulatory authority: <u>Washington County</u> Regulatory authority phone: <u>651-430-4052</u> | | Regulatory authority phone: _651-430-4052 |
| Brief system description:Two pre-cast septic tanks, a pre-cast lift tank, and a gravelless trench drainfield. | | |
| Comments or reco | mmendations: | |

Comments or recommendations:

Although not a compliance criteria, it should be noted that the inlet baffle on the first septic tank is missing and the inlet baffle and outlet baffle on the second tank are missing. These baffles should be replaced as soon as possible.

Certification

I hereby certify that all the necessary information has been gathered to determine the compliance status of this system. No determination of future system performance has been nor can be made due to unknown conditions during system construction, possible abuse of the system, inadequate maintenance, or future water usage.

| Inspector name: | Brian Humpal | Certification number: | L5342 |
|---------------------|---|-----------------------|--------------|
| Business name: | Inspect Minnesota, Midwest Soil Testing | License number: | L2896 |
| Inspector signature | : Brian Humpal | Phone number: | 651-492-7550 |
| | | | |

Necessary or Locally Required Attachments

| 🛛 Soil boring logs | 🛛 System/As-built drawing | Forms per local ordinance |
|---------------------------|--------------------------------------|---------------------------|
| Other information (list): | Report Summary, Property Information | ion, Disclaimer, License |

Searched for seeping in yard/backup in home

Homeowner testimony (See Comments/Explanation)

Other methods not listed (See Comments/Explanation)

Excessive ponding in soil system/D-boxes

"Black soil" above soil dispersal system

System requires "emergency" pumping

Unable to verify (See Comments/Explanation)

1. Impact on Public Health – Compliance component #1 of 5

Compliance criteria: System discharge sewage to the ground surface. System discharge sewage to drain tile or surface waters. System cause sewage backup into dwelling or establishment.

Any "yes" answer above indicates the system is an Imminent Threat to Public Health and Safety.

Comments/Explanation:

None of the above found.

A soil boring over the drainfield indicated no signs of ponding or black/gray soils.

2. Tank Integrity - Compliance component #2 of 5

Compliance criteria:

| System consists of a seepage pit, cesspool, drywell, or leaching pit. | 🗌 Yes | 🛛 No |
|--|-------|------|
| Seepage pits meeting 7080.2550 may be compliant if allowed in local ordinance. | | |
| Sewage tank(s) leak below their designed operating depth. | 🗌 Yes | 🛛 No |
| If yes, which sewage tank(s) leaks: | | |

Any "yes" answer above indicates the system is Failing to Protect Groundwater.

Verification method(s):

Verification method(s): ⊠ Searched for surface outlet

Performed dye test

- Examined construction records
- Examined Tank Integrity Form (Attach)
- Observed liquid level below operating depth
- Examined empty (pumped) tanks(s)
- Probed outside tank(s) for "black soil"
- Unable to verify (See Comments/Explanation)
- Other methods not listed (See Comments/Explanation)

Comments/Explanation:

Lowered underwater camera into tanks - tank walls OK.

Lift pump and alarm were operational at the time of the inspection.

Although not a compliance criteria, it should be noted that the inlet baffle on the first septic tank is missing and the inlet baffle and outlet baffle on the second tank are missing. These baffles should be replaced as soon as possible.

3. Other Compliance Conditions - Compliance component #3 of 5

- a. Maintenance hole covers are damaged, cracked, unsecured, or appear to structurally unsound. 🗌 Yes* 🛛 No 🗌 Unknown
- b. Other issues (*electrical hazards, etc.*) to immediately and adversely impact public health or safety. \Box Yes* \boxtimes No \Box Unknown *System is an imminent threat to public health and safety

Explain:

c. System is non-protective of ground water for other conditions as determined by inspector ☐ Yes* ⊠ No *System is failing to protect groundwater

Explain:

4. Soil Separation – Compliance component #4 of 5

| Date of installation: 2000 | Unknown | Verification method(s): | |
|---|---|---|--|
| Shoreland/Wellhead protection/Food Beverage Lodging? | 🗌 Yes 🛛 No | Soil observation does not expire. Pr | |
| Compliance criteria: | | observations by two independent pa unless site conditions have been alt | |
| For systems built prior to April 1, 1996, and not located in Shoreland or Wellhead Protection Area or not serving a food, beverage or lodging establishment: Drainfield has at least a two-foot vertical separation distance from periodically | ☐ Yes ☐ No | requirements differ. Conducted soil observation(s) (A Two previous verifications (Attac Not applicable (Holding tank(s), not Unable to verify (See Comments/Explanation Other (See Comments/Explanation) | ch boring logs) o drainfield) Explanation) |
| saturated soil or bedrock. Non-performance systems built April 1, 1996, or later or for non-performance systems located in Shoreland or Wellhead Protection Areas or serving a food, beverage, or lodging establishment: | Xes INO | Comments/Explanation: Reviewed design and permit record | S. |
| Drainfield has a three-foot vertical separation distance from periodically saturated soil or bedrock.* | | | |
| "Experimental", "Other", or "Performance" | tal", "Other", or "Performance" □ Yes □ No In | | |
| systems built under pre-2008 Rules; Type IV or V systems built under 2008 Rules (7080. 2350 or 7080.2400 (Advanced Inspector License required) | | A. Bottom of distribution media | See Attached Boring Log(s) |
| Drainfield meets the designed vertical | | B. Periodically saturated soil/bedrock | |
| separation distance from periodically saturated soil or bedrock. | | C. System separation | |
| | | D. Required compliance separation* | |
| Any "no" answer above indicates the Failing to Protect Groundwater. | he system is | *May be reduced up to 15 percent if Ordinance. | allowed by Local |
| Operating Permit and Nitrogen B | MP* – Compliance | e component #5 of 5 🛛 🛛 Not app | icable |
| Is the system operated under an Operating Per | mit? 🗌 Yes | ⊠ No If "yes", A below is required | |
| Is the system required to employ a Nitrogen BM | 1P? 🗌 Yes | ⊠ No If "yes", B below is required | |
| BMP=Best Management Practice(s) specif | ïed in the system des | ign | |
| If the answer to both questions is "no", | this section does | not need to be completed. | |
| Compliance criteria | | | |
| a Operating Dermit surphan | | | |

| a. | Operating Permit number: | 🗌 Yes 🗌 No |
|----|---|------------|
| | Have the Operating Permit requirements been met? | |
| b. | Is the required nitrogen BMP in place and properly functioning? | 🗌 Yes 🔲 No |
| | | |

Any "no" answer indicates Noncompliance.

Upgrade Requirements (*Minn. Stat.* § 115.55) *An imminent threat to public health and safety (ITPHS) must be upgraded, replaced, or its use discontinued within ten months of receipt of this notice or within a shorter period if required by local ordinance. If the system is failing to protect ground water, the system must be upgraded, replaced, or its use discontinued within the time required by local ordinance. If an existing system is not failing as defined in law, and has at least two feet of design soil separation, then the system need not be upgraded, replaced, or its use discontinued, notwithstanding any local ordinance that is more strict. This provision does not apply to systems in shoreland areas, Wellhead Protection Areas, or those used in connection with food, beverage, and lodging establishments as defined in law.*


<u>Inspect Minnesota & Midwest Soil Testing</u>

Subsurface Sewage Treatment System Owner/Property Information

This information will be used for the purpose of conducting an MPCA Compliance Inspection.

| Date of Inspection: March 21, 2016 | Time: 11:30 AM | | | |
|---|--|--|--|--|
| Property Address: 2211 Itasca Ave S, St. Mary's I | Point, MN Zip: 55043 | | | |
| Property Owner: Andrei Beletsky | Phone: 651-353-8888 | | | |
| | eatment System Other | | | |
| | k trench Alternative system | | | |
| | velless trench Experimental system | | | |
| | mber trench Cesspool system | | | |
| Holding Concrete Seer Other: Block Mou | nd | | | |
| Other At-g | | | | |
| Are the tank maintenance covers accessible? \boxtimes Ye | \sim \Box No *If no proper maintenance must be | | | |
| performed through the maintenance holes. Mainten | | | | |
| the ground surface to facilitate access and proper m | | | | |
| | | | | |
| Year house built: 1939 Year septic installed | | | | |
| How long has seller owned the property? | Number of residents in home? | | | |
| | rs drained by gravity? Y | | | |
| | Vhirlpool bath? | | | |
| More than one system (laundry, etc.)? | | | | |
| Does this property have any footing drain tiles connected to the septic system? | | | | |
| | | | | |
| Are any buildings on this property such as garages | or out-buildings connected to this system? | | | |
| | | | | |
| | | | | |
| Are there any additional systems on this property serving other buildings? | | | | |
| | | | | |
| Location of septic system on lot? East Side | | | | |
| Location of water well on lot? West Side | Is the well a deep well? Y | | | |
| Have you ever experienced any problems with the | | | | |
| surfacing of sewage onto the ground, septic tank overflowing, etc.; or have any repairs been made | | | | |
| to the system? If yes, explain: | | | | |
| | | | | |
| | | | | |
| When was the system last pumped? | Name of pumper: | | | |
| How often pumped in previous years? | Is system on a monitoring plan? | | | |
| Have you received notices from any government ag | | | | |
| Is your property located in a shoreland management area? N | | | | |
| Do you have any additional information that should | l be given to the new owner? | | | |
| | | | | |

I hereby certify that the above information is correct to the best of my knowledge. I also understand that if the system is considered "non-compliant/failing" per MPCA rules, that the inspector must by law submit a copy of this report to the local government unit within 15 days of the date of inspection completion. I also agree that unless otherwise noted in this report, that I/we are ultimately responsible for payment of all fees for all work performed relative to this inspection by Inspect Minnesota and Midwest Soil Testing.

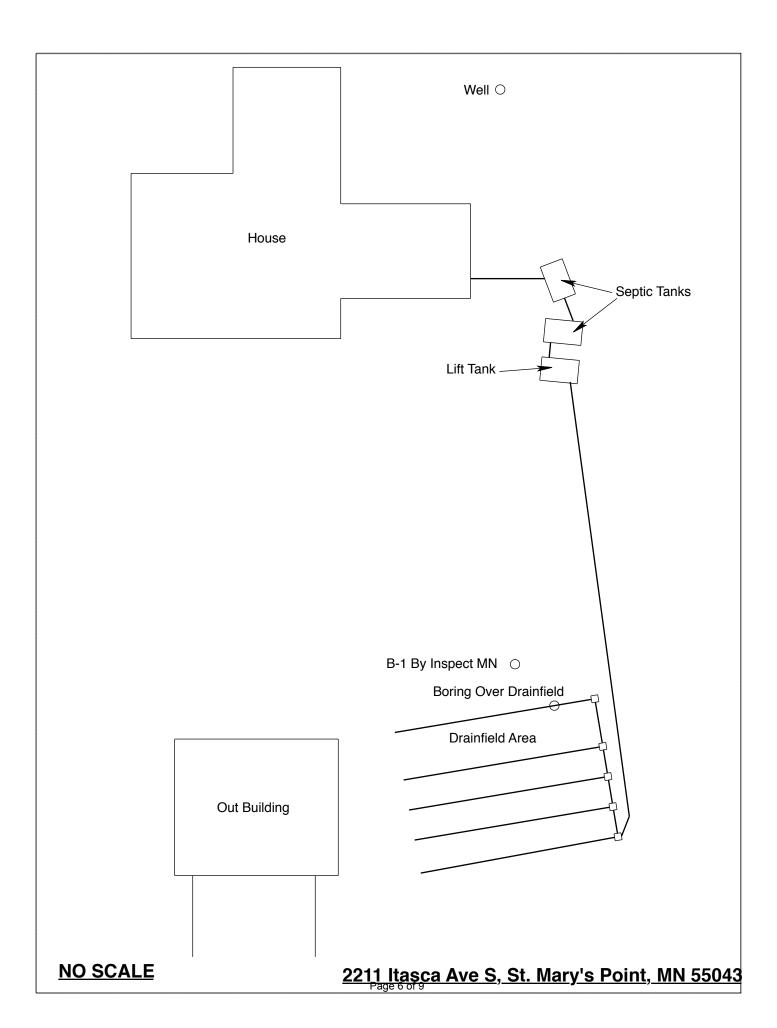

Log Of Soil Borings

| Location of Project: 2211 Itasca Ave S, St. Mary's Point, MN 55043 | | | | | |
|--|------------------|--------------------------------------|----------------------------------|---------------------|----------------------|
| | | | | 3/21/16 | |
| | | Hand/Bucket | Classi | fication System: | USDA |
| Bo | pring Number: | 1 | | Boring Number: | |
| Surface Elevation of Boring | Same grou | und surface as last nfield trench | Surface Elevation o Boring | | |
| Depth In Inches | <u>Soils E</u> | ncountered | Depth In Inches | Soils En | countered |
| 0-18 18-36 36-80 | 10YR 3/3 | Medium Sand Medium Sand | | | |
| 80" De | pth To End Of B | oring Or Redox | [| Depth To End Of Bo | oring Or Redox |
| Same Ele | evation Of Borin | g Relative To System | E | Elevation Of Boring | Relative To System |
| -32" De | | Df Distribution Media | [| | f Distribution Media |
| Fn | d Of Boring At: | 80" | | End Of Boring At: | |
| | dox Present At: | None | | Redox Present At: | |
| | ater Present At: | None | | Water Present At: | |

Bottom Of Distribution Medium At: 32 Inches

DISCLAIMER

Brian L. Humpal, Inc. dba. Inspect Minnesota, Midwest Soil Testing

Relative to Subsurface Sewage Treatment System (SSTS) Compliance Inspections

- 1. This inspection/report is being performed for only the seller/owner of the property on which the SSTS is located. In such case that another party is paying for the inspection, the contract is between only said party and Brian L. Humpal, Inc.; there is no contract between Brian L. Humpal, Inc. and any other party unless otherwise noted.
- 3. Brian L. Humpal, Inc. has not been retained to warranty, guarantee, or certify the proper functioning of the SSTS for any period of time beyond the date of inspection or into the future. Because of the numerous factors (usage, maintenance, soil characteristics, previous failures, etc.) which may affect the proper operation of an SSTS, as well as the inability of Brian L. Humpal, Inc. to supervise or monitor the use or maintenance of the SSTS, the report shall not be construed as a warranty by Brian L. Humpal, Inc. that the SSTS will function properly for any particular party for any period of time.
- 4. Brian L. Humpal, Inc. is unable to verify the frequency and/or, quality of prior or future maintenance of the SSTS. Maintenance of the tank(s) must be performed through the tanks maintenance hole. The removal of solids from any location other than the maintenance hole is not a compliant method of maintenance. It is strongly recommended that maintenance covers be made accessible to the ground surface to facilitate proper maintenance.
- 5. Minimum Compliance Inspection requirements relative to this inspection and this report include <u>only</u> verification that the SSTS has tank(s) (septic tanks, lift tanks, dosing tanks, stilling tanks, etc.) which are watertight below the designed operating depth, the required separation between the bottom of the subsurface soil distribution medium and seasonally saturated soils, no back-ups of sewage into the dwelling, no discharge of sewage/effluent to the ground surface or surface waters, and no imminent safety hazards. Brian L. Humpal, Inc. does not inspect plumbing or pumps prior to the first SSTS component as these are plumbing components. The performance of exterior pumps and associated components are not inspected as they are considered to be maintenance items. Additionally, no indications relative to compliance with electrical code requirements have been made. It is recommended that any other applicable plumbing, electrical, housing, etc. inspections be performed by a qualified inspection business. Sewage back-up verification is limited to observing the floor drain area and/or the information supplied by the last occupants of the building prior to inspection. Brian L. Humpal, Inc. cannot guarantee that the information given to them by the last occupants of the building prior to inspection relative to back-ups is accurate.
- 4. Certification of this SSTS does not warranty future use beyond the date of the inspection. Any SSTS, old or new, can become hydraulically overloaded or discharge sewage/effluent to the ground surface as a result of more people moving into the house than were previously occupying the house, improper maintenance, heavy usage, leaking plumbing fixtures, groundwater infiltration, tree roots, freezing conditions, surface drainage problems, poor initial design, poor construction practices, or unsuitable materials used in constructing the system; the system can also simply stop working because of its age. An SSTS that has been properly designed and installed, properly maintained, and used in the manner for which the system was designed can be expected to provide service for twenty to twenty-five years on average. Some parts of the SSTS such as alarms, switches, pumps, filters, etc. will most likely have to be repaired or replaced over the lifetime of the system.
- 5. A Compliance Inspection is not meant to be a test or inspection for longevity of the system; a Compliance Inspection is strictly for the purpose of determining if the SSTS is protective of public health and safety, as well as the groundwater at the date and time the inspection was performed. This inspection is not intended to determine if the SSTS was originally designed or installed to past or present MPCA or other Local Government Unit code requirements. This inspection is not intended to determine if the SSTS was designed and/or installed to support the anticipated flow from the building as the use of the building may have changed since the design and construction of the SSTS due to the addition of bedrooms, occupants, etc. In addition, this inspection is not intended to determine the quality of the original SSTS design, the quality of the construction practices used while installing the SSTS, or the quality of the materials used in constructing the SSTS.
- 6. Brian L. Humpal, Inc. cannot guarantee the performance of SSTS products/components such as: gravelless pipe, chamber trenches, effluent filters, tanks, sewage pre-treatment components, piping, etc. Products such as gravelless pipe are no longer approved for installation in the State of Minnesota and may have a significantly reduced performance and/or life expectancy.
- 7. WINTER WORK: By accepting this report, it is understood that inspections conducted during winter months (approximately November 1st through April 1st) are more difficult to perform because of possible snow cover and/or ground frost. SSTS components such as tanks, maintenance covers, tank inspection pipes, subsurface distribution medium inspection pipes, and soil treatment areas are more difficult or impossible to locate due to snow cover and/or ground frost. In addition, soil borings are more difficult to perform due to snow cover and/or ground frost. Brian L. Humpal, Inc. will attempt to use the same level of standards when performing work during winter periods as when performing work during non-winter periods. However, the recipient of this report understands that because of the aforementioned considerations, the same level of standards may not be possible.
- 8. By accepting this report, the client understands that Brian L. Humpal, Inc. will not be responsible for any monetary damages exceeding the fee for the services provided.

Subsurface Sewage Treatment Systems

Non-transferable



License # L2896

| Date of Issuance: | Oct 28, 2015 |
|--------------------------------|--------------|
| Maintainer License Expires: | Dec 22, 2016 |
| Installer License Expires: | Dec 22, 2016 |
| Adv Inspector License Expires: | Dec 22, 2016 |
| Adv Designer License Expires: | Dec 22, 2016 |

Inspect Minnesota, Midwest Soil Testing

| Designated Certified Individual (DCI) | Certification Type | Certification Expires | |
|--|--------------------------------|--------------------------|--|
| Brian L. Humpal | Maintainer (Certified) | 10/15/2017 | |
| Brian L. Humpal | Advanced Designer (Certified) | 10/15/2017 | |
| Brian L. Humpal | Advanced Inspector (Certified) | 10/15/2017 | |
| Brian L. Humpal | Installer (Certified) | 10/15/2017 | |
| Brian L. Humpal | Service Provider (Certified) | 10/15/2017 | |
| Christopher R. Uebe | Designer (Certified) | 03/04/2018 | |
| Christopher R. Uebe | Inspector (Certified) | 03/04/2018 | |
| | | | |



Minnesota Pollution Control Agency

520 Lafayette Road North St. Paul, Minnesota 55155-4194

ngs Manaaer

Environmental Business Assistance Section