Inspect Minnesota & Midwest Soil Testing

P.O. Box 10853 White Bear Lake, MN 55110 651-492-7550/Brian@Midwestsoiltesting.com

Brian Humpal

MPCA Licensed Advanced Inspector

SUBSURFACE SEWAGE TREATMENT SYSTEM (SSTS) COMPLIANCE REPORT

Inspection Address: 13020 53rd St N, Baytown, MN **Site Conditions:** 10" Snow 18" Frost

REPORT SUMMARY

I have performed an "MPCA Compliance Inspection" on this system, have reviewed the history of the system with the owner, Joseph Lee, and have reviewed the original design/permit records on file at Washington County. This older system (installed in 1994) consists of two precast septic tanks and a rock trench drainfield.

It should be noted that the septic tanks are currently due for maintenance pumping and should be pumped when possible in the spring of 2018.

Predicated on my inspection of the system, my review of the history of the system with the owner, and my review of the original design/permit records, it is my opinion that this system presently meets MPCA minimum compliance inspection requirements.

Inspect Minnesota and Midwest Soil Testing have been hired to perform a compliance inspection of this SSTS for compliance with local ordinances pursuant to Minn. Stat. § 115.55 (2013). This compliance inspection covers only the criteria required by Minn. Stat. § 115.55 Subd. 5a (2013) and Minn. R. 7080.1500 (2011). A compliance inspection is an indication of the current compliance status of the system and does not guarantee the performance or longevity of this system beyond the date of inspection, as it is impossible to determine the future performance of any system. Inspect Minnesota and Midwest Soil Testing disclaim any use of this compliance inspection beyond determining SSTS compliance pursuant to Minn. Stat. § 115.55 Subd. 5a (2013) and Minn. R. 7080.1500 (2011).

Please contact me should you have any questions.

Brian Humpal



Compliance Inspection Form

Existing Subsurface Sewage Treatment Systems (SSTS)

Doc Type: Compliance and Enforcement

	sults based on Minnesota Pollution Control Agency (Norms – additional local requirements may also apply.	For local tracking purposes:		
Submit completed form to within 15 days	o Local Unit of Government (LUG) and system ow	ner		
System Status				
System status on da	ate (mm/dd/yyyy):2/8/2018			
(Valid for 3 years		oncompliant – Notice of Noncompliance ee Upgrade Requirements on page 3)		
☐ Impact on Publ ☐ Other Complia ☐ Tank Integrity (☐ Other Complia	compliance (check all applicable) lic Health (Compliance Component #1) – Imminent to the Conditions (Compliance Component #3) – Imminer (Compliance Component #2) – Failing to protect group to Compliance Component #3) – Failing to protect group (Compliance Component #4)	ent threat to public health and safety undwater g to protect groundwater oundwater		
Property Information	Daniel ID# as 0 as/Tu	(Danasa)		
•	and	• •		
Property owner: Joe Lee	•	Reason for inspection: Property Transfer Owner's phone: 651-307-2517		
or		wher s phone		
Owner's representative:	Re	presentative phone:		
Local regulatory authority:		Regulatory authority phone: 651-430-4052		
Brief system description:	Two pre-cast septic tanks and rock trench drainfield			
Comments or recommenda	itions:			
It should be noted that the spring of 2018.	septic tanks are currently due for maintenance pump	ing and should be pumped when possible in the		
Certification				
determination of future syst	necessary information has been gathered to determin tem performance has been nor can be made due to ເ rm, inadequate maintenance, or future water usage.			
Inspector name: Brian H	umpal Ce	ertification number: L5342		
Business name: Inspect	Minnesota, Midwest Soil Testing	License number: L2896		
Inspector signature:	Brian Humpal	Phone number: 651-492-7550		
Necessary or Locall	y Required Attachments			
⊠ Soil boring logs		ns per local ordinance		
☐ Other information (list	-	•		

www.pca.state.mn.us • 651-296-6300 • 800-657-3864 • TTY 651-282-5332 or 800-657-3864 • Available in alternative formats wq-wwists4-31 • 1/24/12 Page 1 of 3

Property address: 13020 53rd St N, Baytown Twp, MN 55082

Inspector initials/Date: 02/08/2018

<u>1.</u>	ln	Impact on Public Health – Compliance component #1 of 5							
	Co	Compliance criteria:			Verification method(s):				
		System discharge sewage to the		☐ Yes ☒ No		Searched for surface outlet			
		ound surface.				Searched for seeping in yard/backup in home Excessive ponding in soil system/D-boxes			
		stem discharge sewage to drain tile surface waters.	☐ Yes [⊠ No	\boxtimes	Homeowner testimony (See Comments/Explanation)			
	Sy	stem cause sewage backup into	☐ Yes [⊠ No		"Black soil" above soil dispersal system System requires "emergency" pumping			
		velling or establishment.				Performed dye test			
		Any "yes" answer above indicates the system is an Imminent Threat to Public Health and Safety.				 ☐ Unable to verify (See Comments/Explanation) ☐ Other methods not listed (See Comments/Explanation) 			
	Co	omments/Explanation:							
	No	one of the above found.							
_	_								
2.	Ιā	ank Integrity — Compliance com	nponent #2	2 of 5					
	Compliance criteria:				Verification method(s):				
		stem consists of a seepage pit,	☐ Yes [⊠ No		Probed tank(s) bottom			
		sspool, drywell, or leaching pit.							
	col	epage pits meeting 7080.2550 may be mpliant if allowed in local ordinance.				Examined Tank Integrity Form (Attach) Observed liquid level below operating depth			
		wage tank(s) leak below their	☐ Yes [⊠ No		Examined empty (pumped) tanks(s)			
		signed operating depth.				Probed outside tank(s) for "black soil"			
		ves, which sewage tank(s) leaks:	400 400			Unable to verify (See Comments/Explanation)			
		ny "yes" answer above indica vstem is Failing to Protect Gr		er.	Other methods not listed (See Comments/Explanation)				
	Co	omments/Explanation:							
	Lowered underwater camera into tanks - baffles and tank walls OK.								
	It should be noted that the septic tanks are currently due for maintenance pumping and should be pumped when possible in the spring of 2018.					e pumping and should be pumped when possible in			
_	_								
<u>3.</u>	O1	ther Compliance Conditions	5 – Compli	iance componer	nt #3	3 of 5			
	a.	Maintenance hole covers are damaged	d, cracked,	unsecured, or app	ear t	to structurally unsound. ☐ Yes* ☒ No ☐ Unknown			
	b. Other issues (electrical hazards, etc.) to immediately and adversely impact public health or safety. ☐ Yes* ☒ No ☐ Unk *System is an imminent threat to public health and safety					public health or safety. ☐ Yes* ☒ No ☐ Unknown			
Explain:									
	c. System is non-protective of ground water for other conditions as determined by inspector ☐ Yes* ☒ No *System is failing to protect groundwater				ned by inspector ☐ Yes* ☒ No				
		Explain:							
		•							

www.pca.state.mn.us • 651-296-6300 • 800-657-3864 • TTY 651-282-5332 or 800-657-3864 • Available in alternative formats wq-wwists4-31 • 1/24/12 Page 2 of 3

Property address: 13020 53rd St N, Baytown Twp, MN 55082

Inspector initials/Date: 02/08/2018

	Date of installation: 1994	Unkr	nown	V	erification method(s):		
	Shoreland/Wellhead protection/Food Beverage Lodging?	☐ Yes	⊠ No		oil observation does not expire. Previous soil		
	Compliance criteria:	T.	ι		observations by two independent parties are sufficient, unless site conditions have been altered or local		
	For systems built prior to April 1, 1996, and not located in Shoreland or Wellhead Protection Area or not serving a food, beverage or lodging establishment: Drainfield has at least a two-foot vertical	⊠ Yes	□ No		quirements differ. Conducted soil observation(s) (Two previous verifications (Atta Not applicable (Holding tank(s), r. Unable to verify (See Comments.	ch boring logs) no drainfield)	
	separation distance from periodically saturated soil or bedrock.			\boxtimes	○ Other (See Comments/Explanation)		
	Non-performance systems built April 1, 1996, or later or for non-performance systems located in Shoreland or Wellhead Protection Areas or serving a food, beverage, or lodging establishment:	☐ Yes	□ No		omments/Explanation: eviewed design and permit record	ds.	
	Drainfield has a three-foot vertical separation distance from periodically saturated soil or bedrock.*						
	"Experimental", "Other", or "Performance"	☐ Yes ☐ No		ln	dicate depths of elevations		
	systems built under pre-2008 Rules; Type IV or V systems built under 2008 Rules (7080. 2350 or 7080.2400 (Advanced Inspector License required)			<u>A.</u>	Bottom of distribution media	See Attached Boring Log(s)	
	Drainfield meets the designed vertical separation distance from periodically saturated soil or bedrock.				Periodically saturated soil/bedrock System separation		
				D.	Required compliance separation*		
Any "no" answer above indicates the system is Failing to Protect Groundwater. *May be reduced up to 15 percent Ordinance.				May be reduced up to 15 percent in Ordinance.	if allowed by Local		
	.			_			
5.	Operating Permit and Nitrogen B	MP* – 0	Compliand	ce com	oonent #5 of 5 🛮 🖂 Not app	licable	
	Is the system operated under an Operating Permit?						
	Is the system required to employ a Nitrogen BMP? ☐ Yes ☒ No ☐ f "yes", B below is required						
	BMP=Best Management Practice(s) specified in the system design						
	If the answer to both questions is "no", this section does not need to be completed.						
	Compliance criteria						
	a. Operating Permit number:						
	Have the Operating Permit requirements been met?			☐ Yes ☐ No			
	b. Is the required nitrogen BMP in place and properly functioning?						

Upgrade Requirements (Minn. Stat. § 115.55) An imminent threat to public health and safety (ITPHS) must be upgraded, replaced, or its use discontinued within ten months of receipt of this notice or within a shorter period if required by local ordinance. If the system is failing to protect ground water, the system must be upgraded, replaced, or its use discontinued within the time required by local ordinance. If an existing system is not failing as defined in law, and has at least two feet of design soil separation, then the system need not be upgraded, repaired, replaced, or its use discontinued, notwithstanding any local ordinance that is more strict. This provision does not apply to systems in shoreland areas, Wellhead Protection Areas, or those used in connection with food, beverage, and lodging establishments as defined in law.

www.pca.state.mn.us • 651-296-6300 • 800-657-3864 TTY 651-282-5332 or 800-657-3864 • Available in alternative formats wq-wwists4-31 • 1/24/12 Page 3 of 3


Inspect Minnesota & Midwest Soil Testing Subsurface Sewage Treatment System Owner/Property Information

This information will be used for the purpose of conducting an MPCA Compliance Inspection.

Date of Inspection: February 8, 2018	Time: 9:00 AM				
Property Address: 13020 53 rd St N, Baytown Twp, MN	Zip: 55082				
Property Owner: Joe Lee	Phone: 651-307-2517				
Tank(s) Tank(s)Material Soil Treatment System Septic 2 Fiberglass Septic Rock trench Aerobic Plastic Gravelless trench Lift Metal Chamber trench Holding Concrete Seepage bed Other: Block Mound Other At-grade	Other Alternative system Experimental system Cesspool system Other system				
Are the tank maintenance covers accessible? Yes No *If r performed through the maintenance holes. Maintenance hole cover the ground surface to facilitate access and proper maintenance of the second surface to facilitate access and proper maintenance of the second surface to facilitate access and proper maintenance of the second surface to facilitate access and proper maintenance of the second surface to facilitate access and proper maintenance of the second surface to facilitate access and proper maintenance of the second surface to facilitate access and proper maintenance of the second surface to facilitate access and proper maintenance of the second surface to facilitate access and proper maintenance of the second surface to facilitate access and proper maintenance of the second surface to facilitate access and proper maintenance of the second surface to facilitate access and proper maintenance of the second surface to facilitate access and proper maintenance of the second surface to facilitate access and proper maintenance of the second surface to facilitate access and proper maintenance of the second surface to facilitate access and proper maintenance of the second surface to facilitate access and proper maintenance of the second surface to facilitate access and proper maintenance of the second surface to facilitate access and proper maintenance of the second surface to facilitate access and proper maintenance access access and the second surface access access and the second surface access access access access and the second surface access ac	ers should be made accessible to				
1	Tank size (gals.): 2-1000				
	sidents in home? 3				
Number of bedrooms? 4 Are all floors drained by gr	, i				
Garbage disposal? Y Whirlpool bath?	N				
More than one system (laundry, etc.)? N					
Does this property have any footing drain tiles connected to the septic system? N Are any buildings on this property such as garages or out-buildings connected to this system? N					
Are there any additional systems on this property serving other buildings? N					
Location of septic system on lot? East Side					
Location of water well on lot? West Side	well a deep well? Y				
Have you ever experienced any problems with the system such as: tree roots, sewage back-ups, surfacing of sewage onto the ground, septic tank overflowing, etc.; or have any repairs been made to the system? N If yes, explain:					
When was the system last pumped? 2013? Name of pum	per: Unknown				
How often pumped in previous years? Never					
Have you received notices from any government agency concerning this system? N					
Is your property located in a shoreland management area? N					
Do you have any additional information that should be given to the new owner? N					

I hereby certify that the above information is correct to the best of my knowledge. I also understand that if the system is considered "non-compliant/failing" per MPCA rules, that the inspector must by law submit a copy of this report to the local government unit within 15 days of the date of inspection completion. I also agree that unless otherwise noted in this report, that I/we are ultimately responsible for payment of all fees for all work performed relative to this inspection by Inspect Minnesota and Midwest Soil Testing.

Owner/Occupant: Joseph Lee's Signature On File Date: 02/08/2018

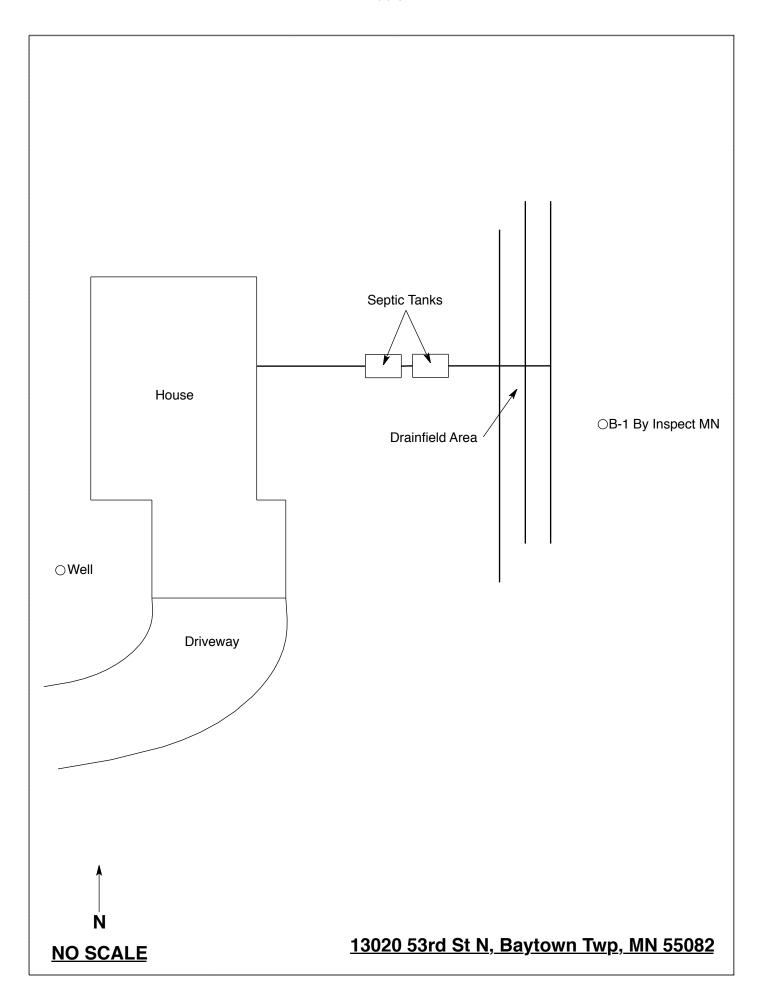

Log Of Soil Borings

Location of Project: 13020 53rd St N, Baytown Twp, MN 55082					
Е	Borings Made By:	Inspect Minnesota		Date:	2/8/18
Auger Used: Hand/Bucket			Classi	fication System:	USDA
Boring Number: 1				Boring Number:	
Surface Elevation of Boring Same ground surface as last drainfield trench			Surface Elevation of Boring	of	
Depth In Inches	Soils E	ncountered	Depth In Inches	Soils Er	ncountered
0-18 18-32 32-70	7.5YR 7.5YR 4/4 Mediu	4/3 Loam 3/4 Loam Im To Fine Sand With Of Gravel			
70"	Depth To End Of B	oring Or Redox		Depth To End Of Bo	oring Or Redox
Same	Elevation Of Boring	g Relative To System	E	Elevation Of Boring	Relative To System
-36" Depth To Bottom Of Distribution Media				of Distribution Media	
≥34" Of Separation				Of Separation	
	End Of Boring At:	70"		End Of Boring At:	
	Redox Present At:	None		Redox Present At:	
Standing Water Present At: None				Water Present At:	
Standing Water Freschi Att			2.00		

Bottom Of Distribution Medium At:	36 Inches

DISCLAIMER

Brian L. Humpal, Inc. dba. Inspect Minnesota, Midwest Soil Testing Relative to Subsurface Sewage Treatment System (SSTS) Compliance Inspections

- 1. This inspection/report is being performed for only the seller/owner of the property on which the SSTS is located. In such case that another party is paying for the inspection, the contract is between only said party and Brian L. Humpal, Inc.; there is no contract between Brian L. Humpal, Inc. and any other party unless otherwise noted.
- 3. Brian L. Humpal, Inc. has not been retained to warranty, guarantee, or certify the proper functioning of the SSTS for any period of time beyond the date of inspection or into the future. Because of the numerous factors (usage, maintenance, soil characteristics, previous failures, etc.) which may affect the proper operation of an SSTS, as well as the inability of Brian L. Humpal, Inc. to supervise or monitor the use or maintenance of the SSTS, the report shall not be construed as a warranty by Brian L. Humpal, Inc. that the SSTS will function properly for any particular party for any period of time.
- 4. Brian L. Humpal, Inc. is unable to verify the frequency and/or, quality of prior or future maintenance of the SSTS. Maintenance of the tank(s) must be performed through the tanks maintenance hole. The removal of solids from any location other than the maintenance hole is not a compliant method of maintenance. It is strongly recommended that maintenance covers be made accessible to the ground surface to facilitate proper maintenance.
- 5. Minimum Compliance Inspection requirements relative to this inspection and this report include <u>only</u> verification that the SSTS has tank(s) (septic tanks, lift tanks, dosing tanks, stilling tanks, etc.) which are watertight below the designed operating depth, the required separation between the bottom of the subsurface soil distribution medium and seasonally saturated soils, no back-ups of sewage into the dwelling, no discharge of sewage/effluent to the ground surface or surface waters, and no imminent safety hazards. Brian L. Humpal, Inc. does not inspect plumbing or pumps prior to the first SSTS component as these are plumbing components. The performance of exterior pumps and associated components are not inspected as they are considered to be maintenance items. Additionally, no indications relative to compliance with electrical code requirements have been made. It is recommended that any other applicable plumbing, electrical, housing, etc. inspections be performed by a qualified inspection business. Sewage back-up verification is limited to observing the floor drain area and/or the information supplied by the last occupants of the building prior to inspection. Brian L. Humpal, Inc. cannot guarantee that the information given to them by the last occupants of the building prior to inspection relative to back-ups is accurate.
- 4. Certification of this SSTS does not warranty future use beyond the date of the inspection. Any SSTS, old or new, can become hydraulically overloaded or discharge sewage/effluent to the ground surface as a result of more people moving into the house than were previously occupying the house, improper maintenance, heavy usage, leaking plumbing fixtures, groundwater infiltration, tree roots, freezing conditions, surface drainage problems, poor initial design, poor construction practices, or unsuitable materials used in constructing the system; the system can also simply stop working because of its age. An SSTS that has been properly designed and installed, properly maintained, and used in the manner for which the system was designed can be expected to provide service for twenty to twenty-five years on average. Some parts of the SSTS such as alarms, switches, pumps, filters, etc. will most likely have to be repaired or replaced over the lifetime of the system.
- 5. A Compliance Inspection is not meant to be a test or inspection for longevity of the system; a Compliance Inspection is strictly for the purpose of determining if the SSTS is protective of public health and safety, as well as the groundwater at the date and time the inspection was performed. This inspection is not intended to determine if the SSTS was originally designed or installed to past or present MPCA or other Local Government Unit code requirements. This inspection is not intended to determine if the SSTS was designed and/or installed to support the anticipated flow from the building as the use of the building may have changed since the design and construction of the SSTS due to the addition of bedrooms, occupants, etc. In addition, this inspection is not intended to determine the quality of the original SSTS design, the quality of the construction practices used while installing the SSTS, or the quality of the materials used in constructing the SSTS.
- 6. Brian L. Humpal, Inc. cannot guarantee the performance of SSTS products/components such as: gravelless pipe, chamber trenches, effluent filters, tanks, sewage pre-treatment components, piping, etc. Products such as gravelless pipe are no longer approved for installation in the State of Minnesota and may have a significantly reduced performance and/or life expectancy.
- 7. WINTER WORK: By accepting this report, it is understood that inspections conducted during winter months (approximately November 1st through April 1st) are more difficult to perform because of possible snow cover and/or ground frost. SSTS components such as tanks, maintenance covers, tank inspection pipes, subsurface distribution medium inspection pipes, and soil treatment areas are more difficult or impossible to locate due to snow cover and/or ground frost. In addition, soil borings are more difficult to perform due to snow cover and/or ground frost. Brian L. Humpal, Inc. will attempt to use the same level of standards when performing work during winter periods as when performing work during non-winter periods. However, the recipient of this report understands that because of the aforementioned considerations, the same level of standards may not be possible.
- 8. By accepting this report, the client understands that Brian L. Humpal, Inc. will not be responsible for any monetary damages exceeding the fee for the services provided.

Subsurface Sewage Treatment Systems Non-transferable Business License

Inspect Minnesota, Midwest Soil Testing

License # L2896

License Expires: 12/22/2018

Issued: 10/10/2017

es:

Specialty Area(s):

Installer
Maintainer
Service Provider
Advanced Designer
Advanced Inspector

Designated Certified Individual(s):

Cert #	Name	Certification Expire
C9633	Anthony P Scully	7/28/2018
	Installer, Designer (Conditional)	
C5342	Brian L Humpal	10/15/2020
	Installer, Maintainer, Serv Prov,	Adv Designer, Adv Inspector
C9852	Christopher R Uebe	3/4/2018
	Designer, Inspector	



520 Lafayette Road North St. Paul, Minnesota 55155-4194 Charles & Thompson

Charles K Thompson, Supervisor Certification & Training Unit