Inspect Minnesota & Midwest Soil Testing

P.O. Box 10853 White Bear Lake, MN 55110 651-492-7550/Brian@Midwestsoiltesting.com

Brian Humpal MPCA Licensed Advanced Inspector

SUBSURFACE SEWAGE TREATMENT SYSTEM COMPLIANCE REPORT

Date: May 24, 2018 Time: 12:30 PM Owner: Chris & Kelly Cusick

Inspection Address: 12225 30th St S, Afton, MN 55001

REPORT SUMMARY

I have performed an "MPCA Compliance Inspection" on this system and have reviewed the history of the system with the owner, Chris Cusick. I have contacted Washington County and was advised that there are no records for this system. This very old system (installed in approximately 1969) consists of cesspool. Additional cesspool(s) and/or drainfield may exist beyond the first cesspool.

My inspection indicates that this system is presently "non-compliant" and is an imminent threat to public health and safety in accordance with MPCA rules 7080.1500 Subp.4(A) because of the effluent surfacing onto the ground and the cesspool(s).

In accordance with MPCA rules, I am sending a copy of this complete report to Washington County. I cannot officially speak on behalf of the County relative to the upgrade requirements of these non-compliant systems. Please contact the Washington County Department of Public Health & Environment (651-430-6655) to verify the County's position.

Please advise buyer, agents, lender, etc. to contact me should they have any questions regarding this system.

Brian Humpal Brian Humpal



Compliance Inspection Form

Existing Subsurface Sewage Treatment Systems (SSTS)

Doc Type: Compliance and Enforcement

Instructions: Inspection results based on Minnesota Pollution Control Agency (MP requirements and attached forms – additional local requirements may also apply.	CA) For local tracking purposes:
Submit completed form to Local Unit of Government (LUG) and system own	ar.
within 15 days	
System Status	
System status on date (mm/dd/yyyy):	
_	compliant – Notice of Noncompliance Upgrade Requirements on page 3)
Reason(s) for noncompliance (check all applicable) ☐ Impact on Public Health (Compliance Component #1) – Imminent thro ☐ Other Compliance Conditions (Compliance Component #3) – Imminent Tank Integrity (Compliance Component #2) – Failing to protect ground	nt threat to public health and safety
☐ Other Compliance Conditions (Compliance Component #3) – Failing t	
☐ Soil Separation (Compliance Component #4) – Failing to protect grou	
☐ Operating permit/monitoring plan requirements (Compliance Compon	ent #5) – Noncompliant
Property Information Parcel ID# or Sec/Twp/ Property address: 12225 30 th St S, Afton, MN 55001 Reas Property owner: Chris & Kelly Cusick Own	
Property Information Parcel ID# or Sec/Twp/ Property address: 12225 30 th St S, Afton, MN 55001 Reas Property owner: Chris & Kelly Cusick Own or	Range:son for inspection:Property Transfer er's phone:612-308-5671
Property Information Property address: 12225 30 th St S, Afton, MN 55001 Property owner: Chris & Kelly Cusick Own Or Owner's representative: Representative:	Range:son for inspection: Property Transfer
Property Information Property address: 12225 30 th St S, Afton, MN 55001 Property owner: Chris & Kelly Cusick Own Or Owner's representative: Representative:	Range: son for inspection: Property Transfer er's phone: 612-308-5671 esentative phone: ulatory authority phone: 651-430-6655
Property Information Property address: 12225 30 th St S, Afton, MN 55001 Property owner: Chris & Kelly Cusick Owner's representative: Local regulatory authority: Washington County Brief system description: Cesspool with possible additional cesspool(s) and/or Comments or recommendations:	Range: son for inspection: Property Transfer er's phone: 612-308-5671 esentative phone: 651-430-6655
Property Information Property address: 12225 30 th St S, Afton, MN 55001 Property owner: Chris & Kelly Cusick Owner's representative: Repribed additional cesspool (s) and/or Comments or recommendations: Certification I hereby certify that all the necessary information has been gathered to determine determination of future system performance has been nor can be made due to united.	Range: son for inspection: Property Transfer er's phone: 612-308-5671 essentative phone: ulatory authority phone: 651-430-6655 a drainfield.
Property Information Property address: 12225 30 th St S, Afton, MN 55001 Property owner: Chris & Kelly Cusick Owner's representative: Representative: Regulatory authority: Washington County Brief system description: Cesspool with possible additional cesspool(s) and/or Comments or recommendations: Certification I hereby certify that all the necessary information has been gathered to determine determination of future system performance has been nor can be made due to unipossible abuse of the system, inadequate maintenance, or future water usage.	Range: son for inspection: Property Transfer er's phone: 612-308-5671 essentative phone: ulatory authority phone: 651-430-6655 a drainfield.
Property Information Property address: 12225 30 th St S, Afton, MN 55001 Property owner: Chris & Kelly Cusick Own Or Owner's representative: Reprise system description: Cesspool with possible additional cesspool(s) and/or Comments or recommendations: Certification I hereby certify that all the necessary information has been gathered to determine determination of future system performance has been nor can be made due to unipossible abuse of the system, inadequate maintenance, or future water usage. Inspector name: Brian Humpal Cert Business name: Inspect Minnesota, Midwest Soil Testing	Range: son for inspection: Property Transfer er's phone: 612-308-5671 essentative phone: ulatory authority phone: 651-430-6655 a drainfield. the compliance status of this system. No known conditions during system construction,
Property Information Property address: 12225 30 th St S, Afton, MN 55001 Property owner: Chris & Kelly Cusick Own or Owner's representative: Represent additional cesspool (s) and/or Comments or recommendations: Certification I hereby certify that all the necessary information has been gathered to determine determination of future system, inadequate maintenance, or future water usage. Inspector name: Brian Humpal Certification Parcel ID# or Sec/Twp/ Read Own Read Own	Range: son for inspection: Property Transfer er's phone: 612-308-5671 essentative phone: ulatory authority phone: 651-430-6655 a drainfield. the compliance status of this system. No known conditions during system construction, fication number: L5342
Property Information Property address: 12225 30 th St S, Afton, MN 55001 Property owner: Chris & Kelly Cusick Ownor Owner's representative: Representative: Regulatory authority: Washington County Regulatory authority: Cesspool with possible additional cesspool(s) and/or Comments or recommendations: Certification I hereby certify that all the necessary information has been gathered to determine determination of future system performance has been nor can be made due to unipossible abuse of the system, inadequate maintenance, or future water usage. Inspector name: Brian Humpal Cert Business name: Inspect Minnesota, Midwest Soil Testing Inspector signature: Washington County Regulatory	Range: son for inspection: Property Transfer er's phone: 612-308-5671 essentative phone: ulatory authority phone: 651-430-6655 a drainfield. the compliance status of this system. No known conditions during system construction, fication number: L5342 License number: L2896
Property Information Property address: 12225 30 th St S, Afton, MN 55001 Property owner: Chris & Kelly Cusick Ownor Owner's representative: Reprivation County Regulatory authority: Washington County Regulatory authority: Cesspool with possible additional cesspool(s) and/or Comments or recommendations: Certification I hereby certify that all the necessary information has been gathered to determine determination of future system performance has been nor can be made due to unipossible abuse of the system, inadequate maintenance, or future water usage. Inspector name: Brian Humpal Cert Business name: Inspect Minnesota, Midwest Soil Testing Inspector signature: Aumpal Necessary or Locally Required Attachments	Range: son for inspection: Property Transfer er's phone: 612-308-5671 essentative phone: ulatory authority phone: 651-430-6655 a drainfield. the compliance status of this system. No known conditions during system construction, fication number: L5342 License number: L2896

www.pca.state.mn.us • 651-296-6300 • 800-657-3864 • TTY 651-282-5332 or 800-657-3864 • Available in alternative formats wq-wwists4-31 • 1/24/12 Page 1 of 3

Property address: 12225 30th St S, Afton, MN 55001

Inspector initials/Date: 5/24/2018

1.	lm	npact on Public Health – Cor	mpliance component #1 o	f 5	
	Co	ompliance criteria:		Verification method(s):	
		stem discharge sewage to the bund surface.	⊠ Yes □ No	☑ Searched for surface outlet☑ Searched for seeping in yard/backup in home	
		stem discharge sewage to drain tile surface waters.	☐ Yes ⊠ No	 ☑ Excessive ponding in soil system/D-boxes ☑ Homeowner testimony (See Comments/Explanation) ☐ "Black soil" above soil dispersal system 	
		rstem cause sewage backup into relling or establishment.	☐ Yes ⊠ No	System requires "emergency" pumping Performed dye test	
		ny "yes" answer above indicates the system is n Imminent Threat to Public Health and Safety.		☐ Unable to verify (See Comments/Explanation) ☐ Other methods not listed (See Comments/Explanation)	
	Сс	Comments/Explanation:			
	Му	/ inspection indicated effluent discharg	ing to the ground surface.		
2.	Ta	ank Integrity — Compliance com	ponent #2 of 5		
		ompliance criteria:		Verification method(s):	
		stem consists of a seepage pit,	⊠ Yes □ No	□ Probed tank(s) bottom	
	ce	sspool, drywell, or leaching pit.		☐ Examined construction records	
		epage pits meeting 7080.2550 may be mpliant if allowed in local ordinance.		Examined Tank Integrity Form (Attach)Observed liquid level below operating depth	
		ewage tank(s) leak below their signed operating depth.	☐ Yes ⊠ No	☐ Examined empty (pumped) tanks(s)	
	lf y	yes, which sewage tank(s) leaks:		☐ Probed outside tank(s) for "black soil"☐ Unable to verify (See Comments/Explanation)	
	Any "yes" answer above indicates the system is Failing to Protect Groundwater.			☐ Other methods not listed (See Comments/Explanation)	
	Сс	omments/Explanation:			
2	04	thar Camplianaa Canditiana	0		
3.	U	ther Compliance Conditions			
	a. Maintenance hole covers are damaged, cracked, unsecured, or appear to structurally unsound. 🗌 Yes* 🛛 No 🗎 Unkn				
 b. Other issues (electrical hazards, etc.) to immediately and adversely impact public health or safety. ☐ Yes* ☐ No *System is an imminent threat to public health and safety 					
 Explain: c. System is non-protective of ground water for other conditions as determined by inspector ☐ Yes* ☒ No *System is failing to protect groundwater 					
				termined by inspector ☐ Yes* ☒ No	
		Explain:			

www.pca.state.mn.us • 651-296-6300 • 800-657-3864 • TTY 651-282-5332 or 800-657-3864 • Available in alternative formats wq-wwists4-31 • 1/24/12 Page 2 of 3

Property address: 12225 30th St S, Afton, MN 55001		Inspector initials/Date: _5/24/2018		
4.	Soil Separation — Compliance compor	nent #4 of 5		
	Date of installation: 1969? Shoreland/Wellhead protection/Food Beverage Lodging? Compliance criteria:	_ ⊠ Unknown □ Yes ⊠ No	Verification method(s): Soil observation does not expire. Previous soil observations by two independent parties are sufficiunless site conditions have been altered or local	ient,
	For systems built prior to April 1, 1996, and not located in Shoreland or Wellhead Protection Area or not serving a food, beverage or lodging establishment: Drainfield has at least a two-foot vertical separation distance from periodically saturated soil or bedrock.	☐ Yes ☐ No	requirements differ. Conducted soil observation(s) (Attach boring logs) Two previous verifications (Attach boring logs) Not applicable (Holding tank(s), no drainfield) Unable to verify (See Comments/Explanation) Other (See Comments/Explanation)	;)
	Non-performance systems built April 1, 1996, or later or for non-performance systems located in Shoreland or Wellhead Protection Areas or serving a food, beverage, or lodging establishment: Drainfield has a three-foot vertical separation distance from periodically saturated soil or bedrock.*	☐ Yes ☐ No	Comments/Explanation:	
	"Experimental", "Other", or "Performance" systems built under pre-2008 Rules; Type IV or V systems built under 2008 Rules (7080. 2350 or 7080.2400 (Advanced Inspector License required) Drainfield meets the designed vertical separation distance from periodically saturated soil or bedrock.	☐ Yes ☐ No	A. Bottom of distribution media B. Periodically saturated soil/bedrock C. System separation	
5.	Any "no" answer above indicates to Failing to Protect Groundwater. Operating Permit and Nitrogen B	D. Required compliance separation* *May be reduced up to 15 percent if allowed by Loc Ordinance. mponent #5 of 5 Not applicable		
	Is the system operated under an Operating Per Is the system required to employ a Nitrogen BN BMP=Best Management Practice(s) specific of the answer to both questions is "no", Compliance criteria	IP? ☐ Yes ☑ Nied in the system design		
	Operating Permit number: Have the Operating Permit requirements by	been met?	☐ Yes ☐ No	
	b. Is the required nitrogen BMP in place and	properly functioning?	☐ Yes ☐ No	

Any "no" answer indicates Noncompliance.

Upgrade Requirements (Minn. Stat. § 115.55) An imminent threat to public health and safety (ITPHS) must be upgraded, replaced, or its use discontinued within ten months of receipt of this notice or within a shorter period if required by local ordinance. If the system is failing to protect ground water, the system must be upgraded, replaced, or its use discontinued within the time required by local ordinance. If an existing system is not failing as defined in law, and has at least two feet of design soil separation, then the system need not be upgraded, repaired, replaced, or its use discontinued, notwithstanding any local ordinance that is more strict. This provision does not apply to systems in shoreland areas, Wellhead Protection Areas, or those used in connection with food, beverage, and lodging establishments as defined in law.

www.pca.state.mn.us • 651-296-6300 • 800-657-3864 TTY 651-282-5332 or 800-657-3864 • Available in alternative formats Page 3 of 3


Inspect Minnesota & Midwest Soil Testing Subsurface Sewage Treatment System Owner/Property Information

This information will be used for the purpose of conducting an MPCA Compliance Inspection.

Date of Inspection: May 24, 2018	Time: 12:30 PM				
Property Address: 12225 30 th St S, Afton, MN Zip: 55001					
Property Owner: Chris & Kelly Cusick	Phone: 612-308-5671				
□ Septic □ Fiberglass □ Rock □ Aerobic □ Plastic □ Grave □ Lift □ Metal □ Cham	lless trench				
Are the tank maintenance covers accessible? \square Yes \boxtimes No *If no, proper maintenance must be performed through the maintenance holes. Maintenance hole covers should be made accessible to the ground surface to facilitate access and proper maintenance of the system.					
Year house built: 1969 Year septic installed:	1969? Tank size (gals.): 1000				
	Number of residents in home? 3-4				
Number of bedrooms? 3 Are all floors	drained by gravity? Y				
Garbage disposal? N W	hirlpool bath? N				
More than one system (laundry, etc.)? N					
Does this property have any footing drain tiles connected to the septic system? N Are any buildings on this property such as garages or out-buildings connected to this system? N					
Are there any additional systems on this property serving other buildings? N					
Location of septic system on lot? South Side					
Location of water well on lot? North Side	Is the well a deep well? Y				
Have you ever experienced any problems with the system such as: tree roots, sewage back-ups,					
surfacing of sewage onto the ground, septic tank overflowing, etc.; or have any repairs been made to the system? Y If yes, explain: 2011 & 2018 Repaired line from house to tank.					
When was the system last pumped? 2017	Name of pumper: Schlomka's				
How often pumped in previous years? Every 1					
Have you received notices from any government agency concerning this system? N					
Is your property located in a shoreland management area? N					
Do you have any additional information that should be given to the new owner? N					

I hereby certify that the above information is correct to the best of my knowledge. I also understand that if the system is considered "non-compliant/failing" per MPCA rules, that the inspector must by law submit a copy of this report to the local government unit within 15 days of the date of inspection completion. I also agree that unless otherwise noted in this report, that I/we are ultimately responsible for payment of all fees for all work performed relative to this inspection by Inspect Minnesota and Midwest Soil Testing.

Owner/Occupant: Chris Cusick's Signature On File Date: 5/24/2018

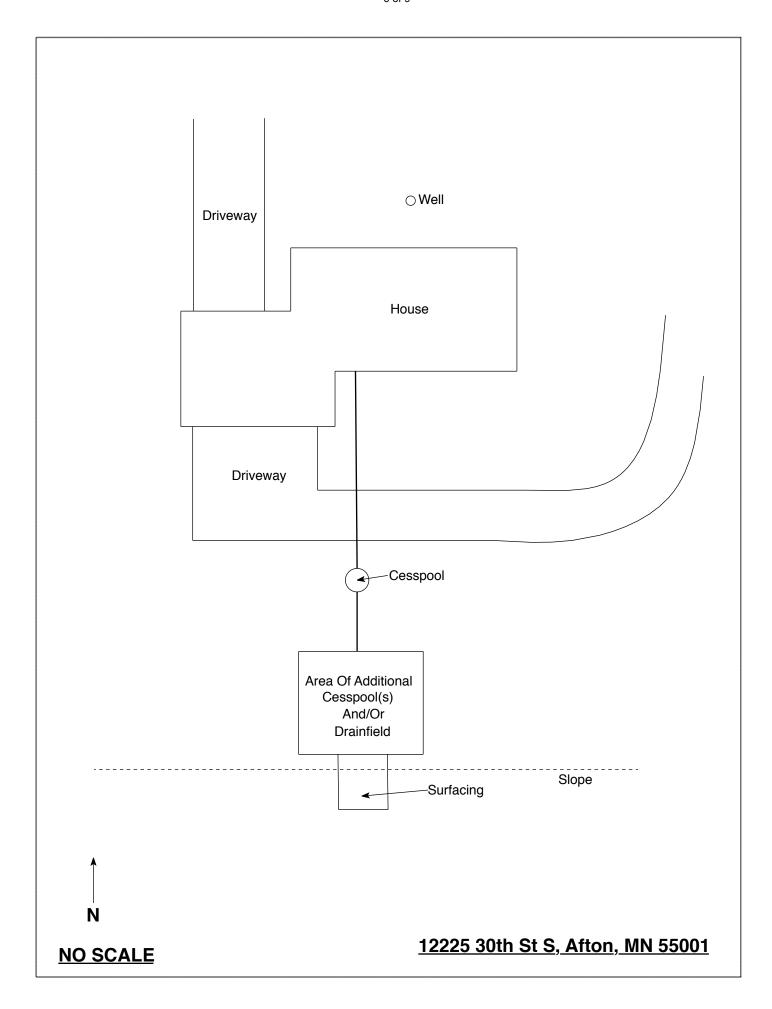



DISCLAIMER

Brian L. Humpal, Inc. dba. Inspect Minnesota, Midwest Soil Testing Relative to Subsurface Sewage Treatment System (SSTS) Compliance Inspections

- 1. This inspection/report is being performed for only the seller/owner of the property on which the SSTS is located. In such case that another party is paying for the inspection, the contract is between only said party and Brian L. Humpal, Inc.; there is no contract between Brian L. Humpal, Inc. and any other party unless otherwise noted.
- 3. Brian L. Humpal, Inc. has not been retained to warranty, guarantee, or certify the proper functioning of the SSTS for any period of time beyond the date of inspection or into the future. Because of the numerous factors (usage, maintenance, soil characteristics, previous failures, etc.) which may affect the proper operation of an SSTS, as well as the inability of Brian L. Humpal, Inc. to supervise or monitor the use or maintenance of the SSTS, the report shall not be construed as a warranty by Brian L. Humpal, Inc. that the SSTS will function properly for any particular party for any period of time.
- 4. Brian L. Humpal, Inc. is unable to verify the frequency and/or, quality of prior or future maintenance of the SSTS. Maintenance of the tank(s) must be performed through the tanks maintenance hole. The removal of solids from any location other than the maintenance hole is not a compliant method of maintenance. It is strongly recommended that maintenance covers be made accessible to the ground surface to facilitate proper maintenance.
- 5. Minimum Compliance Inspection requirements relative to this inspection and this report include <u>only</u> verification that the SSTS has tank(s) (septic tanks, lift tanks, dosing tanks, stilling tanks, etc.) which are watertight below the designed operating depth, the required separation between the bottom of the subsurface soil distribution medium and seasonally saturated soils, no back-ups of sewage into the dwelling, no discharge of sewage/effluent to the ground surface or surface waters, and no imminent safety hazards. Brian L. Humpal, Inc. does not inspect plumbing or pumps prior to the first SSTS component as these are plumbing components. The performance of exterior pumps and associated components are not inspected as they are considered to be maintenance items. Additionally, no indications relative to compliance with electrical code requirements have been made. It is recommended that any other applicable plumbing, electrical, housing, etc. inspections be performed by a qualified inspection business. Sewage back-up verification is limited to observing the floor drain area and/or the information supplied by the last occupants of the building prior to inspection. Brian L. Humpal, Inc. cannot guarantee that the information given to them by the last occupants of the building prior to inspection relative to back-ups is accurate.
- 4. Certification of this SSTS does not warranty future use beyond the date of the inspection. Any SSTS, old or new, can become hydraulically overloaded or discharge sewage/effluent to the ground surface as a result of more people moving into the house than were previously occupying the house, improper maintenance, heavy usage, leaking plumbing fixtures, groundwater infiltration, tree roots, freezing conditions, surface drainage problems, poor initial design, poor construction practices, or unsuitable materials used in constructing the system; the system can also simply stop working because of its age. An SSTS that has been properly designed and installed, properly maintained, and used in the manner for which the system was designed can be expected to provide service for twenty to twenty-five years on average. Some parts of the SSTS such as alarms, switches, pumps, filters, etc. will most likely have to be repaired or replaced over the lifetime of the system.
- 5. A Compliance Inspection is not meant to be a test or inspection for longevity of the system; a Compliance Inspection is strictly for the purpose of determining if the SSTS is protective of public health and safety, as well as the groundwater at the date and time the inspection was performed. This inspection is not intended to determine if the SSTS was originally designed or installed to past or present MPCA or other Local Government Unit code requirements. This inspection is not intended to determine if the SSTS was designed and/or installed to support the anticipated flow from the building as the use of the building may have changed since the design and construction of the SSTS due to the addition of bedrooms, occupants, etc. In addition, this inspection is not intended to determine the quality of the original SSTS design, the quality of the construction practices used while installing the SSTS, or the quality of the materials used in constructing the SSTS.
- 6. Brian L. Humpal, Inc. cannot guarantee the performance of SSTS products/components such as: gravelless pipe, chamber trenches, effluent filters, tanks, sewage pre-treatment components, piping, etc. Products such as gravelless pipe are no longer approved for installation in the State of Minnesota and may have a significantly reduced performance and/or life expectancy.
- 7. WINTER WORK: By accepting this report, it is understood that inspections conducted during winter months (approximately November 1st through April 1st) are more difficult to perform because of possible snow cover and/or ground frost. SSTS components such as tanks, maintenance covers, tank inspection pipes, subsurface distribution medium inspection pipes, and soil treatment areas are more difficult or impossible to locate due to snow cover and/or ground frost. In addition, soil borings are more difficult to perform due to snow cover and/or ground frost. Brian L. Humpal, Inc. will attempt to use the same level of standards when performing work during winter periods as when performing work during non-winter periods. However, the recipient of this report understands that because of the aforementioned considerations, the same level of standards may not be possible.
- 8. By accepting this report, the client understands that Brian L. Humpal, Inc. will not be responsible for any monetary damages exceeding the fee for the services provided.

Subsurface Sewage Treatment Systems Non-transferable Business License

Inspect Minnesota, Midwest Soil Testing

License # L2896

License Expires: 12/22/2018

Issued: 10/10/2017

es:

Specialty Area(s):

Installer
Maintainer
Service Provider
Advanced Designer
Advanced Inspector

Designated Certified Individual(s):

Cert #	Name	Certification Expire	
C9633	Anthony P Scully	7/28/2018	
	Installer, Designer (Conditional)		
C5342	Brian L Humpal	10/15/2020	
	Installer, Maintainer, Serv Prov, Adv Designer, Adv Inspector		
C9852	Christopher R Uebe	3/4/2018	
	Designer, Inspector		



520 Lafayette Road North St. Paul, Minnesota 55155-4194 Charles & Thompson

Charles K Thompson, Supervisor Certification & Training Unit