Inspect Minnesota & Midwest Soil Testing				
P.O. Box 383 Hugo, MN 55038 Brian Humpal				
651-492-7550/Brian@midv	vestsoiltesting.com	MPCA Licensed Designer & Inspector		
SUBSURFACE SEWAGE TREATMENT SYSTEM COMPLIANCE REPORT				
Date: April 26, 2016	<b>Time:</b> 2:30 PM	<b>Owner:</b> Real Estate Owned		
Inspection Address: 14364 15th St N, Stillwater, MN 55082				
	<b>REPORT SUN</b>	IMARY		

I have performed an "MPCA Compliance Inspection" on this septic system and have reviewed the original design/permit records on file at Washington County. This system consists of two pre-cast septic tanks and a gravelless trench drainfield. This house is presently vacant.

My inspection indicates that this system is presently "non-compliant" in accordance with MPCA rules 7080.1500 Subp.4(B)(D) because of the lack of the required three foot separation between the bottom of the drainfield and seasonally saturated soils. This system is not an imminent threat to public health or safety per MPCA rule 7080.1500 Subp. 4(A). Washington County issued sewage treatment permit #0017-98040 for the installation of this septic system.

In accordance with MPCA rules, I am sending a copy of this complete report to Washington County. I cannot officially speak on behalf of the County relative to the upgrade requirements of these non-compliant systems. Please contact Washington County Environmental Specialist, Mr. Chris LeClair (651-430-4052), to verify the County's position.

Please advise buyer, agents, lender, etc. to contact me should they have any questions regarding this system.

Brian Humpal

Brian Humpal

lution Control Agency (MPCA) ements may also apply. t <b>(LUG) and system owner</b>	For local tracking purposes:		
nce 🛛 Noncon	npliant – Notice of Noncompliance rade Requirements on page 3)		
	ements may also apply. : (LUG) and system owner 116 Ince  Noncon		

### Reason(s) for noncompliance (check all applicable)

- □ Impact on Public Health (Compliance Component #1) Imminent threat to public health and safety
- Other Compliance Conditions (Compliance Component #3) Imminent threat to public health and safety
- Tank Integrity (Compliance Component #2) Failing to protect groundwater
- Other Compliance Conditions (Compliance Component #3) Failing to protect groundwater
- Soil Separation (Compliance Component #4) Failing to protect groundwater
- Operating permit/monitoring plan requirements (Compliance Component #5) Noncompliant

### **Property Information**

Parcel ID# or Sec/Twp/Range:

Property address: 14364	15th St N, Stillwater, MN 55082	Reason for inspection: Property Sale
Property owner: Real Es	state Owned	Owner's phone: Unknown
or		
Owner's representative:	Clint Smith (Buyer)	Representative phone: 612-309-0865
Local regulatory authority:	Washington County	Regulatory authority phone: _651-430-4052
Brief system description:	_Two pre-cast septic tanks and a gravelless trend	ch drainfield.
Comments or recommendation	ations:	

Certification

I hereby certify that all the necessary information has been gathered to determine the compliance status of this system. No determination of future system performance has been nor can be made due to unknown conditions during system construction, possible abuse of the system, inadequate maintenance, or future water usage.

Inspector name:	Brian Humpal	Certification number:	L5342
Business name:	Inspect Minnesota, Midwest Soil Testing	License number:	L2896
Inspector signatur	: Brian Humpal	Phone number:	651-492-7550

### **Necessary or Locally Required Attachments**

🛛 Soil boring logs	System/As-built drawing	Forms per local ordinance
Other information (list):	Report Summary, Property Informa	ation, Disclaimer, License

### 1. Impact on Public Health – Compliance component #1 of 5

# Compliance criteria: System discharge sewage to the ground surface. System discharge sewage to drain tile or surface waters. System cause sewage backup into dwelling or establishment.

### Any "yes" answer above indicates the system is an Imminent Threat to Public Health and Safety.

Comments/Explanation:

None of the above found.

### Verification method(s):

- Searched for surface outlet
- Searched for seeping in yard/backup in home
- Excessive ponding in soil system/D-boxes
- Homeowner testimony (See Comments/Explanation)
- "Black soil" above soil dispersal system
- System requires "emergency" pumping
- Performed dye test
- Unable to verify (See Comments/Explanation)
- Other methods not listed (See Comments/Explanation)

### 2. Tank Integrity - Compliance component #2 of 5

### **Compliance criteria:**

System consists of a seepage pit, cesspool, drywell, or leaching pit.	🗌 Yes	🛛 No
Seepage pits meeting 7080.2550 may be compliant if allowed in local ordinance.		
Sewage tank(s) leak below their designed operating depth.	🗌 Yes	🛛 No
If yes, which sewage tank(s) leaks:		

# Any "yes" answer above indicates the system is Failing to Protect Groundwater.

Comments/Explanation:

Lowered underwater camera into tanks - baffles and tank walls OK. House vacant - tanks at operating level.

### Verification method(s):

- Probed tank(s) bottom
- Examined construction records
- Examined Tank Integrity Form (Attach)
- Observed liquid level below operating depth
- Examined empty (pumped) tanks(s)
- Probed outside tank(s) for "black soil"
- Unable to verify (See Comments/Explanation)
- Other methods not listed (See Comments/Explanation)

### 3. Other Compliance Conditions – Compliance component #3 of 5

- a. Maintenance hole covers are damaged, cracked, unsecured, or appear to structurally unsound. 🗌 Yes\* 🛛 No 🗌 Unknown
- b. Other issues (*electrical hazards, etc.*) to immediately and adversely impact public health or safety.  $\Box$  Yes\*  $\boxtimes$  No  $\Box$  Unknown \*System is an imminent threat to public health and safety

Explain:

c. System is non-protective of ground water for other conditions as determined by inspector □ Yes\* ⊠ No \*System is failing to protect groundwater

Explain:

### **4. Soil Separation** – Compliance component #4 of 5

Date of installation: 1998	Unkn	own	Verification method(s):	
Shoreland/Wellhead protection/Food Beverage Lodging?	🗌 Yes	🖾 No	Soil observation does not expire. Pl observations by two independent pa	
Compliance criteria:	1		unless site conditions have been al	
For systems built prior to April 1, 1996, and not located in Shoreland or Wellhead Protection Area or not serving a food, beverage or lodging establishment:	☐ Yes	□ No	<ul> <li>requirements differ.</li> <li>Conducted soil observation(s) (Attach boring log</li> <li>Two previous verifications (Attach boring logs)</li> <li>Not applicable (Holding tank(s), no drainfield)</li> </ul>	
Drainfield has at least a two-foot vertical separation distance from periodically saturated soil or bedrock.			<ul> <li>Unable to verify (See Comments/</li> <li>Other (See Comments/Explanation</li> </ul>	
Non-performance systems built April 1, 1996, or later or for non-performance systems located in Shoreland or Wellhead Protection Areas or serving a food, beverage, or lodging establishment:	🗌 Yes	🛛 No	Comments/Explanation:	
Drainfield has a three-foot vertical separation distance from periodically saturated soil or bedrock.*				
"Experimental", "Other", or "Performance"	🗌 Yes	□ No In	Indicate depths of elevations	
systems built under pre-2008 Rules; Type IV or V systems built under 2008 Rules (7080. 2350 or 7080.2400 (Advanced Inspector License required)			A. Bottom of distribution media	See Attached Boring Log(s)
Drainfield meets the designed vertical			B. Periodically saturated soil/bedrock	
separation distance from periodically saturated soil or bedrock.			C. System separation	
			D. Required compliance separation*	
Any "no" answer above indicates the Failing to Protect Groundwater.	he syste	em is	*May be reduced up to 15 percent if allowed by Local Ordinance.	
Operating Permit and Nitrogen B	<b>MP*</b> – C	ompliance c	omponent #5 of 5 🛛 🖂 Not app	licable
Is the system operated under an Operating Per	mit?	🗌 Yes 🛛	No If "yes", A below is required	
Is the system required to employ a Nitrogen BM	1P?	🗌 Yes 🛛	No If "yes", B below is required	
BMP=Best Management Practice(s) specifi	ïed in the s	system design	ו	
If the answer to both questions is "no",	this sec	tion does no	ot need to be completed.	
Compliance criteria				
a. Operating Permit number:				
Have the Operating Permit requirements been met?			Yes No	

### Any "no" answer indicates Noncompliance.

b. Is the required nitrogen BMP in place and properly functioning?

**Upgrade Requirements** (*Minn. Stat.* § 115.55) *An imminent threat to public health and safety (ITPHS) must be upgraded, replaced, or its use discontinued within ten months of receipt of this notice or within a shorter period if required by local ordinance. If the system is failing to protect ground water, the system must be upgraded, replaced, or its use discontinued within the time required by local ordinance. If an existing system is not failing as defined in law, and has at least two feet of design soil separation, then the system need not be upgraded, replaced, or its use discontinued, notwithstanding any local ordinance that is more strict. This provision does not apply to systems in shoreland areas, Wellhead Protection Areas, or those used in connection with food, beverage, and lodging establishments as defined in law.* 

☐ Yes ☐ No

GTON	WASHINGTO	N COUNTY, MINNES			
		of Health, Environme			
	-	-	•	DRAINFIELD REPLACEMENT PERNIT	70.00
ANTINE MODEL		nagement 612/430-	6708	SEPTIC APPLICATION/SOIL REVIEW	
		LAND TOWNSHIP NAGE PERHIT		Total Feen :	220.00
PERMIT NUMBER	001130040 201	TRAC PERMIT		Total Paid :	.00
<b>A 1 1 1 1 1</b>	446 MAT 3				220.00
Gwmen 1		HARRIS		Total Due :	220.00
	14864 15TH BT I				
	STILLWATER	NHI 55082			ť
Applicant :	T000	FEATHERSTONE EXCAV	612-436-1987		
					•
					•
					·
		PERHISSION	TO HEREBY GRANTE	۶D	-
To execute the	WORK BRACIPIAN I	n this permit on the fo			•
	•	•	-	1) conform in all respects	(
	•			e 4 4. παγματικό ματα το π. αποτική τη απομηγιατώς και π.	
•		ng Code, and/or Ordinan			
,	-	ly time upon the violat	ion of any of the	provisions of said code	
nd ordinances	•				
Project Addres			BTILLMATER	Mei 55062	
.egel Descript	ton:PT OF HE1/4 OF	7 四日174	282920 BELHG TH	IE W 298-2 FT OP Geo : 28-	-029-20-31-0011
Tow Capacity	600 Ga1/Day	y Tank Volume 2000	•		
Soft Condition	e: Depth to Rest	riction 54 Inches	Perc Rate	6 Nin/Inch	
Boil Treatment	Type:				
Bottom Area	1200 Rock Der	oth 12			
Authorized War	k / Special Condi	tione			
		Hage treatment system a	* New Section		
		-			
	gii ili arwa cascati	and shown on site plan	•		
++ Permit Expi	ration Data :	Sevage Treatment : 19	0		
er rærært, uxpr	ISUIUTI VALT (	ынтаун ( <b>тажыла</b> ны) ( 13	ee"uuruc		
			0 00100 VA		
		SE REQUESTED AND ISSUE	O MATON LO ARE ON	OCCUPANCY OF WORK PERMITTED	
SY A BUTLDING					
•	•			by the Building Permit is not	
commenced with	in 60 days of the	date of issuance or if	work is abandons	d or suzpanded for a partod of	
120 days. Ter	w of the Building	Permit is 12 months fr	on date of issue.	Term of sevage treatment	
mermit is 12 m	onthe from date of	issue.			
			ding code: Fine n	ot to exceed five hundred	
	•	int for not more than h	-		
normals (4042)		anna a Mar A 1999 na 2007 na 200 19 200 19 20			
		Code Enforcement Offic	·· Plan	17.1	
*#F#16 £88U# ()	LUA 1990~V0~02	COMPERIEDRE OFFIC			
				•	
			5 of 10		

FILE

## Inspect Minnesota & Midwest Soil Testing


### Subsurface Sewage Treatment System Owner/Property Information

This information will be used for the purpose of conducting an MPCA Compliance Inspection.

Date of Inspection: April 26, 2016	Time: 2:30 PM					
Property Address: 14364 15th St N, Stillwater, MN	Zip: 55082					
Property Owner: Real Estate Owned	Phone: Unknown					
1 1	atment System Other					
Septic 2FiberglassRockAerobicPlasticSepticLiftMetalChanHoldingConcreteSeepa	trench       Alternative system         elless trench       Experimental system         aber trench       Cesspool system         age bed       Other system					
Other: Block Mour Other At-gr.						
Are the tank maintenance covers accessible? $\boxtimes$ Ye performed through the maintenance holes. Mainten the ground surface to facilitate access and proper matrix	s $\square$ No *If no, proper maintenance must be ance hole covers should be made accessible to					
Year house built: 1968 Year septic installed:	1998 Tank size (gals.): 2-1000					
How long has seller owned the property?	Number of residents in home?					
Number of bedrooms? 2 Are all floor	s drained by gravity? Y					
Garbage disposal? W	hirlpool bath?					
More than one system (laundry, etc.)?						
Does this property have any footing drain tiles conn	ected to the septic system?					
Are any buildings on this property such as garages or out-buildings connected to this system?						
Are there any additional systems on this property se	rving other buildings?					
Location of septic system on lot? East Side						
Location of water well on lot? Southeast Side Is the well a deep well? Y						
Have you ever experienced any problems with the system such as: tree roots, sewage back-ups, surfacing of sewage onto the ground, septic tank overflowing, etc.; or have any repairs been made to the system? If yes, explain:						
When was the system last pumped?	Name of pumper:					
How often pumped in previous years? Is system on a monitoring plan?						
Have you received notices from any government agency concerning this system?						
Is your property located in a shoreland management area? N						
Do you have any additional information that should						

I hereby certify that the above information is correct to the best of my knowledge. I also understand that if the system is considered "non-compliant/failing" per MPCA rules, that the inspector must by law submit a copy of this report to the local government unit within 15 days of the date of inspection completion. I also agree that unless otherwise noted in this report, that I/we are ultimately responsible for payment of all fees for all work performed relative to this inspection by Inspect Minnesota and Midwest Soil Testing.

Owner/Occupant: Real Estate Owned

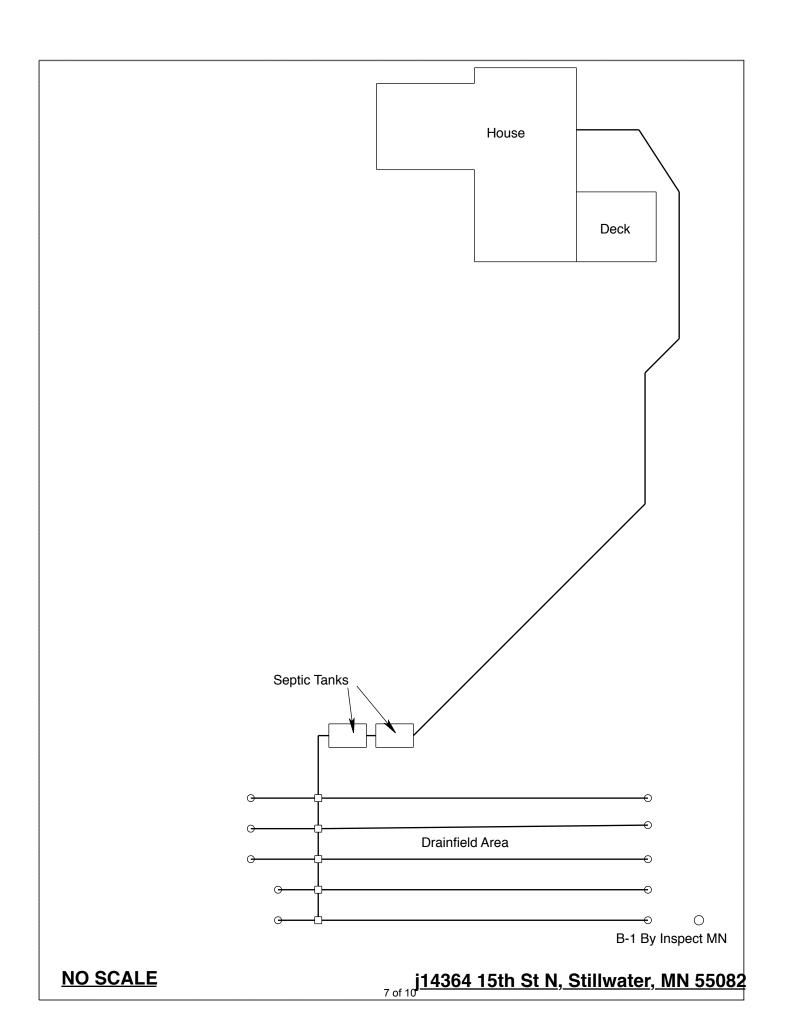

# Log Of Soil Borings

Location of Project: 14364 15th St N, Stillwater, MN 55082					
Borings Made By: Inspect Minnesota					4/26/16
		Hand/Bucket	Classi	fication System:	USDA
Bo	pring Number:	1		Boring Number:	
Surface Elevation of Boring	Same grou	und surface as last nfield trench	Surface Elevation Boring		
Depth In Inches	<u>Soils E</u>	ncountered	Depth In Inches	Soils En	countered
0-11 11-38 38-52 2.5	10YR	2/2 Loam 3/3 Loam (Unconsolidated Bedrock)			
38" De	pth To End Of B	oring Or Bedrock		Depth To End Of Bo	oring Or Redox
Same Ele	Elevation Of Boring Relative To System			Elevation Of Boring	Relative To System
	pth To Bottom ( Separation	Of Distribution Media		Depth To Bottom O Of Separation	f Distribution Media
En	d Of Boring At:	52"		End Of Boring At:	
	ock Present At:	38"		Redox Present At:	
	Standing Water Present At: None			Water Present At:	

Bottom Of Distribution Medium At: 23 Inches

# **DISCLAIMER**

### Brian L. Humpal, Inc. dba. Inspect Minnesota, Midwest Soil Testing

### Relative to Subsurface Sewage Treatment System (SSTS) Compliance Inspections

- 1. This inspection/report is being performed for only the seller/owner of the property on which the SSTS is located. In such case that another party is paying for the inspection, the contract is between only said party and Brian L. Humpal, Inc.; there is no contract between Brian L. Humpal, Inc. and any other party unless otherwise noted.
- 3. Brian L. Humpal, Inc. has not been retained to warranty, guarantee, or certify the proper functioning of the SSTS for any period of time beyond the date of inspection or into the future. Because of the numerous factors (usage, maintenance, soil characteristics, previous failures, etc.) which may affect the proper operation of an SSTS, as well as the inability of Brian L. Humpal, Inc. to supervise or monitor the use or maintenance of the SSTS, the report shall not be construed as a warranty by Brian L. Humpal, Inc. that the SSTS will function properly for any particular party for any period of time.
- 4. Brian L. Humpal, Inc. is unable to verify the frequency and/or, quality of prior or future maintenance of the SSTS. Maintenance of the tank(s) must be performed through the tanks maintenance hole. The removal of solids from any location other than the maintenance hole is not a compliant method of maintenance. It is strongly recommended that maintenance covers be made accessible to the ground surface to facilitate proper maintenance.
- 5. Minimum Compliance Inspection requirements relative to this inspection and this report include <u>only</u> verification that the SSTS has tank(s) (septic tanks, lift tanks, dosing tanks, stilling tanks, etc.) which are watertight below the designed operating depth, the required separation between the bottom of the subsurface soil distribution medium and seasonally saturated soils, no back-ups of sewage into the dwelling, no discharge of sewage/effluent to the ground surface or surface waters, and no imminent safety hazards. Brian L. Humpal, Inc. does not inspect plumbing or pumps prior to the first SSTS component as these are plumbing components. The performance of exterior pumps and associated components are not inspected as they are considered to be maintenance items. Additionally, no indications relative to compliance with electrical code requirements have been made. It is recommended that any other applicable plumbing, electrical, housing, etc. inspections be performed by a qualified inspection business. Sewage back-up verification is limited to observing the floor drain area and/or the information supplied by the last occupants of the building prior to inspection. Brian L. Humpal, Inc. cannot guarantee that the information given to them by the last occupants of the building prior to inspection relative to back-ups is accurate.
- 4. Certification of this SSTS does not warranty future use beyond the date of the inspection. Any SSTS, old or new, can become hydraulically overloaded or discharge sewage/effluent to the ground surface as a result of more people moving into the house than were previously occupying the house, improper maintenance, heavy usage, leaking plumbing fixtures, groundwater infiltration, tree roots, freezing conditions, surface drainage problems, poor initial design, poor construction practices, or unsuitable materials used in constructing the system; the system can also simply stop working because of its age. An SSTS that has been properly designed and installed, properly maintained, and used in the manner for which the system was designed can be expected to provide service for twenty to twenty-five years on average. Some parts of the SSTS such as alarms, switches, pumps, filters, etc. will most likely have to be repaired or replaced over the lifetime of the system.
- 5. A Compliance Inspection is not meant to be a test or inspection for longevity of the system; a Compliance Inspection is strictly for the purpose of determining if the SSTS is protective of public health and safety, as well as the groundwater at the date and time the inspection was performed. This inspection is not intended to determine if the SSTS was originally designed or installed to past or present MPCA or other Local Government Unit code requirements. This inspection is not intended to determine if the SSTS was designed and/or installed to support the anticipated flow from the building as the use of the building may have changed since the design and construction of the SSTS due to the addition of bedrooms, occupants, etc. In addition, this inspection is not intended to determine the quality of the original SSTS design, the quality of the construction practices used while installing the SSTS, or the quality of the materials used in constructing the SSTS.
- 6. Brian L. Humpal, Inc. cannot guarantee the performance of SSTS products/components such as: gravelless pipe, chamber trenches, effluent filters, tanks, sewage pre-treatment components, piping, etc. Products such as gravelless pipe are no longer approved for installation in the State of Minnesota and may have a significantly reduced performance and/or life expectancy.
- 7. WINTER WORK: By accepting this report, it is understood that inspections conducted during winter months (approximately November 1<sup>st</sup> through April 1<sup>st</sup>) are more difficult to perform because of possible snow cover and/or ground frost. SSTS components such as tanks, maintenance covers, tank inspection pipes, subsurface distribution medium inspection pipes, and soil treatment areas are more difficult or impossible to locate due to snow cover and/or ground frost. In addition, soil borings are more difficult to perform due to snow cover and/or ground frost. Brian L. Humpal, Inc. will attempt to use the same level of standards when performing work during winter periods as when performing work during non-winter periods. However, the recipient of this report understands that because of the aforementioned considerations, the same level of standards may not be possible.
- 8. By accepting this report, the client understands that Brian L. Humpal, Inc. will not be responsible for any monetary damages exceeding the fee for the services provided.

Subsurface Sewage Treatment Systems



Non-transferable

# License # L2896

Adv Inspector License Expires: Adv Designer License Expires: Maintainer License Expires: Installer License Expires: Date of Issuance:

Oct 28, 2015 Dec 22, 2016 Dec 22, 2016 Dec 22, 2016 Dec 22, 2016

# **Inspect Minnesota, Midwest Soil Testing**

	10/15/2017	<u> </u>			03/04/2018	
--	------------	----------	--	--	------------	--

Ä

**Minnesota Pollution Control Agency** 

520 Lafayette Road North St. Paul, Minnesota 55155-4194

Steven Giddings Manager Environmental Business Assistance Section