1 of 10

# **Inspect Minnesota & Midwest Soil Testing**

P.O. Box 10853 White Bea	ar Lake, MN 55110	Brian Humpal
651-492-7550/Brian@Midy	westsoiltesting.com	MPCA Licensed Advanced Inspector
SUBSURFACE SEWAGE	TREATMENT SYS	STEM (SSTS) COMPLIANCE REPORT
Date: February 12, 2019	<b>Time:</b> 12:15 PM	Owner: Desiree & Taylor Young
Inspection Address: 8788 Grey	Cloud Island Dr, Grey	Cloud Twp Site Conditions: 2' Snow N/A Frost

#### **REPORT SUMMARY**

I have performed an "MPCA Compliance Inspection" on this system and have reviewed the original design/permit records, along with a previous compliance inspection from 2015, which were on file at Washington County. This system consists of two pre-cast septic tanks, a pre-cast lift tank, and a seepage bed.

It should be noted that the septic tanks are currently due for maintenance pumping and should be pumped when possible in the spring of 2019.

Predicated on my inspection of the system and my review of the original design/permit records, it is my opinion that this system <u>presently meets</u> MPCA minimum compliance inspection requirements.

Inspect Minnesota and Midwest Soil Testing have been hired to perform a compliance inspection of this SSTS for compliance with local ordinances pursuant to Minn. Stat. § 115.55 (2013). This compliance inspection covers only the criteria required by Minn. Stat. § 115.55 Subd. 5a (2013) and Minn. R. 7080.1500 (2011). A compliance inspection is an indication of the current compliance status of the system and does not guarantee the performance or longevity of this system beyond the date of inspection, as it is impossible to determine the future performance of any system. Inspect Minnesota and Midwest Soil Testing disclaim any use of this compliance inspection beyond determining SSTS compliance pursuant to Minn. Stat. § 115.55 Subd. 5a (2013) and Minn. R. 7080.1500 (2011).

Please contact me should you have any questions.

Christopher Uebe

Brian Humpal

Brian Humpal

2 of 10



St. Paul, MN 55155-4194

# **Compliance Inspection Form**

#### **Existing Subsurface Sewage Treatment Systems**

(SSTS)

Doc Type: Compliance and Enforcement

Instructions: Inspection results based on Minnesota Pollution Control Agency (MPCA)	For local tracking purposes:
requirements and attached forms – additional local requirements may also apply.	

Submit completed form to Local Unit of Government (LUG) and system owner within 15 days

#### System Status

System status on date (mm/dd/yyyy): 2/12/2019

#### Compliant – Certificate of Compliance

(Valid for 3 years from report date, unless shorter time frame outlined in Local Ordinance.)

#### Noncompliant – Notice of Noncompliance

(See Upgrade Requirements on page 3)

#### Reason(s) for noncompliance (check all applicable)

Impact on Public Health (Compliance Component #1) – Imminent threat to public health and safety

Other Compliance Conditions (Compliance Component #3) – Imminent threat to public health and safety

Tank Integrity (Compliance Component #2) – Failing to protect groundwater

□ Other Compliance Conditions (Compliance Component #3) – Failing to protect groundwater

Soil Separation (Compliance Component #4) – Failing to protect groundwater

Operating permit/monitoring plan requirements (Compliance Component #5) – Noncompliant

#### **Property Information**

Parcel ID# or Sec/Twp/Range:

Property address:	8788 Grey Cloud Island Dr, Grey Cloud Twp, MN	Reason for inspection: Property Transfer		
Property owner:	Desiree & Taylor Young	Owner's phone: 612-239-2605		
or				
Owner's represent	ative:	Representative phone:		
Local regulatory au	uthority: Washington County	Regulatory authority phone: 651-430-6655		
Brief system descr	iption: Two pre-cast septic tanks, a pre-cast lift ta	Two pre-cast septic tanks, a pre-cast lift tank, and a seepage bed.		

Comments or recommendations:

It should be noted that the septic tanks are currently due for maintenance pumping and should be pumped when possible in the spring of 2019.

#### Certification

I hereby certify that all the necessary information has been gathered to determine the compliance status of this system. No determination of future system performance has been nor can be made due to unknown conditions during system construction, possible abuse of the system, inadequate maintenance, or future water usage.

Inspector name:	Brian Hum	pal/Christopher Uebe		Certification number:	C5342/C9852	
Business name:	Inspect Mir	nnesota, Midwest Soil Testing		License number:	L2896	
Inspector signature	e:2	Zian Humpal Afre Mu	/	Phone number:	651-492-7550	
Necessary or	Locally I	Required Attachments				
🛛 Soil boring lo	gs	System/As-built drawing		Forms per local ordinar	ice	
🛛 Other informa	ation (list):	Report Summary, Property Inform	nation, Dis	claimer, License		

### 1. Impact on Public Health – Compliance component #1 of 5

Property address: 8788 Grey Cloud Island Dr, Grey Cloud Twp, MN

Compliance criteria:		Verification method(s):
System discharge sewage to the ground surface.	🗌 Yes 🛛 No	<ul> <li>Searched for surface outlet</li> <li>Searched for seeping in yard/backup in home</li> </ul>
System discharge sewage to drain tile or surface waters.	🗌 Yes 🖾 No	<ul> <li>Excessive ponding in soil system/D-boxes</li> <li>Homeowner testimony (See Comments/Explanation)</li> </ul>
System cause sewage backup into dwelling or establishment.	🗌 Yes 🖾 No	<ul> <li>"Black soil" above soil dispersal system</li> <li>System requires "emergency" pumping</li> <li>Performed dye test</li> </ul>
Any "yes" answer above indicates the system is an Imminent Threat to Public Health and Safety.		<ul> <li>I enormed uye test</li> <li>Unable to verify (See Comments/Explanation)</li> <li>Other methods not listed (See Comments/Explanation)</li> </ul>

#### 2. Tank Integrity – Compliance component #2 of 5

Compliance criteria:		Verification method(s):	
System consists of a seepage pit,	🗌 Yes 🖾 No	Probed tank(s) bottom	
cesspool, drywell, or leaching pit.		Examined construction records	
Seepage pits meeting 7080.2550 may be		Examined Tank Integrity Form (Attach)	
compliant if allowed in local ordinance.		Observed liquid level below operating depth	
Sewage tank(s) leak below their designed operating depth.	🗌 Yes 🖾 No	Examined empty (pumped) tanks(s)	
If yes, which sewage tank(s) leaks:		Probed outside tank(s) for "black soil"	
Any "yes" answer above indicates the system is Failing to Protect Groundwater.		<ul> <li>Unable to verify (See Comments/Explanation)</li> <li>Other methods not listed (See Comments/Explanation)</li> </ul>	

Comments/Explanation:

Comments/Explanation: None of the above found.

Lowered underwater camera into tanks - baffles and tank walls OK.

Lift pump and alarm were operational at the time of the inspection.

It should be noted that the septic tanks are currently due for maintenance pumping and should be pumped when possible in the spring of 2019.

#### 3. Other Compliance Conditions - Compliance component #3 of 5

a.	Maintenance hole covers are damaged, cracked, unsecured, or appear to structurally unsound.   Yes*  No  Unknow	'n
b.	Other issues <i>(electrical hazards, etc.)</i> to immediately and adversely impact public health or safety.  Yes*  No Unknow <b>*System is an imminent threat to public health and safety</b>	/n
	Explain:	
C.	System is non-protective of ground water for other conditions as determined by inspector Uses* INo *System is failing to protect groundwater	

Explain:

#### **4. Soil Separation** – Compliance component #4 of 5

Date of installation: 2010	🗌 Unkr	nown	Verification met	hod(s):		
Shoreland/Wellhead protection/Food Beverage Lodging?	🗌 Yes	🛛 No	Soil observation do observations by two			
Compliance criteria:			unless site conditio		ered or local	
For systems built prior to April 1, 1996, and not located in Shoreland or Wellhead Protection Area or not serving a food, beverage or lodging establishment:	☐ Yes	🗌 No	☐ Conducted soil ☑ Two previous v	<ul> <li>requirements differ.</li> <li>Conducted soil observation(s) (Attach is a conducted soil observation(s) (Attach is a conducted soil observation) (Attach borin)</li> <li>Two previous verifications (Attach borin)</li> <li>Not applicable (Holding tank(s), no drain)</li> </ul>		
Drainfield has at least a two-foot vertical separation distance from periodically saturated soil or bedrock.			<ul> <li>☐ Unable to verify</li> <li>△ Other (See Com</li> </ul>			
Non-performance systems built April 1,	🛛 Yes	🗌 No	Comments/Explana	ation:		
1996, or later or for non-performance systems located in Shoreland or Wellhead			Reviewed previous	compliance insp	ection from 2015	
Protection Areas or serving a food, beverage, or lodging establishment:			Reviewed design a	Reviewed design and permit records.		
Drainfield has a three-foot vertical separation distance from periodically saturated soil or bedrock.*						
"Experimental", "Other", or "Performance"	🗌 Yes	🗌 No	Indicate depths	of elevations		
systems built under pre-2008 Rules; Type IV or V systems built under 2008 Rules (7080. 2350 or 7080.2400 (Advanced Inspector License required)			A. Bottom of distribut	tion media	See Attachec Boring Log(s	
Drainfield meets the designed vertical			B. Periodically satura	ated soil/bedrock		
separation distance from periodically saturated soil or bedrock.			C. System separation	n		
• " • • • • • • • •		<u> </u>	D. Required compliant	nce separation*		
Any "no" answer above indicates the Failing to Protect Groundwater.	he syst	em is	*May be reduced u Ordinance.	p to 15 percent if	allowed by Loca	
Operating Permit and Nitrogen B	<b>MP*</b> – C	Compliance	component #5 of 5	🖂 Not appl	licable	
s the system operated under an Operating Per		☐ Yes [				
s the system required to employ a Nitrogen BN			No If "yes", B bel	-		
BMP=Best Management Practice(s) specifi				•		
			•			
If the answer to both questions is "no",	this sec	tion does	not need to be com	pietea.		
Compliance criteria						
a. Operating Permit number:			🗌 Yes 🔲 No			
Have the Operating Permit requirements t	perating Permit requirements been met?					

**Upgrade Requirements** (*Minn. Stat.* § 115.55) *An imminent threat to public health and safety (ITPHS) must be upgraded, replaced, or its use discontinued within ten months of receipt of this notice or within a shorter period if required by local ordinance. If the system is failing to protect ground water, the system must be upgraded, replaced, or its use discontinued within the time required by local ordinance. If an existing system is not failing as defined in law, and has at least two feet of design soil separation, then the system need not be upgraded, replaced, or its use discontinued, notwithstanding any local ordinance that is more strict. This provision does not apply to systems in shoreland areas, Wellhead Protection Areas, or those used in connection with food, beverage, and lodging establishments as defined in law.* 


## Inspect Minnesota & Midwest Soil Testing Subsurface Sewage Treatment System Owner/Property Information

This information will be used for the purpose of conducting an MPCA Compliance Inspection.

Date of Inspection: February 12, 2019	Time: 12:15 PM					
Property Address: 8788 Grey Cloud Island Dr, Grey Cloud Twp, MN	Zip: 55071					
Property Owner: Desiree & Taylor Young	Phone: 612-239-2605					
Tank(s)Tank(s)MaterialSoil Treatment SystemSeptic 2FiberglassRock trenchAerobicPlasticGravelless trenchLiftMetalChamber trenchHoldingConcreteSeepage bedOther:BlockMoundOtherOtherAt-grade	Other Alternative system Experimental system Cesspool system Other system					
Are the tank maintenance covers accessible? $\boxtimes$ Yes $\square$ No *If $\square$						
performed through the maintenance holes. Maintenance hole cover						
the ground surface to facilitate access and proper maintenance of t	he system.					
Year house built: 2010 Year septic installed: 2010	Tank size (gals.): 2-1000					
	sidents in home?					
Number of bedrooms?3Are all floors drained by gr	ravity? Y					
Garbage disposal? Y Whirlpool bath?	Y					
More than one system (laundry, etc.)? N						
Does this property have any footing drain tiles connected to the se	ptic system? N					
Are any buildings on this property such as garages or out-buildings connected to this system? N						
Are there any additional systems on this property serving other bu	ildings? N					
Location of septic system on lot? West Side						
Location of water well on lot? South Side Is the	e well a deep well? Y					
Have you ever experienced any problems with the system such as: tree roots, sewage back-ups, surfacing of sewage onto the ground, septic tank overflowing, etc.; or have any repairs been made to the system? If yes, explain:						
	per: Schlomka's Sewer Service					
How often pumped in previous years? Due Pumping Is system on a monitoring plan?						
Have you received notices from any government agency concerning this system?						
Is your property located in a shoreland management area? N	a navy avmar?					
Do you have any additional information that should be given to th						

I hereby certify that the above information is correct to the best of my knowledge. I also understand that if the system is considered "non-compliant/failing" per MPCA rules, that the inspector must by law submit a copy of this report to the local government unit within 15 days of the date of inspection completion. I also agree that unless otherwise noted in this report, that I/we are ultimately responsible for payment of all fees for all work performed relative to this inspection by Inspect Minnesota and Midwest Soil Testing.

Owner/Occupant:

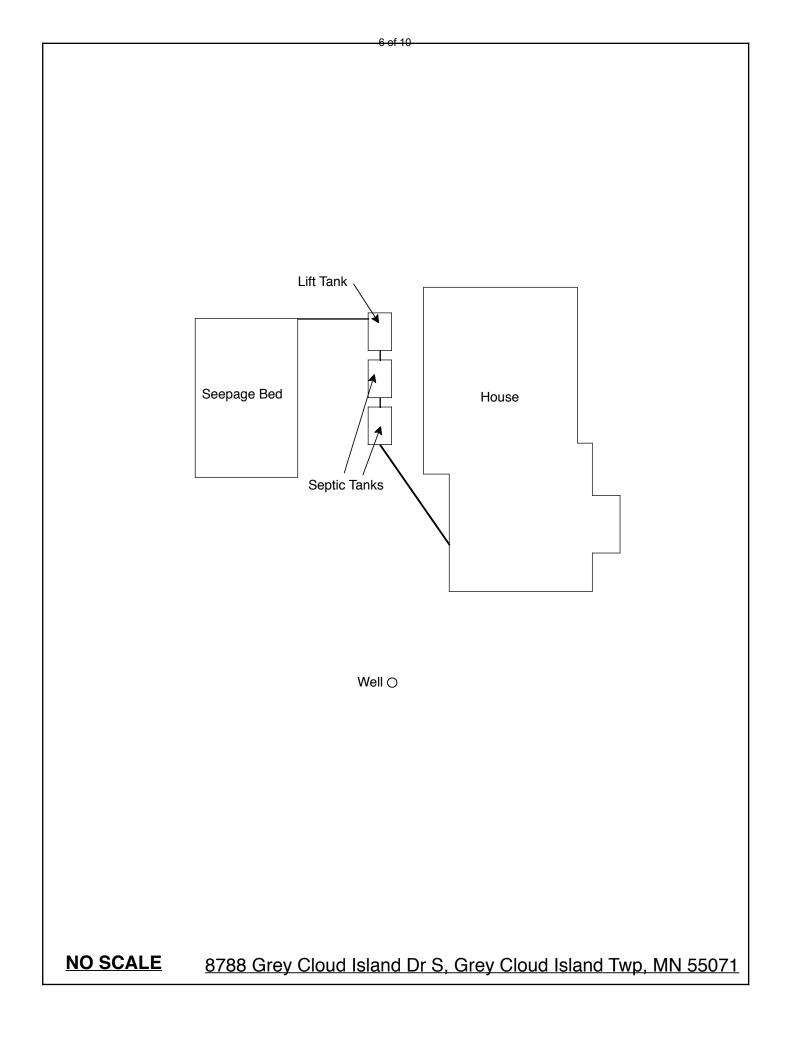

## Log Of Soil Borings

Locat	ion of Project	8788 Grey Cloud Isla	nd Dr S Gr	ev Cloud Island	Twp MN 55071
		Inspect Minnesota	Date: 10/5/15		
		Hand/Bucket	Classif	fication System:	USDA
Bo	pring Number:			Boring Number:	
Surface Elevation of Boring	Same group	d surface as seepage bed	Surface Elevation o Boring		
Depth In Inches	<u>Soils E</u>	ncountered	Depth In Inches	<u>Soils Er</u>	icountered
73-80	10YR 3/3 10YR 4/3 10YR 4/3 M 0YR 3/4 & 7.5YF 10YR 4/3 M 7.5YR 4/4 Lar Few 7.5	2 Loamy Sand 3 Loamy Sand 6 Medium Sand With 8 4/4 Lamellae Banding edium Sand With nellae Banding And YR 7/8 Redox			
73" De	epth To End Of B	oring Or Redox	C	Depth To End Of Bo	oring Or Redox
Same Ele	evation Of Boring Relative To System		Elevation Of Boring Relative To Syster		
	pth To Bottom ( Separation	Of Distribution Media		Depth To Bottom O Df Separation	f Distribution Media
Er	nd Of Boring At:	80"		End Of Boring At:	
	dox Present At:	73"		Redox Present At:	
Standing Wa	ater Present At:	None	Standing	Water Present At:	

Bottom Of Distribution Medium At: 30 Inches

· · · · · · · · ·	Black sandy Black sandy 100 m topsoil	3-	Medium Said Loye 313 30	Medium brain Medium sand Cectic at the				
	Black Sandy Loain mik	3	Dark red sand With chunks of	(old the stump)	WAND A			
G	Vark brown Sandy loam tapsoil	Wediens to Vied brown	Medium Sand 5yr 5/3					
22 - / - a /	Black Savedy -locin topsoil	3	Redortum medicin Sand Syr413	Medium brown Wy edium sand Barr 413		ledra Web" 66	-	•
Deter $25 - 70 - 70$ Depth In Feet $B - 5$	L Jung	Red brown loamy sand 2	છ	4		9 9 9		<u> </u>

÷

LOG OF SOIL BORINGS 1 3

.

•

.

ı

-

•

2212

٩

# **DISCLAIMER**

#### Brian L. Humpal, Inc. dba. Inspect Minnesota, Midwest Soil Testing

#### Relative to Subsurface Sewage Treatment System (SSTS) Compliance Inspections

- 1. This inspection/report is being performed for only the seller/owner of the property on which the SSTS is located. In such case that another party is paying for the inspection, the contract is between only said party and Brian L. Humpal, Inc.; there is no contract between Brian L. Humpal, Inc. and any other party unless otherwise noted.
- 3. Brian L. Humpal, Inc. has not been retained to warranty, guarantee, or certify the proper functioning of the SSTS for any period of time beyond the date of inspection or into the future. Because of the numerous factors (usage, maintenance, soil characteristics, previous failures, etc.) which may affect the proper operation of an SSTS, as well as the inability of Brian L. Humpal, Inc. to supervise or monitor the use or maintenance of the SSTS, the report shall not be construed as a warranty by Brian L. Humpal, Inc. that the SSTS will function properly for any particular party for any period of time.
- 4. Brian L. Humpal, Inc. is unable to verify the frequency and/or, quality of prior or future maintenance of the SSTS. Maintenance of the tank(s) must be performed through the tanks maintenance hole. The removal of solids from any location other than the maintenance hole is not a compliant method of maintenance. It is strongly recommended that maintenance covers be made accessible to the ground surface to facilitate proper maintenance.
- 5. Minimum Compliance Inspection requirements relative to this inspection and this report include <u>only</u> verification that the SSTS has tank(s) (septic tanks, lift tanks, dosing tanks, stilling tanks, etc.) which are watertight below the designed operating depth, the required separation between the bottom of the subsurface soil distribution medium and seasonally saturated soils, no back-ups of sewage into the dwelling, no discharge of sewage/effluent to the ground surface or surface waters, and no imminent safety hazards. Brian L. Humpal, Inc. does not inspect plumbing or pumps prior to the first SSTS component as these are plumbing components. The performance of exterior pumps and associated components are not inspected as they are considered to be maintenance items. Additionally, no indications relative to compliance with electrical code requirements have been made. It is recommended that any other applicable plumbing, electrical, housing, etc. inspections be performed by a qualified inspection business. Sewage back-up verification is limited to observing the floor drain area and/or the information supplied by the last occupants of the building prior to inspection. Brian L. Humpal, Inc. cannot guarantee that the information given to them by the last occupants of the building prior to inspection relative to back-ups is accurate.
- 4. Certification of this SSTS does not warranty future use beyond the date of the inspection. Any SSTS, old or new, can become hydraulically overloaded or discharge sewage/effluent to the ground surface as a result of more people moving into the house than were previously occupying the house, improper maintenance, heavy usage, leaking plumbing fixtures, groundwater infiltration, tree roots, freezing conditions, surface drainage problems, poor initial design, poor construction practices, or unsuitable materials used in constructing the system; the system can also simply stop working because of its age. An SSTS that has been properly designed and installed, properly maintained, and used in the manner for which the system was designed can be expected to provide service for twenty to twenty-five years on average. Some parts of the SSTS such as alarms, switches, pumps, filters, etc. will most likely have to be repaired or replaced over the lifetime of the system.
- 5. A Compliance Inspection is not meant to be a test or inspection for longevity of the system; a Compliance Inspection is strictly for the purpose of determining if the SSTS is protective of public health and safety, as well as the groundwater at the date and time the inspection was performed. This inspection is not intended to determine if the SSTS was originally designed or installed to past or present MPCA or other Local Government Unit code requirements. This inspection is not intended to determine if the SSTS was designed and/or installed to support the anticipated flow from the building as the use of the building may have changed since the design and construction of the SSTS due to the addition of bedrooms, occupants, etc. In addition, this inspection is not intended to determine the quality of the original SSTS design, the quality of the construction practices used while installing the SSTS, or the quality of the materials used in constructing the SSTS.
- 6. Brian L. Humpal, Inc. cannot guarantee the performance of SSTS products/components such as: gravelless pipe, chamber trenches, effluent filters, tanks, sewage pre-treatment components, piping, etc. Products such as gravelless pipe are no longer approved for installation in the State of Minnesota and may have a significantly reduced performance and/or life expectancy.
- 7. WINTER WORK: By accepting this report, it is understood that inspections conducted during winter months (approximately November 1<sup>st</sup> through April 1<sup>st</sup>) are more difficult to perform because of possible snow cover and/or ground frost. SSTS components such as tanks, maintenance covers, tank inspection pipes, subsurface distribution medium inspection pipes, and soil treatment areas are more difficult or impossible to locate due to snow cover and/or ground frost. In addition, soil borings are more difficult to perform due to snow cover and/or ground frost. Brian L. Humpal, Inc. will attempt to use the same level of standards when performing work during winter periods as when performing work during non-winter periods. However, the recipient of this report understands that because of the aforementioned considerations, the same level of standards may not be possible.
- 8. By accepting this report, the client understands that Brian L. Humpal, Inc. will not be responsible for any monetary damages exceeding the fee for the services provided.

# Subsurface Sewage Treatment Systems Non-transferable Business License

Inspect Minnesota, Midwest Soil Testing

License Expires: 12/22/2019

Issued: 11/20/2018

**Specialty Area(s):** 

License # L2896

Installer Maintainer Service Provider Advanced Designer Advanced Inspector

# **Designated Certified Individual(s):**

Cert #	Name	Certification Expires:
C9633	Anthony P Scully	3/5/2020
•	Installer, Designer (Apprentice)	
C5342	Brian L Humpal	10/15/2023
	Installer, Maintainer, Serv Prov, Adv D	esigner, Adv Inspector
C9852	Christopher R Uebe	3/4/2021
	Designer, Inspector	

# MINNESOTA POLLUTION CONTROL AGENCY

520 Lafayette Road North St. Paul, Minnesota 55155-4194

Nich Haig

Nick Haig, Supervisor Certification and Training Unit