Inspect Minnesota & Midwest Soil Testing

P.O. Box 10853 White Bear Lake, MN 55110 651-492-7550/Brian@Midwestsoiltesting.com

Brian Humpal MPCA Licensed Advanced Inspector

SUBSURFACE SEWAGE TREATMENT SYSTEM (SSTS) COMPLIANCE REPORT

Inspection Address: 4393 Odell Ave S, Afton, MN 55001

REPORT SUMMARY

I have performed an "MPCA Compliance Inspection" on this system and have reviewed the original design/permit records, along with a previous compliance inspection from 2016, which were on file at Washington County. This very old system (installed in 1987) consists of a pre-cast septic tank and a rock trench drainfield. It should be noted that the average life expectancy of a septic system is approximately 30 years. This house is presently vacant.

Although not compliance criteria, it should be noted that the septic tank inlet baffle is missing and should be replaced as soon as possible.

Predicated on my inspection of the system and my review of the original design/permit records, it is my opinion that this system <u>presently meets</u> MPCA minimum compliance inspection requirements.

Inspect Minnesota and Midwest Soil Testing have been hired to perform a compliance inspection of this SSTS for compliance with local ordinances pursuant to Minn. Stat. § 115.55 (2013). This compliance inspection covers only the criteria required by Minn. Stat. § 115.55 Subd. 5a (2013) and Minn. R. 7080.1500 (2011). A compliance inspection is an indication of the current compliance status of the system and does not guarantee the performance or longevity of this system beyond the date of inspection, as it is impossible to determine the future performance of any system. Inspect Minnesota and Midwest Soil Testing disclaim any use of this compliance inspection beyond determining SSTS compliance pursuant to Minn. Stat. § 115.55 Subd. 5a (2013) and Minn. R. 7080.1500 (2011).

Please contact me should you have any questions.

Christopher Uebe

Brian Humpal



Compliance Inspection Form

Existing Subsurface Sewage Treatment Systems (SSTS)

Doc Type: Compliance and Enforcement

Instructions: Inspection results based on Minnesota Pollution Control Agency (MPCA) requirements and attached forms – additional local requirements may also apply.	For local tracking purposes:
Submit completed form to Local Unit of Government (LUG) and system owner within 15 days	
System Status	
System status on date (mm/dd/yyyy):3/27/2019	
<u> </u>	npliant – Notice of Noncompliance rade Requirements on page 3)
Reason(s) for noncompliance (check all applicable) Impact on Public Health (Compliance Component #1) – Imminent threat to Other Compliance Conditions (Compliance Component #3) – Imminent threat the Tank Integrity (Compliance Component #2) – Failing to protect groundward Other Compliance Conditions (Compliance Component #3) – Failing to protect groundward Soil Separation (Compliance Component #4) – Failing to protect groundward Operating permit/monitoring plan requirements (Compliance Component #4)	reat to public health and safety fer otect groundwater ater
Property Information Parcel ID# or Sec/Twp/Rang	ge:
Property address: 4393 Odell Ave S, Afton, MN 55001 Reason f	or inspection: Property Transfer
Property owner:Martin & Patricia Chalupa Owner's or	phone:
Owner's representative: Holz Group - Keller Williams Represer	ntative phone: 651-259-4699
Local regulatory authority: Washington County Regulato	ry authority phone: 651-430-6655
Brief system description: A pre-cast septic tank and a rock trench drainfield.	
Comments or recommendations:	
Although not compliance criteria, it should be noted that the septic tank inlet baffle is m possible.	issing and should be replaced as soon as
Certification	
I hereby certify that all the necessary information has been gathered to determine the of determination of future system performance has been nor can be made due to unknow possible abuse of the system, inadequate maintenance, or future water usage.	
Inspector name: Brian Humpal/Christopher Uebe Certificat	ion number: <u>C5342/C9852</u>
Business name: Inspect Minnesota, Midwest Soil Testing Licer	se number: _L2896
Inspector signature: Prian Thumpal for the Pho	ne number: 651-492-7550
Necessary or Locally Required Attachments	
	local ordinance
☐ Other information (list): Report Summary, Property Information, Disclaimer, Lic	

www.pca.state.mn.us • 651-296-6300 • 800-657-3864 • TTY 651-282-5332 or 800-657-3864 • Available in alternative formats wq-wwists4-31 • 1/24/12 Page 1 of 3

Property address: 4393 Odell Ave S, Afton, MN 55001

Inspector initials/Date: 3/27/2019 **B**#

1.	. Impact on Public Health – Compliance component #1 of 5					
	Compliance criteria:			Verification method(s):		
	System discharge sewage to the ground surface. Yes No Searched for surface outlet Searched for seeping in yard/		Searched for seeping in yard/backup in home			
		stem discharge sewage to drain tile surface waters.	☐ Yes	⊠ No		
	System cause sewage backup into dwelling or establishment.		☐ Yes	⊠ No	 □ "Black soil" above soil dispersal system □ System requires "emergency" pumping □ Performed dye test 	
		Any "yes" answer above indicates the system is an Imminent Threat to Public Health and Safety.			☐ Unable to verify (See Comments/Explanation) ☐ Other methods not listed (See Comments/Explanation)	
		omments/Explanation: one of the above found.				
2.	Ta	ank Integrity — Compliance com	nponent #	#2 of 5		
	C	ompliance criteria:			Verification method(s):	
		stem consists of a seepage pit, sspool, drywell, or leaching pit.	☐ Yes	⊠ No	☑ Probed tank(s) bottom☑ Examined construction records	
		epage pits meeting 7080.2550 may be mpliant if allowed in local ordinance.			Examined Tank Integrity Form (Attach)Observed liquid level below operating depth	
		ewage tank(s) leak below their signed operating depth.	☐ Yes	⊠ No	☐ Examined empty (pumped) tanks(s)	
		yes, which sewage tank(s) leaks:			Probed outside tank(s) for "black soil"	
	Any "yes" answer above indicates the system is Failing to Protect Groundwater.		 ☐ Unable to verify (See Comments/Explanation) ☐ Other methods not listed (See Comments/Explanation) 			
	Сс	omments/Explanation:				
	Although not compliance criteria, it should be noted that the septic tank inlet baffle is missing and should be replaced as so as possible.					
3.	0	ther Compliance Conditions	– Comp	liance compone	ent #3 of 5	
	a.	Maintenance hole covers are damaged	d, cracked	, unsecured, or app	pear to structurally unsound. Yes* No Unknown	
	b. Other issues (electrical hazards, etc.) to immediately and adversely impact public health or safety. ☐ Yes* ☐ No ☐ Unk*System is an imminent threat to public health and safety					
		Explain:				
	C.	System is non-protective of ground wa *System is failing to protect ground		er conditions as de	etermined by inspector ☐ Yes* ☐ No	
		Explain:				

www.pca.state.mn.us • 651-296-6300 • 800-657-3864 • TTY 651-282-5332 or 800-657-3864 • Available in alternative formats wq-wwists4-31 • 1/24/12 Page 2 of 3

Inspector initials/Date: 3/27/2019 84(1) Property address: 4393 Odell Ave S, Afton, MN 55001 **Soil Separation** – Compliance component #4 of 5 Date of installation: 1987 Unknown Verification method(s): Shoreland/Wellhead protection/Food Beverage ☐ Yes ☐ No Soil observation does not expire. Previous soil Lodging? observations by two independent parties are sufficient, unless site conditions have been altered or local Compliance criteria: requirements differ. For systems built prior to April 1, 1996, and not located in Shoreland or Wellhead ☐ Conducted soil observation(s) (Attach boring logs) Protection Area or not serving a food. ☐ Two previous verifications (Attach boring logs) beverage or lodging establishment: ☐ Not applicable (Holding tank(s), no drainfield) Drainfield has at least a two-foot vertical ☐ Unable to verify (See Comments/Explanation) separation distance from periodically ○ Other (See Comments/Explanation) saturated soil or bedrock. ☐ Yes ☐ No Non-performance systems built April 1, Comments/Explanation: 1996, or later or for non-performance Reviewed previous compliance inspection from 2016. systems located in Shoreland or Wellhead Protection Areas or serving a food, Reviewed design and permit records. beverage, or lodging establishment: Drainfield has a three-foot vertical separation distance from periodically saturated soil or bedrock.* "Experimental", "Other", or "Performance" ☐ Yes ☐ No Indicate depths of elevations systems built under pre-2008 Rules; Type IV See Attached or V systems built under 2008 Rules (7080. Boring Log(s) A. Bottom of distribution media 2350 or 7080.2400 (Advanced Inspector License required) B. Periodically saturated soil/bedrock Drainfield meets the designed vertical separation distance from periodically C. System separation saturated soil or bedrock. D. Required compliance separation* Any "no" answer above indicates the system is *May be reduced up to 15 percent if allowed by Local Failing to Protect Groundwater. Ordinance. 5. Operating Permit and Nitrogen BMP* – Compliance component #5 of 5 Not applicable ☐ Yes ☐ No If "yes", A below is required Is the system operated under an Operating Permit? Is the system required to employ a Nitrogen BMP? ☐ Yes ☐ No If "yes", B below is required BMP=Best Management Practice(s) specified in the system design If the answer to both questions is "no", this section does not need to be completed.

Any "no" answer indicates Noncompliance.

Have the Operating Permit requirements been met?

b. Is the required nitrogen BMP in place and properly functioning?

Upgrade Requirements (Minn. Stat. § 115.55) An imminent threat to public health and safety (ITPHS) must be upgraded, replaced, or its use discontinued within ten months of receipt of this notice or within a shorter period if required by local ordinance. If the system is failing to protect ground water, the system must be upgraded, replaced, or its use discontinued within the time required by local ordinance. If an existing system is not failing as defined in law, and has at least two feet of design soil separation, then the system need not be upgraded, repaired, replaced, or its use discontinued, notwithstanding any local ordinance that is more strict. This provision does not apply to systems in shoreland areas, Wellhead Protection Areas, or those used in connection with food, beverage, and lodging establishments as defined in law.

www.pca.state.mn.us • 651-296-6300 • 800-657-3864 wq-wwists4-31 • 1/24/12 Page 3 of 3

Compliance criteria

a. Operating Permit number:

☐ Yes ☐ No

☐ Yes ☐ No


Inspect Minnesota & Midwest Soil Testing Subsurface Sewage Treatment System Owner/Property Information

This information will be used for the purpose of conducting an MPCA Compliance Inspection.

Date of Inspection: March 27, 2019	Time: 9:00 AM			
Property Address: 4393 Odell Ave S, Afton, MN	Zip: 55001			
Property Owner: Martin & Patricia Chalupa	Phone:			
Tank(s) Tank(s)Material Soil Treatment System Septic 1 Fiberglass Rock trench Aerobic Plastic Gravelless trench Lift Metal Chamber trench Holding Concrete Seepage bed Other: Block Mound Other At-grade	Other Alternative system Experimental system Cesspool system Other system			
Are the tank maintenance covers accessible? ☐ Yes ☒ No *If i	no, proper maintenance must be			
performed through the maintenance holes. Maintenance hole cover				
the ground surface to facilitate access and proper maintenance of t	he system.			
Year house built: 1986 Year septic installed: 1987	Γank size (gals.): 1200			
1	sidents in home? 2			
Number of bedrooms? 4 Are all floors drained by g				
Garbage disposal? N Whirlpool bath?	N			
More than one system (laundry, etc.)? N				
Does this property have any footing drain tiles connected to the se				
Are any buildings on this property such as garages or out-building	s connected to this system? N			
Are there any additional systems on this property serving other bu	ildings? N			
Location of septic system on lot? North Side				
Location of water well on lot? South Side	well a deep well? Y			
Have you ever experienced any problems with the system such as:	tree roots, sewage back-ups,			
surfacing of sewage onto the ground, septic tank overflowing, etc.; or have any repairs been made to the system? N If yes, explain:				
When was the system last pumped? Unknown Name of pum	per: Unknown			
How often pumped in previous years? Unknown				
Have you received notices from any government agency concerning this system? N				
Is your property located in a shoreland management area? N				
Do you have any additional information that should be given to the new owner? N				
I hereby certify that the above information is correct to the best of my knowledge. I also understand that if the system is considered "non-compliant/failing" per MPCA rules, that the inspector must by law submit a copy of this report to the				

I hereby certify that the above information is correct to the best of my knowledge. I also understand that if the system is considered "non-compliant/failing" per MPCA rules, that the inspector must by law submit a copy of this report to the local government unit within 15 days of the date of inspection completion. I also agree that unless otherwise noted in this report, that I/we are ultimately responsible for payment of all fees for all work performed relative to this inspection by Inspect Minnesota and Midwest Soil Testing.

Owner/Occupant:	Date:	

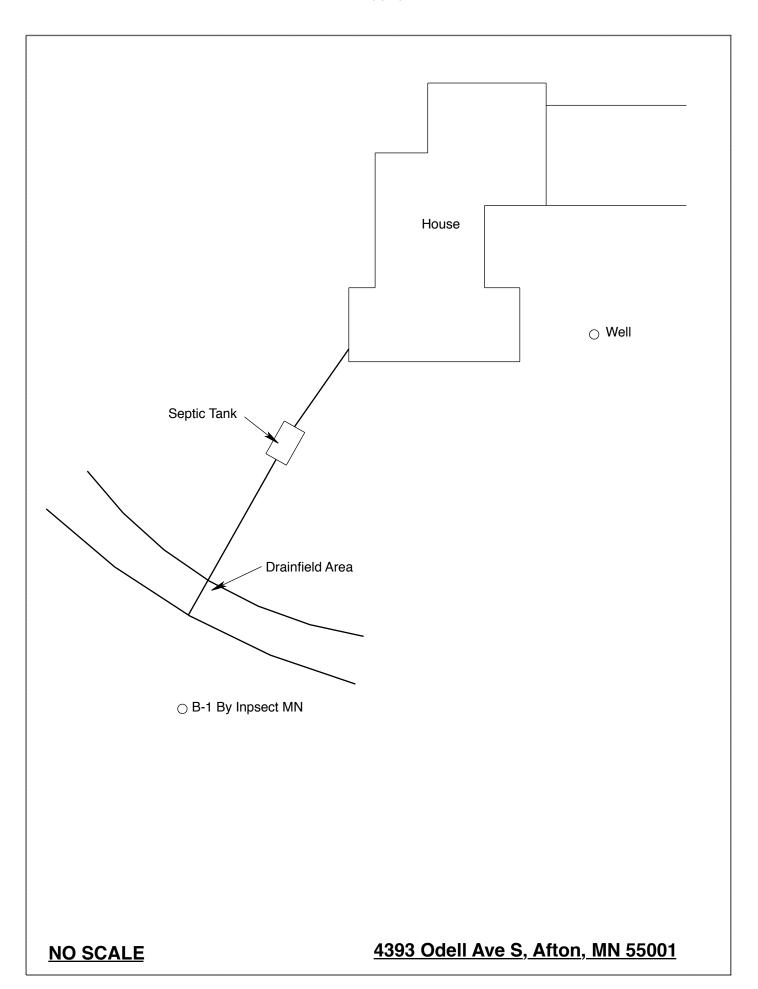

Log Of Soil Borings

Location of Project: 4393 Odell Ave S, Afton, MN 55001					
Borings Made By: Inspect Minnesota			.011, 1111 33	Date:	3/27/19
Auger Used: Hand/Bucket		-		USDA	
Boring Number: 1			Boring Number:		
Surface Elevation Boring	of Same grou	und surface as last ofield trench	Surface Elevation of Boring		
Depth In Inches	Soils E	ncountered	Depth In Inches	Soils Er	countered
0-12 12-27 27-40 40-57	10YR 3 10YR 3/4 10YR 3/4 S	/2 Silt Loam /3 Silt Loam 4 Sandy Loam andy Loam With ock Fragments			
57"	Depth To End Of B	oring Or Redox		Depth To End Of Bo	oring Or Redox
Same	Elevation Of Boring	g Relative To System		Elevation Of Boring	Relative To System
-33"		Of Distribution Media			f Distribution Media
≥24"	Of Separation			Of Separation	
	End Of Boring At:	57"		End Of Boring At:	
	Redox Present At:	None		Redox Present At:	
Standing	Water Present At:	None	Standing	Water Present At:	
			_		

Bottom Of Distribution Medium At	: 33 Inches

Log Of Soil Borings

Location of Project: 4393 Odell Ave S, Afton, MN 55001					
Borings Made By: Inspect Minnesota			Date:	8/3/16	
Auger Used: Hand/Bucket		Class	ification System:	USDA	
Boring Number: 1			Boring Number:		
Surface	Cama gray	and curface as last	Surface		
Elevation	α	ind surface as last ofield trench	Elevation	of	
Boring	uran	meia trench	Boring		
Depth In	Soils F	ncountered	Depth In	Soils Fr	ncountered
Inches			Inches	<u> </u>	<u>icountereu</u>
0-12 12-29 29-44 44-57 57-73	10YR 4 10YR 3/4 10YR 4/4 10YR 4/4 M Bedroc	2 Loamy Sand /3 Silt Loam Medium Sand Medium Sand edium Sand With k Fragments sal at 73"			
73"	Depth To End Of B	oring Or Redox		Depth To End Of Bo	oring Or Redox
		g Relative To System			Relative To System
		Of Distribution Media		Depth To Bottom C	of Distribution Media
≥40"	Of Separation			Of Separation	
	End Of Daving At-	73"		End Of Daving At-	
	End Of Boring At:			End Of Boring At:	
Redox Present At: None		Ctandina	Redox Present At:		
Standing	Water Present At:	None	Standing	Water Present At:	

Bottom Of Distribution Medium At: 33 Inches	

DISCLAIMER

Brian L. Humpal, Inc. dba. Inspect Minnesota, Midwest Soil Testing Relative to Subsurface Sewage Treatment System (SSTS) Compliance Inspections

- 1. This inspection/report is being performed for only the seller/owner of the property on which the SSTS is located. In such case that another party is paying for the inspection, the contract is between only said party and Brian L. Humpal, Inc.; there is no contract between Brian L. Humpal, Inc. and any other party unless otherwise noted.
- 3. Brian L. Humpal, Inc. has not been retained to warranty, guarantee, or certify the proper functioning of the SSTS for any period of time beyond the date of inspection or into the future. Because of the numerous factors (usage, maintenance, soil characteristics, previous failures, etc.) which may affect the proper operation of an SSTS, as well as the inability of Brian L. Humpal, Inc. to supervise or monitor the use or maintenance of the SSTS, the report shall not be construed as a warranty by Brian L. Humpal, Inc. that the SSTS will function properly for any particular party for any period of time.
- 4. Brian L. Humpal, Inc. is unable to verify the frequency and/or, quality of prior or future maintenance of the SSTS. Maintenance of the tank(s) must be performed through the tanks maintenance hole. The removal of solids from any location other than the maintenance hole is not a compliant method of maintenance. It is strongly recommended that maintenance covers be made accessible to the ground surface to facilitate proper maintenance.
- 5. Minimum Compliance Inspection requirements relative to this inspection and this report include <u>only</u> verification that the SSTS has tank(s) (septic tanks, lift tanks, dosing tanks, stilling tanks, etc.) which are watertight below the designed operating depth, the required separation between the bottom of the subsurface soil distribution medium and seasonally saturated soils, no back-ups of sewage into the dwelling, no discharge of sewage/effluent to the ground surface or surface waters, and no imminent safety hazards. Brian L. Humpal, Inc. does not inspect plumbing or pumps prior to the first SSTS component as these are plumbing components. The performance of exterior pumps and associated components are not inspected as they are considered to be maintenance items. Additionally, no indications relative to compliance with electrical code requirements have been made. It is recommended that any other applicable plumbing, electrical, housing, etc. inspections be performed by a qualified inspection business. Sewage back-up verification is limited to observing the floor drain area and/or the information supplied by the last occupants of the building prior to inspection. Brian L. Humpal, Inc. cannot guarantee that the information given to them by the last occupants of the building prior to inspection relative to back-ups is accurate.
- 4. Certification of this SSTS does not warranty future use beyond the date of the inspection. Any SSTS, old or new, can become hydraulically overloaded or discharge sewage/effluent to the ground surface as a result of more people moving into the house than were previously occupying the house, improper maintenance, heavy usage, leaking plumbing fixtures, groundwater infiltration, tree roots, freezing conditions, surface drainage problems, poor initial design, poor construction practices, or unsuitable materials used in constructing the system; the system can also simply stop working because of its age. An SSTS that has been properly designed and installed, properly maintained, and used in the manner for which the system was designed can be expected to provide service for twenty to twenty-five years on average. Some parts of the SSTS such as alarms, switches, pumps, filters, etc. will most likely have to be repaired or replaced over the lifetime of the system.
- 5. A Compliance Inspection is not meant to be a test or inspection for longevity of the system; a Compliance Inspection is strictly for the purpose of determining if the SSTS is protective of public health and safety, as well as the groundwater at the date and time the inspection was performed. This inspection is not intended to determine if the SSTS was originally designed or installed to past or present MPCA or other Local Government Unit code requirements. This inspection is not intended to determine if the SSTS was designed and/or installed to support the anticipated flow from the building as the use of the building may have changed since the design and construction of the SSTS due to the addition of bedrooms, occupants, etc. In addition, this inspection is not intended to determine the quality of the original SSTS design, the quality of the construction practices used while installing the SSTS, or the quality of the materials used in constructing the SSTS.
- 6. Brian L. Humpal, Inc. cannot guarantee the performance of SSTS products/components such as: gravelless pipe, chamber trenches, effluent filters, tanks, sewage pre-treatment components, piping, etc. Products such as gravelless pipe are no longer approved for installation in the State of Minnesota and may have a significantly reduced performance and/or life expectancy.
- 7. WINTER WORK: By accepting this report, it is understood that inspections conducted during winter months (approximately November 1st through April 1st) are more difficult to perform because of possible snow cover and/or ground frost. SSTS components such as tanks, maintenance covers, tank inspection pipes, subsurface distribution medium inspection pipes, and soil treatment areas are more difficult or impossible to locate due to snow cover and/or ground frost. In addition, soil borings are more difficult to perform due to snow cover and/or ground frost. Brian L. Humpal, Inc. will attempt to use the same level of standards when performing work during winter periods as when performing work during non-winter periods. However, the recipient of this report understands that because of the aforementioned considerations, the same level of standards may not be possible.
- 8. By accepting this report, the client understands that Brian L. Humpal, Inc. will not be responsible for any monetary damages exceeding the fee for the services provided.

Subsurface Sewage Treatment Systems

Non-transferable

Business License

Inspect Minnesota, Midwest Soil Testing

License # L2896

License Expires: 12/22/2019

Issued: 11/20/2018

Specialty Area(s):

Installer
Maintainer
Service Provider
Advanced Designer
Advanced Inspector

Designated Certified Individual(s):

Cert #	Name	Certification Expires:
C9633	Anthony P Scully	3/5/2020
	Installer, Designer (Apprentice)	
C5342	Brian L Humpal	10/15/2023
	Installer, Maintainer, Serv Prov, Adv	Designer, Adv Inspector
C9852	Christopher R Uebe	3/4/2021
	Designer, Inspector	



520 Lafayette Road North St. Paul, Minnesota 55155-4194 Mich Haig

Nick Haig, Supervisor Certification and Training Unit