Inspect Minnesota & Midwest Soil Testing

P.O. Box 10853 White Bea	Brian Humpal		
651-492-7550/Brian@Midy	MPCA Licensed Advanced Inspector		
SUBSURFACE SEWAGE TREATMENT SYSTEM (SSTS) COMPLIANCE REPORT			
Date: April 15, 2019	Time: 2:15 PM	Owner: Jordan & Christi Zweig	
Inspection Address: 13206 24 th St Ct N, West Lakeland, MN 55082			

REPORT SUMMARY

I have performed an "MPCA Compliance Inspection" on this system, have reviewed the history of the system with the owner, Christi Zweig, and have reviewed the original design/permit records, along with a previous compliance inspection from 2017, which were on file at Washington County. This system consists of two pre-cast septic tanks, a pre-cast lift tank, and a seepage bed.

Although not a compliance criteria, it should be noted that the septic tanks are currently due for maintenance pumping and should be pumped when possible.

Predicated on my inspection of the system, my review of the history of the system with the owner, and my review of the records, it is my opinion that this system <u>presently meets</u> MPCA minimum compliance inspection requirements.

Inspect Minnesota and Midwest Soil Testing have been hired to perform a compliance inspection of this SSTS for compliance with local ordinances pursuant to Minn. Stat. § 115.55 (2013). This compliance inspection covers only the criteria required by Minn. Stat. § 115.55 Subd. 5a (2013) and Minn. R. 7080.1500 (2011). A compliance inspection is an indication of the current compliance status of the system and does not guarantee the performance or longevity of this system beyond the date of inspection, as it is impossible to determine the future performance of any system. Inspect Minnesota and Midwest Soil Testing disclaim any use of this compliance inspection beyond determining SSTS compliance pursuant to Minn. Stat. § 115.55 Subd. 5a (2013) and Minn. R. 7080.1500 (2011).


Please contact me should you have any questions.

Christopher Uebe

Brian Humpal

Brian Humpal

2 of 11

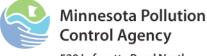

520 Lafayette Road North St. Paul, MN 55155-4194

Compliance Inspection Form

Existing Subsurface Sewage Treatment Systems

(SSTS)

Doc Type: Compliance and Enforcement

Instructions: Inspection results based on Minnesota Pollution Control Agency (MPCA)
requirements and attached forms – additional local requirements may also apply.

Submit completed form to Local Unit of Government (LUG) and system owner within 15 days

System Status

System status on date (mm/dd/yyyy): 4/15/2019

Compliant – Certificate of Compliance

(Valid for 3 years from report date, unless shorter time frame outlined in Local Ordinance.)

] Noncompliant – Notice of Noncompliance

For local tracking purposes:

(See Upgrade Requirements on page 3)

Reason(s) for noncompliance (check all applicable)

- Impact on Public Health (Compliance Component #1) Imminent threat to public health and safety
- Other Compliance Conditions (Compliance Component #3) Imminent threat to public health and safety
- Tank Integrity (Compliance Component #2) Failing to protect groundwater
- Other Compliance Conditions (Compliance Component #3) Failing to protect groundwater
- Soil Separation (Compliance Component #4) Failing to protect groundwater
- Operating permit/monitoring plan requirements (Compliance Component #5) Noncompliant

Property Information

Parcel	ID# or	Sec/T	wp/Range:
--------	--------	-------	-----------

Property address: 1320	6 24 th St Ct N, West Lakeland, MN 55082	Reason for inspection	n: Property Transfer
Property owner: Jordan	& Christi Zweig	Owner's phone: 7	13-202-6798
or			
Owner's representative:		Representative phon	e:
Local regulatory authority:	Washington County	Regulatory authority	phone: 651-430-6655
Brief system description:	Two pre-cast septic tanks, a pre-cast lift tank, a	and a seepage bed.	

Comments or recommendations:

Although not a compliance criteria, it should be noted that the septic tanks are currently due for maintenance pumping and should be pumped when possible.

Certification

I hereby certify that all the necessary information has been gathered to determine the compliance status of this system. No determination of future system performance has been nor can be made due to unknown conditions during system construction, possible abuse of the system, inadequate maintenance, or future water usage.

Inspector name:	Brian Humpal/Christopher Uebe	Certification number:	C5342/C9852
Business name:	Inspect Minnesota, Midwest Soil Testing	License number:	L2896
Inspector signatur	e: Brian Humpal Africa Man	Phone number:	651-492-7550
Necessary or	Locally Required Attachments		
🛛 Soil boring lo	gs 🛛 System/As-built drawing	Forms per local ordinan	се
☑ Other information (list):Report Summary, Property Information, Disclaimer, License			

1. Impact on Public Health – Compliance component #1 of 5

Property address: 13206 24th St Ct N, West Lakeland, MN 55082

Compliance criteria: Verification method(s): Searched for surface outlet System discharge sewage to the □ Yes ⊠ No Searched for seeping in yard/backup in home ground surface. Excessive ponding in soil system/D-boxes System discharge sewage to drain tile 🗌 Yes 🖾 No Homeowner testimony (See Comments/Explanation) or surface waters. "Black soil" above soil dispersal system 🗌 Yes 🖾 No System cause sewage backup into System requires "emergency" pumping dwelling or establishment. Performed dye test Any "yes" answer above indicates the system is Unable to verify (See Comments/Explanation) an Imminent Threat to Public Health and Safety. Other methods not listed (See Comments/Explanation)

2. Tank Integrity – Compliance component #2 of 5

Compliance criteria:		Verification method(s):
System consists of a seepage pit, cesspool, drywell, or leaching pit.	🗌 Yes 🖾 No	 Probed tank(s) bottom Examined construction records
Seepage pits meeting 7080.2550 may be compliant if allowed in local ordinance.		 Examined Tank Integrity Form (Attach) Observed liquid level below operating depth
Sewage tank(s) leak below their designed operating depth.	🗌 Yes 🖾 No	Examined empty (pumped) tanks(s)
If yes, which sewage tank(s) leaks:		Probed outside tank(s) for "black soil"
Any "yes" answer above indic system is Failing to Protect G		Unable to verify (See Comments/Explanation) Other methods not listed (See Comments/Explanation)

Comments/Explanation:

Comments/Explanation: None of the above found.

Although not a compliance criteria, it should be noted that the septic tanks are currently due for maintenance pumping and should be pumped when possible.

Lowered underwater camera into tanks - baffles and tank walls OK. Lift pump and alarm were operational at the time of the inspection.

3. Other Compliance Conditions - Compliance component #3 of 5

a.	Maintenance hole covers are damaged	l, cracked, unsecure	d, or appear to stru	ucturally unsound.	□ Yes*	🛛 No	🗌 Unknown
----	-------------------------------------	----------------------	----------------------	--------------------	--------	------	-----------

b. Other issues (electrical hazards, etc.) to immediately and adversely impact public health or safety. *System is an imminent threat to public health and safety

Explain:

c. System is non-protective of ground water for other conditions as determined by inspector Yes* No ***System is failing to protect groundwater**

Explain:

4. Soil Separation – Compliance component #4 of 5

Date of installation: 2014	Unknown	Verification method(s):		
Shoreland/Wellhead protection/Food Beverage Lodging?	🗌 Yes 🛛 No	Soil observation does not expire. Pr observations by two independent pa		
Compliance criteria:		unless site conditions have been alt		
For systems built prior to April 1, 1996, and not located in Shoreland or Wellhead Protection Area or not serving a food, beverage or lodging establishment:	□ Yes □ No	 requirements differ. Conducted soil observation(s) (Attach boring logs) Two previous verifications (Attach boring logs) Not applicable (Holding tank(s), no drainfield) Unable to verify (See Comments/Explanation) Other (See Comments/Explanation) 	ch boring logs) o drainfield)	
Drainfield has at least a two-foot vertical separation distance from periodically saturated soil or bedrock.			. ,	
Non-performance systems built April 1, 1996, or later or for non-performance systems located in Shoreland or Wellhead Protection Areas or serving a food, beverage, or lodging establishment:	🖾 Yes 🔲 No	<i>Comments/Explanation:</i> Reviewed previous compliance insp Reviewed design and permit record		
Drainfield has a three-foot vertical separation distance from periodically saturated soil or bedrock.*				
"Experimental", "Other", or "Performance"	🗌 Yes 🔲 No	Indicate depths of elevations		
systems built under pre-2008 Rules; Type IV or V systems built under 2008 Rules (7080. 2350 or 7080.2400 (Advanced Inspector		A. Bottom of distribution media	See Attached Boring Log(s)	
License required)		B. Periodically saturated soil/bedrock		
Drainfield meets the designed vertical separation distance from periodically saturated soil or bedrock.		C. System separation		
		D. Required compliance separation*		
Any "no" answer above indicates t Failing to Protect Groundwater.	the system is	*May be reduced up to 15 percent if Ordinance.	allowed by Local	
Operating Permit and Nitrogen B	MP* – Compliance	e component #5 of 5 🛛 🛛 Not app	licable	
Is the system operated under an Operating Permit? Yes No If "yes", A below is required				
Is the system required to employ a Nitrogen BM	MP? ☐ Yes	□ No If "yes", B below is required		

BMP=Best Management Practice(s) specified in the system design

If the answer to both questions is "no", this section does not need to be completed.

Compliance criteria

5.

a.	Operating Permit number:	∏Yes ∏No
	Have the Operating Permit requirements been met?	
b.	Is the required nitrogen BMP in place and properly functioning?	🗌 Yes 🗌 No

Any "no" answer indicates Noncompliance.

Upgrade Requirements (Minn. Stat. § 115.55) An imminent threat to public health and safety (ITPHS) must be upgraded, replaced, or its use discontinued within ten months of receipt of this notice or within a shorter period if required by local ordinance. If the system is failing to protect ground water, the system must be upgraded, replaced, or its use discontinued within the time required by local ordinance. If an existing system is not failing as defined in law, and has at least two feet of design soil separation, then the system need not be upgraded, replaced, or its use discontinued, notwithstanding any local ordinance that is more strict. This provision does not apply to systems in shoreland areas, Wellhead Protection Areas, or those used in connection with food, beverage, and lodging establishments as defined in law.

Inspect Minnesota & Midwest Soil Testing

Subsurface Sewage Treatment System Owner/Property Information


This information will be used for the purpose of conducting an MPCA Compliance Inspection.

Property Address: 13206 24 th St Ct N, West Lakeland, MN Zip: 55082 Property Owner: Jordan & Christi Zweig Phone: 713-202-6798 Tank(s) Tank(s)Material Soil Treatment System Other Septic 2 Fiberglass Rock trench Alternative system Other Aerobic Plastic Gravelless trench Experimental system Experimental system Holding Concrete Seepage bed Other system Other system Other: Block Mound Other system Other system Other: Block Mound Other system Image: Seepage bed Are the tank maintenance covers accessible? Y es No< *If no, proper maintenance must be performed through the maintenance holes. Maintenance hole covers should be made accessible to the ground surface to facilitate access and proper maintenance of the system. Year house built: 2014 Year septic installed: 2014 Tank size (gals.): 1-1500, 1-1000 How long has seller owned the property? 2017 Number of residents in home? 3 Number of bedrooms? 4 Year all floors drained by gravity? Y Garbage disposal? Y Whirlpool bath? Y More than one system (laundry, etc.)? N Does this proper				
Property Owner: Jordan & Christi Zweig Phone: 713-202-6798 Tank(s) Tank(s)Material Soil Treatment System Other Septic 2 Fiberglass Rock trench Alternative system Aerobic Plastic Gravelless trench Experimental system Holding Concrete Seepage bed Other system Other: Block Mound				
Tank(s) Tank(s)Material Soil Treatment System Other Septic 2 Fiberglass Rock trench Alternative system Experimental system Aerobic Plastic Gravelless trench Experimental system Experimental system Holding Concrete Seepage bed Other system Other system				
Septic 2 Fiberglass Rock trench Atternative system Aerobic Plastic Gravelless trench Experimental system Lift Metal Chamber trench Experimental system Holding Concrete Seepage bed Other system Experimental system Other Block Mound Other system Other system Year the tank maintenance covers accessible? Yes No *If no, proper maintenance must be performed through the maintenance holes. Maintenance hole covers should be made accessible to the ground surface to facilitate access and proper maintenance of the system. Year house built: 2014 Year septic installed: 2014 Tank size (gals.): 1-1500, 1-1000 How long has seller owned the property? 2017 Number of residents in home? 3 Number of bedrooms? 4 Are all floors drained by gravity? Y Garbage disposal? Y Whirlpool bath? Y More than one system (laundry, etc.)? N Does this property have any footing drain tiles connected to the septic system? N Are any buildings on this property such as garages or out-buildings connected to this system? N Are there any additional systems on this property serving other buildings? N Location of septic system on lot? Tanks - East Side, Seepage Bed - Southeast Side				
Image: Second system				
☐ Holding ☐ Concrete ☐ Seepage bed ☐ Other system ☐ Other: ☐ Block ☐ Mound				
□ Other: □ Block □ Mound □ Other: □ Other □ At-grade Are the tank maintenance covers accessible? □ Yes □ No *If no, proper maintenance must be performed through the maintenance holes. Maintenance hole covers should be made accessible to the ground surface to facilitate access and proper maintenance of the system. Year house built: 2014 Year septic installed: 2014 Tank size (gals.): 1-1500, 1-1000 How long has seller owned the property? 2017 Number of residents in home? 3 Number of bedrooms? 4 Are all floors drained by gravity? Y Garbage disposal? Y Whirlpool bath? Y More than one system (laundry, etc.)? N Does this property have any footing drain tiles connected to the septic system? N Are any buildings on this property such as garages or out-buildings connected to this system? N Are there any additional systems on this property serving other buildings? N Location of septic system on lot? Tanks - East Side, Seepage Bed - Southeast Side				
Are the tank maintenance covers accessible? ⊠ Yes □ No *If no, proper maintenance must be performed through the maintenance holes. Maintenance hole covers should be made accessible to the ground surface to facilitate access and proper maintenance of the system. Year house built: 2014 Year septic installed: 2014 Tank size (gals.): 1-1500, 1-1000 How long has seller owned the property? 2017 Number of residents in home? 3 Number of bedrooms? 4 Are all floors drained by gravity? Y Garbage disposal? Y Whirlpool bath? Y More than one system (laundry, etc.)? N Does this property have any footing drain tiles connected to the septic system? N Are any buildings on this property such as garages or out-buildings connected to this system? N Are there any additional systems on this property serving other buildings? N Location of septic system on lot? Tanks - East Side, Seepage Bed - Southeast Side				
performed through the maintenance holes. Maintenance hole covers should be made accessible to the ground surface to facilitate access and proper maintenance of the system.Year house built: 2014Year septic installed: 2014Tank size (gals.): 1-1500, 1-1000How long has seller owned the property? 2017Number of residents in home? 3Number of bedrooms? 4Are all floors drained by gravity? YGarbage disposal? YWhirlpool bath? YMore than one system (laundry, etc.)? NDoes this property have any footing drain tiles connected to the septic system? NAre any buildings on this property such as garages or out-buildings connected to this system? NAre there any additional systems on this property serving other buildings? NLocation of septic system on lot? Tanks - East Side, Seepage Bed - Southeast Side				
performed through the maintenance holes. Maintenance hole covers should be made accessible to the ground surface to facilitate access and proper maintenance of the system.Year house built: 2014Year septic installed: 2014Tank size (gals.): 1-1500, 1-1000How long has seller owned the property? 2017Number of residents in home? 3Number of bedrooms? 4Are all floors drained by gravity? YGarbage disposal? YWhirlpool bath? YMore than one system (laundry, etc.)? NDoes this property have any footing drain tiles connected to the septic system? NAre any buildings on this property such as garages or out-buildings connected to this system? NAre there any additional systems on this property serving other buildings? NLocation of septic system on lot? Tanks - East Side, Seepage Bed - Southeast Side				
Year house built: 2014Year septic installed: 2014Tank size (gals.): 1-1500, 1-1000How long has seller owned the property? 2017Number of residents in home? 3Number of bedrooms? 4Are all floors drained by gravity? YGarbage disposal? YWhirlpool bath? YMore than one system (laundry, etc.)? NDoes this property have any footing drain tiles connected to the septic system? NAre any buildings on this property such as garages or out-buildings connected to this system? NAre there any additional systems on this property serving other buildings? NLocation of septic system on lot? Tanks - East Side, Seepage Bed - Southeast Side				
How long has seller owned the property? 2017 Number of residents in home? 3 Number of bedrooms? 4 Are all floors drained by gravity? Y Garbage disposal? Y Whirlpool bath? Y More than one system (laundry, etc.)? N Does this property have any footing drain tiles connected to the septic system? N Are any buildings on this property such as garages or out-buildings connected to this system? N Are there any additional systems on this property serving other buildings? N Location of septic system on lot? Tanks - East Side, Seepage Bed - Southeast Side				
Number of bedrooms? 4 Are all floors drained by gravity? Y Garbage disposal? Y Whirlpool bath? Y More than one system (laundry, etc.)? N Does this property have any footing drain tiles connected to the septic system? N Are any buildings on this property such as garages or out-buildings connected to this system? N Are there any additional systems on this property serving other buildings? N Location of septic system on lot? Tanks - East Side, Seepage Bed - Southeast Side				
Garbage disposal? Y Whirlpool bath? Y More than one system (laundry, etc.)? N Does this property have any footing drain tiles connected to the septic system? N Are any buildings on this property such as garages or out-buildings connected to this system? N Are there any additional systems on this property serving other buildings? N Location of septic system on lot? Tanks - East Side, Seepage Bed - Southeast Side				
More than one system (laundry, etc.)? N Does this property have any footing drain tiles connected to the septic system? N Are any buildings on this property such as garages or out-buildings connected to this system? N Are there any additional systems on this property serving other buildings? N Location of septic system on lot? Tanks - East Side, Seepage Bed - Southeast Side				
Does this property have any footing drain tiles connected to the septic system? N Are any buildings on this property such as garages or out-buildings connected to this system? N Are there any additional systems on this property serving other buildings? N Location of septic system on lot? Tanks - East Side, Seepage Bed - Southeast Side				
Are any buildings on this property such as garages or out-buildings connected to this system? N Are there any additional systems on this property serving other buildings? N Location of septic system on lot? Tanks - East Side, Seepage Bed - Southeast Side				
Are there any additional systems on this property serving other buildings? N Location of septic system on lot? Tanks - East Side, Seepage Bed - Southeast Side				
Location of septic system on lot? Tanks - East Side, Seepage Bed - Southeast Side				
Location of septic system on lot? Tanks - East Side, Seepage Bed - Southeast Side				
Location of septic system on lot? Tanks - East Side, Seepage Bed - Southeast Side				
Location of water well on lot? West Side				
Location of water wen on lot? West side Is the wen a deep wen? I				
Have you ever experienced any problems with the system such as: tree roots, sewage back-ups,				
surfacing of sewage onto the ground, septic tank overflowing, etc.; or have any repairs been made				
to the system? N If yes, explain:				
When was the system last pumped? Due Pump Name of pumper: N/A				
How often pumped in previous years? Never? Is system on a monitoring plan? N				
Have you received notices from any government agency concerning this system? N				
Is your property located in a shoreland management area? N Do you have any additional information that should be given to the new owner? N				
bo you have any additional information that should be given to the new owner? IN				

I hereby certify that the above information is correct to the best of my knowledge. I also understand that if the system is considered "non-compliant/failing" per MPCA rules, that the inspector must by law submit a copy of this report to the local government unit within 15 days of the date of inspection completion. I also agree that unless otherwise noted in this report, that I/we are ultimately responsible for payment of all fees for all work performed relative to this inspection by Inspect Minnesota and Midwest Soil Testing.

Owner/Occupant: Christi Zweig's Signature On File

Date: 4/15/2019

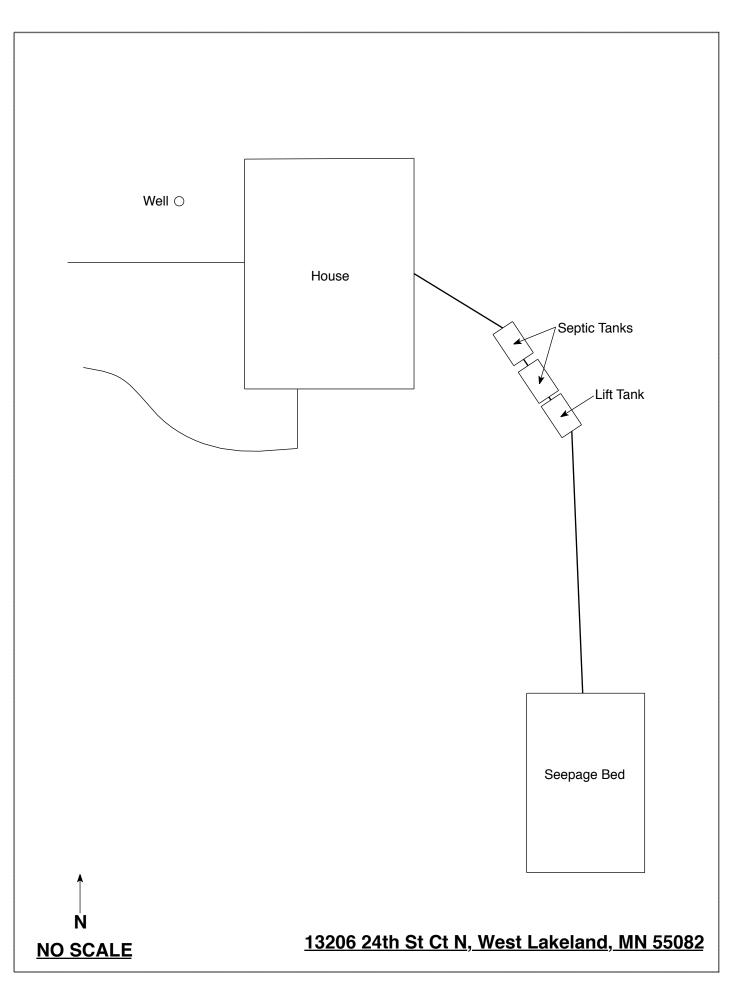

4. Soil Separation -- Compliance component #4 of 5

Date of installation: _8/12/2014		Verification method(s):
(mm/dd/yyyy) Shoreland/Wellhead protection/Food beverage lodging? Compliance criteria:	🗌 Yes 🛛 No	Soil observation does not expire. Previous soil observations by two independent parties are sufficient, unless site conditions have been altered or local requirements differ.
For systems built prior to April 1, 1996, and not located in Shoreland or Wellhead Protection Area or not serving a food, beverage or lodging establishment: Drainfield has at least a two-foot vertical separation distance from periodically saturated soil or bedrock.	☐ Yes ☐ No	 Conducted soil observation(s) (Attach boring logs) Two previous verifications (Attach boring logs) Not applicable (Holding tank(s), no drainfield) Unable to verify (See Comments/Explanation) Other (See Comments/Explanation)
Non-performance systems built April 1, 1996, or later or for non-performance systems located in Shoreland or Wellhead Protection Areas or serving a food, beverage, or lodging establishment: Drainfield has a three-foot vertical separation distance from periodically saturated soil or bedrock.*	⊠ Yes □ No	Comments/Explanation: B-1 0-11 topsoil10 YR 3/3 11-32 loamy sand10 YR 4/4 32-64 med sand7.5 YR 4/6
"Experimental", "Other", or "Performance" systems built under pre-2008 Rules; Type IV or V systems built under 2008 Rules (7080. 2350 or 7080.2400 (Advanced Inspector License required) Drainfield meets the designed vertical separation distance from periodically saturated soil or bedrock.	☐ Yes ☐ No	Indicate depths or elevations A. Bottom of distribution media 24 B. Periodically saturated soil/bedrock 24 C. System separation 40 D. Required compliance separation* 36
Anv "no" answer above indicates t	he svstem is	*May be reduced up to 15 percent if allowed by Local

failing to protect groundwater.

A. Bottom of distribution media	24
B. Periodically saturated soil/bedrock	
C. System separation	40
D. Required compliance separation*	36
*Mov he reduced up to 15 percent i	fallowed by Local

Ordinance.

Not applicable 5. Operating Permit and Nitrogen BMP* – Compliance component #5 of 5

Yes No If "yes", A below is required Is the system operated under an Operating Permit? Yes No If "yes", B below is required Is the system required to employ a Nitrogen BMP?

BMP = Best Management Practice(s) specified in the system design

If the answer to both questions is "no", this section does not need to be completed.

Compliance criteria

a.	Operating Permit number:n/a	🗌 Yes 🔲 No				
	Have the Operating Permit requirements been met?					
b.	Is the required nitrogen BMP in place and properly functioning?	🗌 Yes 🗌 No				
Any "no" answer indicates Noncompliance.						

Upgrade Requirements (Minn. Stat. § 115.55) An imminent threat to public health and safety (ITPHS) must be upgraded, replaced, or its use discontinued within ten months of receipt of this notice or within a shorter period if required by local ordinance. If the system is failing to protect ground water, the system must be upgraded, replaced, or its use discontinued within the time required by local ordinance. If an existing system is not failing as defined in law, and has at least two feet of design soil separation, then the system need not be upgraded, repaired, replaced, or its use discontinued, notwithstanding any local ordinance that is more strict. This provision does not apply to systems in shoreland areas,

Wellhead Protection Areas, or those used in connection with food, beverage, and lodging establishments as defined in law.

Tradewell Soil Testing 18330 Dahlia Street NW Cedar, MN 55011

Name: Landucci Homes, Inc.

Date: December 13th, 2013

Address: Lot 8 Block 1 Artisan (13206 24th Street North) West Lakeland

Boring #1	Boring #2	Boring #3	Boring #4
0"- 6" Topsoil	0"- 8" Topsoil	0"- 8" Topsoil	0"- 8" Topsoil
Fine Sandy Loam	Loamy Fine Sand	Loamy Fine Sand	Loamy Fine Sand
10YR 3/2	10YR 3/1	10YR 3/2	10YR 3/1
6"- 36"	8"- 24"	8"-26"	8"- 22"
Fine Sandy Loam &	Fine Sandy Loam	Loamy Fine Sand	Loamy Fine Sand
Gravel 7.5YR 3/4	10YR 4/4	10YR 4/4	10YR 4/4
36"- 72"	24"- 40"	26"- 54"	22"- 50"
Loam/ Sandy Loam &	Very Fine Loamy Sand	Sandy Loam & Gravel	Sandy Loam & Gravel
Gravel 10YR 3/4 3/6	10YR 4/6 5/6	10YR 3/4 3/6	10YR 3/4 3/6
	40"- 64"		
	Loamy Fine Sand &	· · ·	
	Gravel 10YR 4/4 4/6		
·····			
No Mottle Found	Mottles @ 58"	Mottles @ 46"	Mottles @ 48"
Dry Hole	Dry Hole	Dry Hole	Dry Hole

SOIL BORING TEST REPORT

4- Bedroom, Type 1 Home (600 GPD Flow)

Perc Rate = 16- 30 MPI 1.67 SSF

2-1000 gallon septic tanks

1000 gallon pump tank

1000 square feet of drainfield with 6" of rock below the pipe

38 cubic yards or 54 ton of clean rock

Maintain 36" between mottled soil and bottom of rock bed.

Inducel

Mark Tradewell MPCA #307 Tradewell Soil Testing 18330 Dahlia Street NW Cedar, MN 55011

Date: December 13th, 2013

Name: Landucci Homes, Inc.

Address: Lot 8 Block 1 Artisan (13206 24th Street North) West Lakeland

SOIL BORING TEST REPORT

Boring #5					 · · · · · · · · · · · ·	······
0"- 6" Topsoil	······································	 				
Loamy Fine Sand						•
10YR 3/2						
6"- 42"		 ·			 	
Very Fine Sandy Loam						
10YR 4/4 5/4				l l		
42"- 70"			· _ ·		 	·
Loamy Sand						
10YR 4/6 4/4						
**Hit obstruction					 	
			·		 	
No Mottles @ 70"						
Dry Hole				÷		

Julewell

Mark Tradewell MPCA #307

DISCLAIMER

Brian L. Humpal, Inc. dba. Inspect Minnesota, Midwest Soil Testing

Relative to Subsurface Sewage Treatment System (SSTS) Compliance Inspections

- 1. This inspection/report is being performed for only the seller/owner of the property on which the SSTS is located. In such case that another party is paying for the inspection, the contract is between only said party and Brian L. Humpal, Inc.; there is no contract between Brian L. Humpal, Inc. and any other party unless otherwise noted.
- 3. Brian L. Humpal, Inc. has not been retained to warranty, guarantee, or certify the proper functioning of the SSTS for any period of time beyond the date of inspection or into the future. Because of the numerous factors (usage, maintenance, soil characteristics, previous failures, etc.) which may affect the proper operation of an SSTS, as well as the inability of Brian L. Humpal, Inc. to supervise or monitor the use or maintenance of the SSTS, the report shall not be construed as a warranty by Brian L. Humpal, Inc. that the SSTS will function properly for any particular party for any period of time.
- 4. Brian L. Humpal, Inc. is unable to verify the frequency and/or, quality of prior or future maintenance of the SSTS. Maintenance of the tank(s) must be performed through the tanks maintenance hole. The removal of solids from any location other than the maintenance hole is not a compliant method of maintenance. It is strongly recommended that maintenance covers be made accessible to the ground surface to facilitate proper maintenance.
- 5. Minimum Compliance Inspection requirements relative to this inspection and this report include <u>only</u> verification that the SSTS has tank(s) (septic tanks, lift tanks, dosing tanks, stilling tanks, etc.) which are watertight below the designed operating depth, the required separation between the bottom of the subsurface soil distribution medium and seasonally saturated soils, no back-ups of sewage into the dwelling, no discharge of sewage/effluent to the ground surface or surface waters, and no imminent safety hazards. Brian L. Humpal, Inc. does not inspect plumbing or pumps prior to the first SSTS component as these are plumbing components. The performance of exterior pumps and associated components are not inspected as they are considered to be maintenance items. Additionally, no indications relative to compliance with electrical code requirements have been made. It is recommended that any other applicable plumbing, electrical, housing, etc. inspections be performed by a qualified inspection business. Sewage back-up verification is limited to observing the floor drain area and/or the information supplied by the last occupants of the building prior to inspection. Brian L. Humpal, Inc. cannot guarantee that the information given to them by the last occupants of the building prior to inspection relative to back-ups is accurate.
- 4. Certification of this SSTS does not warranty future use beyond the date of the inspection. Any SSTS, old or new, can become hydraulically overloaded or discharge sewage/effluent to the ground surface as a result of more people moving into the house than were previously occupying the house, improper maintenance, heavy usage, leaking plumbing fixtures, groundwater infiltration, tree roots, freezing conditions, surface drainage problems, poor initial design, poor construction practices, or unsuitable materials used in constructing the system; the system can also simply stop working because of its age. An SSTS that has been properly designed and installed, properly maintained, and used in the manner for which the system was designed can be expected to provide service for twenty to twenty-five years on average. Some parts of the SSTS such as alarms, switches, pumps, filters, etc. will most likely have to be repaired or replaced over the lifetime of the system.
- 5. A Compliance Inspection is not meant to be a test or inspection for longevity of the system; a Compliance Inspection is strictly for the purpose of determining if the SSTS is protective of public health and safety, as well as the groundwater at the date and time the inspection was performed. This inspection is not intended to determine if the SSTS was originally designed or installed to past or present MPCA or other Local Government Unit code requirements. This inspection is not intended to determine if the SSTS was designed and/or installed to support the anticipated flow from the building as the use of the building may have changed since the design and construction of the SSTS due to the addition of bedrooms, occupants, etc. In addition, this inspection is not intended to determine the quality of the original SSTS design, the quality of the construction practices used while installing the SSTS, or the quality of the materials used in constructing the SSTS.
- 6. Brian L. Humpal, Inc. cannot guarantee the performance of SSTS products/components such as: gravelless pipe, chamber trenches, effluent filters, tanks, sewage pre-treatment components, piping, etc. Products such as gravelless pipe are no longer approved for installation in the State of Minnesota and may have a significantly reduced performance and/or life expectancy.
- 7. WINTER WORK: By accepting this report, it is understood that inspections conducted during winter months (approximately November 1st through April 1st) are more difficult to perform because of possible snow cover and/or ground frost. SSTS components such as tanks, maintenance covers, tank inspection pipes, subsurface distribution medium inspection pipes, and soil treatment areas are more difficult or impossible to locate due to snow cover and/or ground frost. In addition, soil borings are more difficult to perform due to snow cover and/or ground frost. Brian L. Humpal, Inc. will attempt to use the same level of standards when performing work during winter periods as when performing work during non-winter periods. However, the recipient of this report understands that because of the aforementioned considerations, the same level of standards may not be possible.
- 8. By accepting this report, the client understands that Brian L. Humpal, Inc. will not be responsible for any monetary damages exceeding the fee for the services provided.

Subsurface Sewage Treatment Systems Non-transferable Business License

Inspect Minnesota, Midwest Soil Testing

License Expires: 12/22/2019

Issued: 11/20/2018

Specialty Area(s):

License # L2896

Installer Maintainer Service Provider Advanced Designer Advanced Inspector

Designated Certified Individual(s):

Cert #	Name	Certification Expires:
C9633	Anthony P Scully	3/5/2020
•	Installer, Designer (Apprentice)	
C5342	Brian L Humpal	10/15/2023
	Installer, Maintainer, Serv Prov, Adv D	esigner, Adv Inspector
C9852	Christopher R Uebe	3/4/2021
	Designer, Inspector	

MINNESOTA POLLUTION CONTROL AGENCY

520 Lafayette Road North St. Paul, Minnesota 55155-4194

Nich Haig

Nick Haig, Supervisor Certification and Training Unit