Inspect Minnesota & Midwest Soil Testing

P.O. Box 10853 White Bea	Brian Humpal					
651-492-7550/Brian@Midv	MPCA Licensed Advanced Inspector					
SUBSURFACE SEWAGE	(SSTS) COMPLIANCE REPORT					
Date: May 28, 2019	Time: 11:00 AM	Owner: Jason Pieper				
Inspection Address: 11860 Irish Ave N, Grant, MN 55082						

REPORT SUMMARY

I have performed an "MPCA Compliance Inspection" on this system, have reviewed the history of the system with the owner, Jason Pieper, and have reviewed the original design/permit records, along with two previous compliance inspections from 2016 and 2007, which were on file at Washington County. This system consists of two pre-cast septic tanks, a pre-cast lift tank, and a mound.

Predicated on my inspection of the system, my review of the history of the system with the owner, and my review of the records, it is my opinion that this system <u>presently meets</u> MPCA minimum compliance inspection requirements.

Inspect Minnesota and Midwest Soil Testing have been hired to perform a compliance inspection of this SSTS for compliance with local ordinances pursuant to Minn. Stat. § 115.55 (2013). This compliance inspection covers only the criteria required by Minn. Stat. § 115.55 Subd. 5a (2013) and Minn. R. 7080.1500 (2011). A compliance inspection is an indication of the current compliance status of the system and does not guarantee the performance or longevity of this system beyond the date of inspection, as it is impossible to determine the future performance of any system. Inspect Minnesota and Midwest Soil Testing disclaim any use of this compliance inspection beyond determining SSTS compliance pursuant to Minn. Stat. § 115.55 Subd. 5a (2013) and Minn. R. 7080.1500 (2011).

Please contact me should you have any questions.

Christopher Uebe

Brian Humpal

Brian Humpal

Minnesota Pollution Control Agency	Compl
520 Lafayette Road North St. Paul. MN 55155-4194	Existing Sub

iance Inspection Form

surface Sewage Treatment Systems (SSTS)

Doc Type: Compliance and Enforcement

Page 1 of 3

nstructions: Inspection results based on Minnesota Pollution Control Agency (MPCA)
requirements and attached forms – additional local requirements may also apply.

For local tracking purposes:

Submit completed form to Local Unit of Government (LUG) and system owner within 15 days

System Status

System status on date (mm/dd/yyyy): 5/28/2019

Compliant – Certificate of Compliance

(Valid for 3 years from report date, unless shorter time frame outlined in Local Ordinance.)

Noncompliant – Notice of Noncompliance

(See Upgrade Requirements on page 3)

Reason(s) for noncompliance (check all applicable)

□ Impact on Public Health (Compliance Component #1) – Imminent threat to public health and safety

Other Compliance Conditions (Compliance Component #3) – Imminent threat to public health and safety

2 of 9

Tank Integrity (Compliance Component #2) – Failing to protect groundwater

Other Compliance Conditions (Compliance Component #3) – Failing to protect groundwater

Soil Separation (Compliance Component #4) – Failing to protect groundwater

Operating permit/monitoring plan requirements (Compliance Component #5) – Noncompliant

Property Information

Parcel ID# or Sec/Twp/Range:

Property address:	11860 Irish Ave N, Grant, MN 55082	Reason for inspection: Property Transfer
Property owner: Jason Pieper		Owner's phone: 612-790-6814
or		
Owner's represent	ative:	Representative phone:
Local regulatory authority: Washington County		Regulatory authority phone: _651-430-6655
Brief system desc	ription:Two pre-cast septic tanks, a pre-cast	lift tank, and a mound.
Comments or reco	mmendations:	

Comments or recommendations:

Certification

wq-wwists4-31 • 1/24/12

I hereby certify that all the necessary information has been gathered to determine the compliance status of this system. No determination of future system performance has been nor can be made due to unknown conditions during system construction, possible abuse of the system, inadequate maintenance, or future water usage.

Inspector name:	impal/Christo	pher	Uebe			Certification numb	C5342/C9852		
Business name:	Inspect I	Minnesota, M	lidwe	st Soil Testing			License numb	ber:	L2896
Inspector signatur	re:	Brian ?	Hus	npal Africa	_//	h	Phone numb	oer:	651-492-7550
Necessary or	Locally	y Require	d A	ttachment	S				
Soil boring lo	ogs	Syste	em/A	s-built drawing	J		Forms per local ord	inar	nce
Other inform	ation (list)	: Report S	umm	ary, Property I	nforr	mation, Dis	claimer, License		
www.pca.state.mn.	us • 6	51-296-6300	•	800-657-3864	•	TTY 651-2	.82-5332 or 800-657-3	864	• Available in alternative formats

1. Impact on Public Health – Compliance component #1 of 5

🗌 Yes 🖾 No
🗌 Yes 🖾 No
🗌 Yes 🖾 No

Any "yes" answer above indicates the system is an Imminent Threat to Public Health and Safety.

Comments/Explanation:

None of the above found.

Verification method(s):

- Searched for surface outlet
- Searched for seeping in yard/backup in home
- Excessive ponding in soil system/D-boxes
- Homeowner testimony (See Comments/Explanation)
- "Black soil" above soil dispersal system
- System requires "emergency" pumping
- Performed dye test
- Unable to verify (See Comments/Explanation)
- Other methods not listed (See Comments/Explanation)

2. Tank Integrity – Compliance component #2 of 5

Compliance criteria:		Verification method(s):
System consists of a seepage pit, cesspool, drywell, or leaching pit.	🗌 Yes 🛛 No	 Probed tank(s) bottom Examined construction records
Seepage pits meeting 7080.2550 may be compliant if allowed in local ordinance.		Examined Tank Integrity Form (Attach)
Sewage tank(s) leak below their designed operating depth.	🗌 Yes 🖾 No	 Observed liquid level below operating depth Examined empty (pumped) tanks(s)
If yes, which sewage tank(s) leaks:		Probed outside tank(s) for "black soil"
Any "yes" answer above indic system is Failing to Protect G		 Unable to verify (See Comments/Explanation) Other methods not listed (See Comments/Explanation)

Comments/Explanation:

Lowered underwater camera into tanks - baffles and tank walls OK. Lift pump and alarm were operational at the time of the inspection.

3. Other Compliance Conditions - Compliance component #3 of 5

a.	Maintenance hole covers are damaged, cracked, unsecured, or appear to structurally unsound.	□ Yes*	🛛 No	Unknown

b. Other issues (electrical hazards, etc.) to immediately and adversely impact public health or safety. \Box Yes* \boxtimes No \Box Unknown *System is an imminent threat to public health and safety

Explain:

c. System is non-protective of ground water for other conditions as determined by inspector □ Yes* ⊠ No *System is failing to protect groundwater

Explain:

4. Soil Separation – Compliance component #4 of 5

Date of installation: 2004	Unknown	Verification method(s):					
Shoreland/Wellhead protection/Food Beverage Lodging?	🗌 Yes 🛛 No	Soil observation does not expire. Pr observations by two independent pa					
Compliance criteria:	1	unless site conditions have been altered or local					
For systems built prior to April 1, 1996, and not located in Shoreland or Wellhead Protection Area or not serving a food, beverage or lodging establishment: Drainfield has at least a two-foot vertical separation distance from periodically	☐ Yes ☐ No	 requirements differ. Conducted soil observation(s) (Attach boring log Two previous verifications (Attach boring logs) Not applicable (Holding tank(s), no drainfield) Unable to verify (See Comments/Explanation) 					
saturated soil or bedrock.		Other (See Comments/Explanation)				
Non-performance systems built April 1, 1996, or later or for non-performance systems located in Shoreland or Wellhead Protection Areas or serving a food, beverage, or lodging establishment: Drainfield has a three-foot vertical separation distance from periodically saturated soil or bedrock.*	⊠ Yes □ No	Comments/Explanation: Reviewed previous compliance inspection from 20 Reviewed previous compliance inspection from 20 Reviewed design and permit records.					
"Experimental", "Other", or "Performance"	🗌 Yes 🗌 No	Indicate depths of elevations	Indicate depths of elevations				
systems built under pre-2008 Rules; Type IV or V systems built under 2008 Rules (7080. 2350 or 7080.2400 (Advanced Inspector License required)		A. Bottom of distribution media	See Attached Boring Log(s)				
Drainfield meets the designed vertical		B. Periodically saturated soil/bedrock					
separation distance from periodically saturated soil or bedrock.		C. System separation					
		D. Required compliance separation*					
Any "no" answer above indicates the system is *May be reduced up to 15 percent if allowed by Lo Failing to Protect Groundwater. Ordinance.							
Operating Permit and Nitrogen BMP* – Compliance component #5 of 5 Not applicable Is the system operated under an Operating Permit? Yes No If "yes", A below is required							

Is the system required to employ a Nitrogen BMP?

BMP=Best Management Practice(s) specified in the system design

If the answer to both questions is "no", this section does not need to be completed.

Compliance criteria

5.

a.	Operating Permit number:	🗌 Yes 🗌 No
	Have the Operating Permit requirements been met?	
b.	Is the required nitrogen BMP in place and properly functioning?	🗌 Yes 🗌 No

Any "no" answer indicates Noncompliance.

Upgrade Requirements (Minn. Stat. § 115.55) An imminent threat to public health and safety (ITPHS) must be upgraded, replaced, or its use discontinued within ten months of receipt of this notice or within a shorter period if required by local ordinance. If the system is failing to protect ground water, the system must be upgraded, replaced, or its use discontinued within the time required by local ordinance. If an existing system is not failing as defined in law, and has at least two feet of design soil separation, then the system need not be upgraded, replaced, or its use discontinued, notwithstanding any local ordinance that is more strict. This provision does not apply to systems in shoreland areas, Wellhead Protection Areas, or those used in connection with food, beverage, and lodging establishments as defined in law.

Inspect Minnesota & Midwest Soil Testing

Subsurface Sewage Treatment System Owner/Property Information


This information will be used for the purpose of conducting an MPCA Compliance Inspection.

Date of Inspection: May 28, 2019	Time: 11:00 AM			
Property Address: 11860 Irish Ave N, Grant, MN	Zip: 55082			
Property Owner: Jason Pieper	Phone: 612-790-6814			
Tank(s) Tank(s)Material Soil Treatme Septic 2 Fiberglass Rock trend Aerobic Plastic Gravelless Material Chamber Gravelless Mound Concrete Seepage b Other: Block Mound Other At-grade Are the tank maintenance covers accessible? Yes performed through the maintenance holes. Maintenance the ground surface to facilitate access and proper mainter	nt System Other ch Alternative system			
	-			
Year house built: 2004 Year septic installed: 200	Tank size (gals.): 1-1500,1-1000 mber of residents in home? 4-5			
	ained by gravity? Y			
	pool bath? N			
More than one system (laundry, etc.)? N				
Does this property have any footing drain tiles connecte				
Are any buildings on this property such as garages or ou	at-buildings connected to this system? N			
Are there any additional systems on this property servin	g other buildings? N			
Location of septic system on lot? Tanks - Northeast Sid	e, Mound - East Side			
Location of water well on lot? South Side	Is the well a deep well? Y			
Have you ever experienced any problems with the syste				
surfacing of sewage onto the ground, septic tank overflo to the system? N If yes, explain:	owing, etc.; or have any repairs been made			
When was the system last pumped? 2017 Nat	me of pumper: Olson's Sewer Service			
How often pumped in previous years? Every 3	Is system on a monitoring plan? N			
Have you received notices from any government agency concerning this system? N				
Is your property located in a shoreland management area? N				
Do you have any additional information that should be				

I hereby certify that the above information is correct to the best of my knowledge. I also understand that if the system is considered "non-compliant/failing" per MPCA rules, that the inspector must by law submit a copy of this report to the local government unit within 15 days of the date of inspection completion. I also agree that unless otherwise noted in this report, that I/we are ultimately responsible for payment of all fees for all work performed relative to this inspection by Inspect Minnesota and Midwest Soil Testing.

Owner/Occupant: Jason Pieper's Signature On File

Date: 5/28/2019

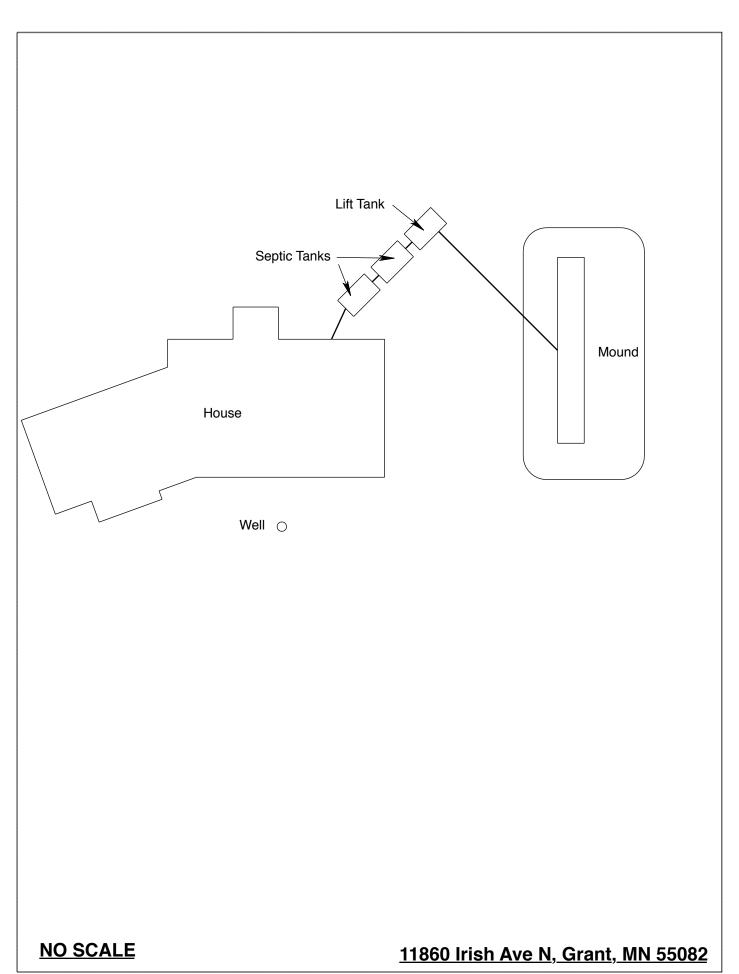

						. ».
		io -	<u>ہ</u>	8 7	പ	- ω - υ - μ
			╉┋╋╋	┼┽┼┼┼┼	┥╷╷╷╷╷╷╷	++++++++++++++++++++++++++++++++++++
	oil Borings	- I I'			1.1.1.1.1.	KIER NO
				OTTLE	G.	EDDISH EDDISH SANDY WDITLE
Location of Project: 11860 Irish Ave. N., G Borings Made By: Inspect Minnesota]		IN IN	STep	
Auger Used: Hand/Bucket	Date: 11/8/07 Classification System: USDA			36		Row Row
Boring Number: 1	Boring Number:	-			1.1.1.1.1.1	
Surface 63" Below Top Of Mound On	Surface	1 †	┼┼┼┼┼┼	┥┥┤┊┋┊	┼┼┼┼┼┼┼	╎┼┼┼┼┊╎┊╎┼╎┊╎
Boring Original Contour	Elevation of Boring			9		LIGHT FINE BODISI FINE FINE WITH
Depth In Inches Soils Encountered	Depth In Solla Francistand	1		PY OT		포공유로 뉴트
0-3 10YR 2/2 Loam	Inches Solis Encountered	4		6. 8		BROWN SAND BROW TO SAND TO SAND
3-14 10YR 3/4 Loamy Sand 14-17 10YR 5/4 Loamy Sand						SUP CONN
17-27 10YR 5/4 Loamy Sand With Few 7.5YR 5/8 Mottles			+++++	┼┼┼┼┼┼┼┼	┼┼┼┼┼┼┼	╎╷╷╷╷╷╷╷╷╷╷╷
27-36 5YR 4/6 Sandy Clay Loam With 10YR 5/3 Mottles				0 30		36 75
LUTR 5/3 Mottles				CIGHT SEDIU		LIGHT FINE SPANE
				5 5		
				V_ P SP		BROWN SAND BROWN
				De L		3.2 2
		+	┼┼┼┼┼┼	┼┼┼┼┼┼┼┼	╎╎╎╎╎╎╎╎	┝ <u></u> <u></u> <u></u> <u></u> <u></u>
		'		Merr	FAINT REDDIS SAND MOTTLE	LIGHT FINE FINE MEDISH FINE NIEDISH CHITH L
				210 210		EDDISH FINE FINE FINE DUITH
				"i 0	7.	
				e',	\$45 28m	BROWN SAND BROWN BROWN SAND SAND SAND SAND
			1111			
				יויוייוי	1.1.1.1.	
17" Depth To End Of Boring Or Mottled Soils	Depth To End Of Boring Or Mottled Soils					LIGHT FINE SANSY SANSY
+63" Elevation Of Boring Relative To System -30" Depth To Bottom Of System	Elevation Of Boring Relative To System			R é		
=50" Of Separation	Depth To Bottom Of System Of Separation		1	ω. 	7	BROWN SAND LOAM
End Of Boring At: 36"	End Of Boring At:				1	n Xel Dy
Mottled Soil Present At: 17"	Mottled Soil Present At:		┼┼┼┼┼	┼┼┼┼┼┼ ┼	╋╹╏╹╹╹	┼╎<mark>╎╎</mark>┊┊┊┊┊┊
Standing Water Present At: None	Standing Water Present At:			M	O(V)	
Bottom Of Distribution Medium At:	30 Inches			Мотъе	IVIOque dataol	LIGHT FINE SANDY SANDY
				(m (v.) //	F 2 6 8 6 8
				, M	0 F	BROWN, BROWN, LORM BROWN
7 of	12				8	of 12 Z Z

	· ·	h		10
· · · · · · · · · · · · · · · · · · ·	∽ <u>~</u> +++++++	ч « ш	PEPTH	J08 <u>В.</u> 7 9, <u>Ви</u>
	с. Стар	LIGNT BROWN, FINE SAND BEDGISH BROWN SANDY LOAM	HOLE 1/3 Top SOIL- SANDY LOAM	100 BRACHING HARDESTER, SARAN LOT?, BUT OF CRANTES, SARAN MATE 8-39-04
	++++++++++			· &
	•		HOLE	বর্ব
┃ ┃ ╎╷╎╷╎╻╎╻╎╻╎╻╎╻╎╻╎╹	<u>++++++</u>	┥┥╸┥╺┊	++++	
			HOLE #	BOR ING LOG
				LOG
┠ ╎╷╎╷<mark>╎</mark>╷╎╷╎╷╎╷╎╷╎╷╎	+++++++++	+++++++++++++++++++++++++++++++++++++++	++++	
			HOLE #	
╷ ┠ ╎╷╷╷╎╷╞╷╞╷╞╻╡╻╡╻ ╋┲╋┥	└┼┼┼┼┼┼┼┥	++++++++++		BOR
			HOLE #	BOREHOLE DIAMETER
	unin	Lititite		
	• <u>•</u> •• <u>•</u> ••		HOLE #	TRGE 2 OF 2 4". 36"-26"-1" HAND BUGER
	9 of 12			

		•	and the second s
			JOB
0457 5-	PBSTRUCTION	SANDY LOAM	DOR <u>SAUDY</u> <u>SAULUS</u> BAD
+++++++++++++++++++++++++++++++++++++++	┝┿┿┿┿┿┿	┿┿┿┿┿╋┝┶┾┼┾	ANG ENTATES
50 IL WET	Soil is WE	- TOP SOLL- - SANDY LEANT - ARONN FINE - SAND - - CLUCHT LEANT - LUCHT LEANT - LUCHT LEANT	3 ²² Льр. Ноіе 12
┼┼┼┼┟╎╷╎╷╷╷	┽┽┽┽┽┼┼┼┦┦	└╎╵┊_╔╒╷╎╷╎ ╒┼┾	E Franci
0 × , , , , , , , , , , , , , , , , , , ,	OBSTRUCTION STOP	TOP BOIL - SANDY LOAM- <u>SANDY LOAM- CEALSH BROWG</u> SANDY LOAM TH SHL LAAM CEALGH BROWG SANDY LOAM- SANDY LOAM- SANDY LOAM-	BORING LOG
++++++++++++++++++++++++++++++++++++++	FAINT - BEODISH BEODISH SANDY	┍╶┥╌┥╌┥╌┥╴┥╴┥╸┥╸┥╸	
470P	REDDISH BROWN	ToP Soul-	HOLE 14
Monte 20" Soit Soit - S		┝┥┥╴┟╴╎╴┥╴┥╸┥╸┥	BOREHOLE DL HOLE
Soir- Soir- 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4143 4145 4145 4145 4145 4145 4145 4145 4145 4145 4145 4145 4145 4145 4145 4145 4145 4145 4145 4145 4145 4145 4145 4145 4145 4145 4145 4145 4145 4145 4145 414		TOP SOIL	E #5
Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contraction Contr	Morred South	REDDIS	HOLE 15 HOLE 16 HOLE 16
36" BRewn 5/4 4/4		TEP Serie - in NDY Lenn 	AND AUGGE
2 A		· · · · ·	

JOB DADOHUS HONDES LOT9, BULE, MANNY LANG ESTATES, 3RD ADD. LOT9, BULE, MANNY LANG ESTATES, 3RD ADD.

BORING LOG

W-SKI ZE'I" BOREHOLE DIAMETER HAND AUGER

• ð

DATE 8-27 + 30-04

PEPTH

SANDY LOAM TOP HOLE # 7

5012-

TOP SOIL -

HOLE \$ HOLE \$ AND YOUNG TO PARTY

++

HOLE #1/1 HOLE #12 TOP SOLL - TOP SOLL -SANDY LOAM - SANDY LOAM

Brian L. Humpal, Inc. dba. Inspect Minnesota, Midwest Soil Testing

Relative to Subsurface Sewage Treatment System (SSTS) Compliance Inspections

- 1. This inspection/report is being performed for only the seller/owner of the property on which the SSTS is located. In such case that another party is paying for the inspection, the contract is between only said party and Brian L. Humpal, Inc.; there is no contract between Brian L. Humpal, Inc. and any other party unless otherwise noted.
- 3. Brian L. Humpal, Inc. has not been retained to warranty, guarantee, or certify the proper functioning of the SSTS for any period of time beyond the date of inspection or into the future. Because of the numerous factors (usage, maintenance, soil characteristics, previous failures, etc.) which may affect the proper operation of an SSTS, as well as the inability of Brian L. Humpal, Inc. to supervise or monitor the use or maintenance of the SSTS, the report shall not be construed as a warranty by Brian L. Humpal, Inc. that the SSTS will function properly for any particular party for any period of time.
- 4. Brian L. Humpal, Inc. is unable to verify the frequency and/or, quality of prior or future maintenance of the SSTS. Maintenance of the tank(s) must be performed through the tanks maintenance hole. The removal of solids from any location other than the maintenance hole is not a compliant method of maintenance. It is strongly recommended that maintenance covers be made accessible to the ground surface to facilitate proper maintenance.
- 5. Minimum Compliance Inspection requirements relative to this inspection and this report include <u>only</u> verification that the SSTS has tank(s) (septic tanks, lift tanks, dosing tanks, stilling tanks, etc.) which are watertight below the designed operating depth, the required separation between the bottom of the subsurface soil distribution medium and seasonally saturated soils, no back-ups of sewage into the dwelling, no discharge of sewage/effluent to the ground surface or surface waters, and no imminent safety hazards. Brian L. Humpal, Inc. does not inspect plumbing or pumps prior to the first SSTS component as these are plumbing components. The performance of exterior pumps and associated components are not inspected as they are considered to be maintenance items. Additionally, no indications relative to compliance with electrical code requirements have been made. It is recommended that any other applicable plumbing, electrical, housing, etc. inspections be performed by a qualified inspection business. Sewage back-up verification is limited to observing the floor drain area and/or the information supplied by the last occupants of the building prior to inspection. Brian L. Humpal, Inc. cannot guarantee that the information given to them by the last occupants of the building prior to inspection relative to back-ups is accurate.
- 4. Certification of this SSTS does not warranty future use beyond the date of the inspection. Any SSTS, old or new, can become hydraulically overloaded or discharge sewage/effluent to the ground surface as a result of more people moving into the house than were previously occupying the house, improper maintenance, heavy usage, leaking plumbing fixtures, groundwater infiltration, tree roots, freezing conditions, surface drainage problems, poor initial design, poor construction practices, or unsuitable materials used in constructing the system; the system can also simply stop working because of its age. An SSTS that has been properly designed and installed, properly maintained, and used in the manner for which the system was designed can be expected to provide service for twenty to twenty-five years on average. Some parts of the SSTS such as alarms, switches, pumps, filters, etc. will most likely have to be repaired or replaced over the lifetime of the system.
- 5. A Compliance Inspection is not meant to be a test or inspection for longevity of the system; a Compliance Inspection is strictly for the purpose of determining if the SSTS is protective of public health and safety, as well as the groundwater at the date and time the inspection was performed. This inspection is not intended to determine if the SSTS was originally designed or installed to past or present MPCA or other Local Government Unit code requirements. This inspection is not intended to determine if the SSTS was designed and/or installed to support the anticipated flow from the building as the use of the building may have changed since the design and construction of the SSTS due to the addition of bedrooms, occupants, etc. In addition, this inspection is not intended to determine the quality of the original SSTS design, the quality of the construction practices used while installing the SSTS, or the quality of the materials used in constructing the SSTS.
- 6. Brian L. Humpal, Inc. cannot guarantee the performance of SSTS products/components such as: gravelless pipe, chamber trenches, effluent filters, tanks, sewage pre-treatment components, piping, etc. Products such as gravelless pipe are no longer approved for installation in the State of Minnesota and may have a significantly reduced performance and/or life expectancy.
- 7. WINTER WORK: By accepting this report, it is understood that inspections conducted during winter months (approximately November 1st through April 1st) are more difficult to perform because of possible snow cover and/or ground frost. SSTS components such as tanks, maintenance covers, tank inspection pipes, subsurface distribution medium inspection pipes, and soil treatment areas are more difficult or impossible to locate due to snow cover and/or ground frost. In addition, soil borings are more difficult to perform due to snow cover and/or ground frost. Brian L. Humpal, Inc. will attempt to use the same level of standards when performing work during winter periods as when performing work during non-winter periods. However, the recipient of this report understands that because of the aforementioned considerations, the same level of standards may not be possible.
- 8. By accepting this report, the client understands that Brian L. Humpal, Inc. will not be responsible for any monetary damages exceeding the fee for the services provided.

Subsurface Sewage[®]Treatment Systems Non-transferable Business License

Inspect Minnesota, Midwest Soil Testing

License Expires: 12/22/2019

Issued: 11/20/2018

Specialty Area(s):

License # L2896

Installer Maintainer Service Provider Advanced Designer Advanced Inspector

Designated Certified Individual(s):

Cert #	Name	Certification Expires:
C9633	Anthony P Scully	3/5/2020
•	Installer, Designer (Apprentice)	
C5342	Brian L Humpal	10/15/2023
	Installer, Maintainer, Serv Prov, Adv De	esigner, Adv Inspector
C9852	Christopher R Uebe	3/4/2021
	Designer, Inspector	

MINNESOTA POLLUTION CONTROL AGENCY

520 Lafayette Road North St. Paul, Minnesota 55155-4194

Nich Haig

Nick Haig, Supervisor Certification and Training Unit