Midwest Sewer Services

P.O. Box 10853 White Bear Lake, MN 55110

Brian Humpal

651-492-7550/Brian@Midwestsoiltesting.com

MPCA Licensed Advanced Inspector

SUBSURFACE SEWAGE TREATMENT SYSTEM (SSTS) COMPLIANCE REPORT

Date: July 21, 2020 Time: 11:30 AM Owner: Kevin Snow & Julie Snow

Inspection Address: 1240 Oryan Trail N, West Lakeland, MN 55082

REPORT SUMMARY

I have performed an "MPCA Compliance Inspection" on this system, have reviewed the history of the system with the owner, Kevin Snow, and have reviewed the original design/permit records on file at Washington County. This older system (installed in 1998) consists of two precast septic tanks and a gravelless trench drainfield.

Although not a compliance criteria, it should be noted that gravelless pipe is no longer approved for installation in the State of Minnesota and we have had experience with this product having significantly reduced performance and/or life expectancy. We cannot guarantee the performance of this system beyond the compliance date (7/21/2020). In addition, the second septic tank manhole cover is buried. I recommend extending this cover to the ground surface to facilitate easier access and proper maintenance. It should also be noted that the septic tanks are currently due for maintenance pumping and should be pumped as soon as possible.

Predicated on my inspection of the system, my review of the history of the system with the owner, and my review of the original design/permit records, it is my opinion that this system presently meets MPCA minimum compliance inspection requirements.

Midwest Sewer Services have been hired to perform a compliance inspection of this SSTS for compliance with local ordinances pursuant to Minn. Stat. § 115.55 (2013). This compliance inspection covers only the criteria required by Minn. Stat. § 115.55 Subd. 5a (2013) and Minn. R. 7080.1500 (2011). A compliance inspection is an indication of the current compliance status of the system and does not guarantee the performance or longevity of this system beyond the date of inspection, as it is impossible to determine the future performance of any system. Midwest Sewer Services disclaim any use of this compliance inspection beyond determining SSTS compliance pursuant to Minn. Stat. § 115.55 Subd. 5a (2013) and Minn. R. 7080.1500 (2011).

Please contact me should you have any questions.

Christopher Uebe

Brian Humpal

Brian Humpal



Compliance Inspection Form

Existing Subsurface Sewage Treatment Systems (SSTS)

Doc Type: Compliance and Enforcement

Instructions: Inspection results based on Minnesota Pollution Conrequirements and attached forms – additional local requirements may	
Submit completed form to Local Unit of Government (LUG) ar within 15 days	nd system owner
System Status	
System status on date (mm/dd/yyyy):7/21/2020	
○ Compliant – Certificate of Compliance (Valid for 3 years from report date, unless shorter time frame outlined in Local Ordinance.)	
Reason(s) for noncompliance (check all applicable	e)
☐ Impact on Public Health (Compliance Component #1) – Imminent threat to public health and safety
☐ Other Compliance Conditions (Compliance Compone	nt #3) – Imminent threat to public health and safety
☐ Tank Integrity (Compliance Component #2) – Failing	
Other Compliance Conditions (Compliance Compone	
Soil Separation (Compliance Component #4) – Failin	
☐ Operating permit/monitoring plan requirements (Comp	pliance Component #5) – Noncompliant
Property Information Parcel Property address: 1240 Oryan Trail N, West Lakeland, MN 5508 Property owner: Kevin Snow & Julie Snow	ID# or Sec/Twp/Range: Reason for inspection: Property Transfer Owner's phone: 651-491-0103
or	
Owner's representative:	Representative phone:
Local regulatory authority: Washington County	Regulatory authority phone: 651-430-6655
Brief system description: Two pre-cast septic tanks and a grave	elless trench drainfield.
Comments or recommendations:	
Although not a compliance criteria, it should be noted that gravelle Minnesota and we have had experience with this product having s cannot guarantee the performance of this system beyond the com manhole cover is buried. I recommend extending this cover to the maintenance. It should also be noted that the septic tanks are cur soon as possible.	significantly reduced performance and/or life expectancy. We apliance date (7/21/2020). In addition, the second septic tank a ground surface to facilitate easier access and proper
Certification	
I hereby certify that all the necessary information has been gather determination of future system performance has been nor can be possible abuse of the system, inadequate maintenance, or future	made due to unknown conditions during system construction,
Inspector name: Brian Humpal/Christopher Uebe	Certification number: C5342/C9852
Business name: Midwest Sewer Services	License number: _L2896
Inspector signature: Brian Thumpal for the	Phone number: 651-492-7550
Necessary or Locally Required Attachments	
Soil boring logs	☐ Forms per local ordinance

www.pca.state.mn.us • 651-296-6300 • 800-657-3864 • TTY 651-282-5332 or 800-657-3864 • Available in alternative formats wq-wwists4-31 • 1/24/12

	☑ Other information (list): Report Summary, Property Information, Disclaimer, License				
Pro	perty	y address: <u>1240 Oryan Trail N, Wes</u> t	Lakeland, MN 55082	Inspector initials/Date: 7/21/2020 BACM	
1.	In	npact on Public Health – Co	mpliance componer	nt #1 of 5	
••		ompliance criteria:	приспос сотгронет	Verification method(s):	
	Sy	ystem discharge sewage to the ound surface.	☐ Yes ⊠ No	☑ Searched for surface outlet☑ Searched for seeping in yard/backup in home	
		ystem discharge sewage to drain tile surface waters.	☐ Yes ⊠ No	 Excessive ponding in soil system/D-boxes Homeowner testimony (See Comments/Explanation) "Black soil" above soil dispersal system 	
		ystem cause sewage backup into velling or establishment.	☐ Yes ⊠ No	 "Black soil" above soil dispersal system System requires "emergency" pumping Performed dye test 	
	Any "yes" answer above indicates the system is an Imminent Threat to Public Health and Safety.			☐ Unable to verify (See Comments/Explanation) ☐ Other methods not listed (See Comments/Explanation)	
•	No	omments/Explanation: one of the above found.			
<u>2.</u>		ank Integrity – Compliance cor	nponent #2 of 5		
	С	ompliance criteria:		Verification method(s):	
		ystem consists of a seepage pit, esspool, drywell, or leaching pit.	☐ Yes ⊠ No	☑ Probed tank(s) bottom☑ Examined construction records	
		eepage pits meeting 7080.2550 may be impliant if allowed in local ordinance.		☐ Examined Tank Integrity Form (Attach)	
		ewage tank(s) leak below their	☐ Yes ⊠ No	Observed liquid level below operating depthExamined empty (pumped) tanks(s)	
	de	esigned operating depth. yes, which sewage tank(s) leaks:		Probed outside tank(s) for "black soil"	
			otos the	☐ Unable to verify (See Comments/Explanation)	
	Any "yes" answer above indicates the system is Failing to Protect Groundwater.				
		omments/Explanation:			
	M ca m m	innesota and we have had experience annot guarantee the performance of the anhole cover is buried. I recommend	with this product having system beyond the extending this cover to	velless pipe is no longer approved for installation in the State of ing significantly reduced performance and/or life expectancy. We compliance date (7/21/2020). In addition, the second septic tank to the ground surface to facilitate easier access and proper e currently due for maintenance pumping and should be pumped	
3.	0	ther Compliance Conditions	5 – Compliance con	nponent #3 of 5	
	a.	Maintenance hole covers are damage	d, cracked, unsecured	, or appear to structurally unsound. ☐ Yes* ☒ No ☐ Unknown	
	b.	Other issues (electrical hazards, etc.) to *System is an imminent threat to po		sely impact public health or safety. ☐ Yes* ☒ No ☐ Unknown	
		Explain:			
	C.	System is non-protective of ground was *System is failing to protect ground		s as determined by inspector ☐ Yes* ☒ No	

www.pca.state.mn.us • 651-296-6300 • 800-657-3864 • TTY 651-282-5332 or 800-657-3864 • Available in alternative formats wq-wwists4-31 • 1/24/12


Explain:

Pro	perty address:1240 Oryan Trail N, West Lake	and, MN 5	5082	Inspector initials/Date:	7/21/2020 BA (U
4.	Soil Separation – Compliance compor	nent #4 of	5		
	Date of installation: 1998 Shoreland/Wellhead protection/Food Beverage	☐ Unkno		Verification method(s): Soil observation does not expire.	Previous soil
	Lodging? Compliance criteria:		observations by two independent parties are sufficient, unless site conditions have been altered or local requirements differ. □ Conducted soil observation(s) (Attach boring logs) □ Two previous verifications (Attach boring logs) □ Not applicable (Holding tank(s), no drainfield) □ Unable to verify (See Comments/Explanation) □ Other (See Comments/Explanation)		
	For systems built prior to April 1, 1996, and not located in Shoreland or Wellhead Protection Area or not serving a food, beverage or lodging establishment: Drainfield has at least a two-foot vertical separation distance from periodically saturated soil or bedrock.	☐ Yes ☐ No			
	Non-performance systems built April 1, 1996, or later or for non-performance systems located in Shoreland or Wellhead Protection Areas or serving a food, beverage, or lodging establishment:	⊠ Yes	□ No	Comments/Explanation: Reviewed design and permit reco	ords.
	Drainfield has a three-foot vertical separation distance from periodically saturated soil or bedrock.*				
	"Experimental", "Other", or "Performance" systems built under pre-2008 Rules; Type IV or V systems built under 2008 Rules (7080. 2350 or 7080.2400 (Advanced Inspector License required)	☐ Yes	□ No	A. Bottom of distribution media B. Periodically saturated soil/bedrocl	See Attached Boring Log(s)
	Drainfield meets the designed vertical separation distance from periodically saturated soil or bedrock.			C. System separation	
	Any "no" answer above indicates to Failing to Protect Groundwater.	he syste	m is	D. Required compliance separation**May be reduced up to 15 percer Ordinance.	
5.	Operating Permit and Nitrogen B	MP* – Co	ompliance c	omponent #5 of 5 🛮 🖂 Not a p	oplicable
	Is the system operated under an Operating Per Is the system required to employ a Nitrogen BM BMP=Best Management Practice(s) specific of the answer to both questions is "no", Compliance criteria	IP? ied in the s	☐ Yes ☐ ystem desigr		
	Operating Permit number: Have the Operating Permit requirements I	peen met?		☐ Yes ☐ No	
	b. Is the required nitrogen BMP in place and	properly fu	ınctioning?	☐ Yes ☐ No	
	Any "no" answer indicates Noncom	pliance.			

www.pca.state.mn.us • 651-296-6300 • 800-657-3864 TTY 651-282-5332 or 800-657-3864 • Available in alternative formats Page 3 of 4

Midwest Sewer Testing Subsurface Sewage Treatment System Owner/Property Information This information will be used for the purpose of conducting an MPCA Compliance Inspection.

This information will be used for the purpose of conducting all MFCF	A Comphance inspection.			
Date of Inspection: July 21, 2020	Time: 11:30 AM			
Property Address: 1240 Oryan Trail N, West Lakeland, MN	Zip: 55082			
Property Owner: Kevin Snow & Julie Snow	Phone: 651-491-0103			
Tank(s) Tank(s)Material Soil Treatment System Septic 2 Fiberglass Rock trench Aerobic Plastic Gravelless trench Lift Metal Chamber trench Holding Concrete Seepage bed Other: Block Mound Other At-grade	Other Alternative system Experimental system Cesspool system Other system			
Are the tank maintenance covers accessible? \square Yes \square No *If				
performed through the maintenance holes. Maintenance hole cov				
the ground surface to facilitate access and proper maintenance of	the system.			
Year house built: 1998 Year septic installed: 1998	Tank size (gals.): 2-1000			
	esidents in home? 2-4			
Number of bedrooms? 4 Are all floors drained by s	gravity? Y			
Garbage disposal? Y Whirlpool bath				
More than one system (laundry, etc.)? N				
Does this property have any footing drain tiles connected to the s	eptic system? N			
Are any buildings on this property such as garages or out-buildings connected to this system? N				
Are there any additional systems on this property serving other be	uildings? N			
Location of septic system on lot? West Side				
Location of water well on lot? East Side Is the	e well a deep well? Y			
Have you ever experienced any problems with the system such as: tree roots, sewage back-ups, surfacing of sewage onto the ground, septic tank overflowing, etc.; or have any repairs been made to the system? N If yes, explain:				
When was the system last pumped? 2016 Name of pur	nper:			
How often pumped in previous years? Every 3-4	n on a monitoring plan? N			
Have you received notices from any government agency concern	ing this system? N			
Is your property located in a shoreland management area? N				
Do you have any additional information that should be given to the	ne new owner? N			
I hereby certify that the above information is correct to the best of my knowledg considered "non-compliant/failing" per MPCA rules, that the inspector must by local government unit within 15 days of the date of inspection completion. I a this report, that I/we are ultimately responsible for payment of all fees for all w by Inspect Minnesota and Midwest Soil Testing	law submit a copy of this report to the lso agree that unless otherwise noted in			
Owner/Occupant:	Date:			

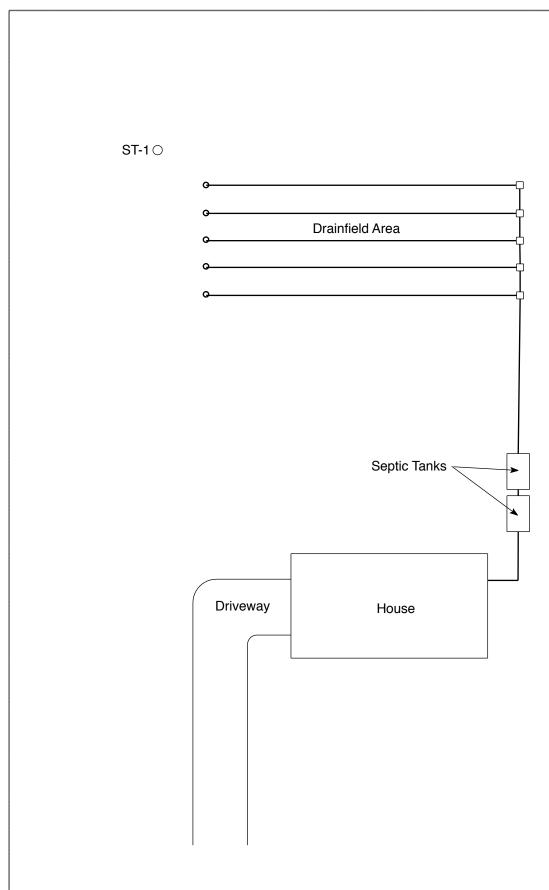

N → NO SCALE

1240 Oryan Trail N, West Lakeland, MN 55082

Soil Observations Log

Location of Project: 1240 Oryan Trail N, West Lakeland, MN 55082							
Observations Made By: Midwest Sewer Ser					Date:	7/21/2020	
Classification System: USDA							
	Soil	Observation:	ST-1	Soil Observation:			
Eleva	Surface Elevation of Observation Same ground surface as last drainfield trench		Elevat	face tion of vation			
Depth In Inches	Rock %	Soils E	ncountered	Depth In Inches	Rock %	Soils	Encountered
0-7 7-27 27-67		10YR 4/	2/2 Silt Loam 3 Sandy Loam 4 Medium Sand				
67"	Depth T	o End Of Soil O	bservation Or Redox		Depth T	o End Of Soil	Observation Or Redox
Same Elevation Of Observation Relative To System				tion Relative To System			
-31" Depth To Bottom Of Distribution Media					Distribution Media		
≥36" Of Separation			Of Sepa	ration			
Fnd	Of Soil (Observation At:	67"	End Of	Soil Oh	servation At:	
Lina		dox Present At:	None	2 51		x Present At:	
Star		ater Present At:	None	Standi		r Present At:	

Bottom Of Distribution Medium At: 31 Inches		
Signature:	Offer 1h	

16124389910;# 1/ 4

Standing water table: Present at _____ feet of depth, hours efter boring. Mottled soil: Observed at _____ feet of depth. Not present in boring hole Observations and comments:

End of boring at ______ feet. Standing water table: Present at _____ feet of depth, hours after boring. Not present in boring hole ____ Mottled soil: Observed at _____ feet of depth. Not present in boring hole __

Observations and comments:

DISCLAIMER

Brian L. Humpal, Inc. dba. Midwest Sewer Services, Inspect Minnesota, Midwest Soil Testing Relative to Subsurface Sewage Treatment System (SSTS) Compliance Inspections

- 1. This inspection/report is being performed for only the seller/owner of the property on which the SSTS is located. In such case that another party is paying for the inspection, the contract is between only said party and Brian L. Humpal, Inc.; there is no contract between Brian L. Humpal, Inc. and any other party unless otherwise noted.
- 3. Brian L. Humpal, Inc. has not been retained to warranty, guarantee, or certify the proper functioning of the SSTS for any period of time beyond the date of inspection or into the future. Because of the numerous factors (usage, maintenance, soil characteristics, previous failures, etc.) which may affect the proper operation of an SSTS, as well as the inability of Brian L. Humpal, Inc. to supervise or monitor the use or maintenance of the SSTS, the report shall not be construed as a warranty by Brian L. Humpal, Inc. that the SSTS will function properly for any particular party for any period of time.
- 4. Brian L. Humpal, Inc. is unable to verify the frequency and/or, quality of prior or future maintenance of the SSTS. Maintenance of the tank(s) must be performed through the tanks maintenance hole. The removal of solids from any location other than the maintenance hole is not a compliant method of maintenance. It is strongly recommended that maintenance covers be made accessible to the ground surface to facilitate proper maintenance.
- 5. Minimum Compliance Inspection requirements relative to this inspection and this report include <u>only</u> verification that the SSTS has tank(s) (septic tanks, lift tanks, dosing tanks, stilling tanks, etc.) which are watertight below the designed operating depth, the required separation between the bottom of the subsurface soil distribution medium and seasonally saturated soils, no back-ups of sewage into the dwelling, no discharge of sewage/effluent to the ground surface or surface waters, and no imminent safety hazards. Brian L. Humpal, Inc. does not inspect plumbing or pumps prior to the first SSTS component as these are plumbing components. The performance of exterior pumps and associated components are not inspected as they are considered to be maintenance items. Additionally, no indications relative to compliance with electrical code requirements have been made. It is recommended that any other applicable plumbing, electrical, housing, etc. inspections be performed by a qualified inspection business. Sewage back-up verification is limited to observing the floor drain area and/or the information supplied by the last occupants of the building prior to inspection. Brian L. Humpal, Inc. cannot guarantee that the information given to them by the last occupants of the building prior to inspection relative to back-ups is accurate.
- 4. Certification of this SSTS does not warranty future use beyond the date of the inspection. Any SSTS, old or new, can become hydraulically overloaded or discharge sewage/effluent to the ground surface as a result of more people moving into the house than were previously occupying the house, improper maintenance, heavy usage, leaking plumbing fixtures, groundwater infiltration, tree roots, freezing conditions, surface drainage problems, poor initial design, poor construction practices, or unsuitable materials used in constructing the system; the system can also simply stop working because of its age. An SSTS that has been properly designed and installed, properly maintained, and used in the manner for which the system was designed can be expected to provide service for twenty to twenty-five years on average. Some parts of the SSTS such as alarms, switches, pumps, filters, etc. will most likely have to be repaired or replaced over the lifetime of the system.
- 5. A Compliance Inspection is not meant to be a test or inspection for longevity of the system; a Compliance Inspection is strictly for the purpose of determining if the SSTS is protective of public health and safety, as well as the groundwater at the date and time the inspection was performed. This inspection is not intended to determine if the SSTS was originally designed or installed to past or present MPCA or other Local Government Unit code requirements. This inspection is not intended to determine if the SSTS was designed and/or installed to support the anticipated flow from the building as the use of the building may have changed since the design and construction of the SSTS due to the addition of bedrooms, occupants, etc. In addition, this inspection is not intended to determine the quality of the original SSTS design, the quality of the construction practices used while installing the SSTS, or the quality of the materials used in constructing the SSTS.
- 6. Brian L. Humpal, Inc. cannot guarantee the performance of SSTS products/components such as: gravelless pipe, chamber trenches, effluent filters, tanks, sewage pre-treatment components, piping, etc. Products such as gravelless pipe are no longer approved for installation in the State of Minnesota and may have a significantly reduced performance and/or life expectancy.
- 7. WINTER WORK: By accepting this report, it is understood that inspections conducted during winter months (approximately November 1st through April 1st) are more difficult to perform because of possible snow cover and/or ground frost. SSTS components such as tanks, maintenance covers, tank inspection pipes, subsurface distribution medium inspection pipes, and soil treatment areas are more difficult or impossible to locate due to snow cover and/or ground frost. In addition, soil borings are more difficult to perform due to snow cover and/or ground frost. Brian L. Humpal, Inc. will attempt to use the same level of standards when performing work during winter periods as when performing work during non-winter periods. However, the recipient of this report understands that because of the aforementioned considerations, the same level of standards may not be possible.
- 8. By accepting this report, the client understands that Brian L. Humpal, Inc. will not be responsible for any monetary damages exceeding the fee for the services provided.

Subsurface Sewage Treatment Systems

Non-transferable

Business License

Midwest Sewer Services

License # L2896

License Expires: 12/22/2020

Issued: 11/26/2019

Specialty Area(s):

Installer
Maintainer
Service Provider
Advanced Designer
Advanced Inspector

Designated Certified Individual(s):

Cert # Na

Name

Certification Expires:

C5342

Brian L Humpal

10/15/2023

Installer, Maintainer, Serv Prov, Adv Designer, Adv Inspector

C9852 4

Christopher R Uebe

3/4/2021

Designer, Inspector



520 Lafayette Road North St. Paul, Minnesota 55155-4194 Mich Haig

Nick Haig, Supervisor Certification and Training Unit