## **Midwest Sewer Services**

P.O. Box 10853 White I	Bear Lake, MN 55110	Brian Humpal		
651-492-7550/Brian@M	idwestsoiltesting.com	MPCA Licensed Advanced Inspector		
SUBSURFACE SEWAGE TREATMENT SYSTEM (SSTS) COMPLIANCE REPORT				
Date: June 9, 2021	<b>Time:</b> 1:45 PM	Owner: Kyle & Liz Taylor		
Inspection Address: 4787 Northbrook Blvd N, Baytown Twp, MN 55082				

## **REPORT SUMMARY**

I have performed an "MPCA Compliance Inspection" on this system and have reviewed the original design/permit records which were on file at Washington County. This very old system (installed in 1979) consists of a pre-cast septic tank and a rock trench drainfield. It should be noted that the average life expectancy of a septic system is approximately 30 years. Meyer Sewer Service pumped the septic tank on June 9, 2021.

My inspection indicates that this system is presently "non-compliant" in accordance with MPCA rules 7080.1500 Subp.4(B)(E) because of the lack of the required two foot separation between the bottom of the drainfield and seasonally saturated soils.

In accordance with MPCA rules, I am sending a copy of this complete report to Washington County. I cannot officially speak on behalf of the County relative to the upgrade requirements of these non-compliant systems. Please contact the Washington County Department of Public Health & Environment (651-430-6655) to verify the County's position.

Please advise buyer, agents, lender, etc. to contact me should they have any questions regarding this system.

Christopher Uebe

Brian Humpal

Brian Humpal



520 Lafayette Road North St. Paul, MN 55155-4194

## Compliance inspection report form

Existing Subsurface Sewage Treatment System (SSTS)

Doc Type: Compliance and Enforcement

Instructions: Inspector must submit completed form to Local Governmental Unit (LGU) and system owner within 15 days of final determination of compliance or noncompliance. Instructions for filling out this form are located on the Minnesota Pollution Control Agency (MPCA) website at https://www.pca.state.mn.us/sites/default/files/wg-wwists4-31a.pdf.

2 of 10

Property information	Local tracking number:		
Parcel ID# or Sec/Twp/Range:	Reason for Inspection	Property Transfer	
Local regulatory authority info: Washington County			
Property address: 4787 Northbrook Blvd N, Baytown Twp, MN 55	5082		
Owner/representative: Kyle & Liz Taylor		Owner's phone: <u>612-723-8163</u>	
Brief system description: A pre-cast septic tank and a rock trench	drainfield.		

#### System status

System status on date (mm/dd/yyyy): 6/9/2021

Compliant – Certificate of compliance\*

(Valid for 3 years from report date unless evidence of an imminent threat to public health or safety requiring removal and abatement under section 145A.04. subdivision 8 is discovered or a shorter time frame exists in Local Ordinance.)

\*Note: Compliance indicates conformance with Minn. R. 7080.1500 as of system status date above and does not quarantee future performance.

#### Noncompliant – Notice of noncompliance

Systems failing to protect ground water must be upgraded, replaced, or use discontinued within the time required by local ordinance.

An imminent threat to public health and safety (ITPHS) must be upgraded, replaced, or its use discontinued within ten months of receipt of this notice or within a shorter period if required by local ordinance or under section 145A.04 subdivision 8.

#### Reason(s) for noncompliance (check all applicable)

□ Impact on public health (Compliance component #1) – Imminent threat to public health and safety

Tank integrity (Compliance component #2) – Failing to protect groundwater

Other Compliance Conditions (Compliance component #3) – Imminent threat to public health and safety

Other Compliance Conditions (Compliance component #3) – Failing to protect groundwater

System not abandoned according to Minn. R. 7080.2500 (Compliance component #3) - Failing to protect groundwater

Soil separation (Compliance component #5) – Failing to protect groundwater

Other information (list): Report Summary, Property Information, Disclaimer, License

Operating permit/monitoring plan requirements (Compliance component #4) – Noncompliant - local ordinance applies

#### Comments or recommendations

#### Certification

I hereby certify that all the necessary information has been gathered to determine the compliance status of this system. No determination of future system performance has been nor can be made due to unknown conditions during system construction, possible abuse of the system, inadequate maintenance, or future water usage.

By typing my name below, I certify the above statements to be true and correct, to the best of my knowledge, and that this information can be used for the purpose of processing this form.

Business name: Midwest Sewer Services Certification number: 5342/9852 Brian Humpal Hoter Inspector signature: License number: L2896 (This document has been electronically signed) Phone: 651-492-7550 Necessary or locally required supporting documentation (must be attached) Soil observation logs System/As-Built Locally required forms Tank Integrity Assessment Operating Permit

#### https://www.pca.state.mn.us 651-296-6300 800-657-3864 Available in alternative formats Use your preferred relay service wq-wwists4-31b • 4/28/2021

System discharges sewage to the

🗌 Yes\* 🛛 No System discharges sewage to drain tile or surface waters. System causes sewage backup into 🗌 Yes\* 🛛 No

Property Address: 4787 Northbrook Blvd N, Baytown Twp, MN 55082

Any "yes" answer above indicates the system is an imminent threat to public health and safety.

Describe verification methods and results:

None of the above found.

dwelling or establishment.

Business Name: Midwest Sewer Services

Compliance criteria:

ground surface

## 2. Tank integrity – Compliance component #2 of 5

Compliance criteria:		Attached supporting documentation:		
System consists of a seepage pit, cesspool, drywell, leaching pit, or other pit?	🗌 Yes* 🛛 No	Empty tank(s) viewed by inspector	Meyer Sewer	
	□ Yes* ⊠ No	Name of maintenance business:	Service	
Sewage tank(s) leak below their designed operating depth?		License number of maintenance business:	L915	
designed operating depth?		Date of maintenance:	6/9/2021	
		Existing tank integrity assessment (Attach)	)	
If yes, which sewage tank(s) leaks:		Date of maintenance (mm/dd/yyyy): (must be within t	hree years)	
Any "yes" answer above indicates the system is failing to protect groundwater.		(See form instructions to ensure assessme Minn. R. 7082.0700 subp. 4 B (1))	ent complies with	
		Tank is Noncompliant (pumping not necessary – explain below		
		☐ Other:		
Describe verification methods and	results:			

٠

https://www.pca.state.mn.us 651-296-6300 800-657-3864 ٠ ٠ wq-wwists4-31b • 4/28/2021

٠

Use your preferred relay service

Date: 6/9/2021

1. Impact on public health – Compliance component #1 of 5 Attached supporting documentation: 🗌 Yes\* 🛛 No Other: Not applicable

4 of 10

Property Address:	4787 Northbrook Blvd N, Baytown Twp, MN 55082
Business Name:	Midwest Sewer Services

Date: 6/9/2021

## 3. Other compliance conditions – Compliance component #3 of 5

3a	Maintenance hole covers appear to be structurally unsound (damaged, cracked, etc.), or unsound	secured?
	□ Yes*	
3b	Other issues (electrical hazards, etc.) to immediately and adversely impact public health or safe	ety? 🗌 Yes* 🛛 No 🗌 Unknown
	*Yes to 3a or 3b - System is an imminent threat to public health and safety.	
30	System is non-protective of ground water for other conditions as determined by inspector?	🗌 Yes* 🛛 No
3d	System not abandoned in accordance with Minn. R. 7080.2500?	🗌 Yes* 🛛 No
	*Yes to 3c or 3d - System is failing to protect groundwater.	
	Describe verification methods and results:	
	Attached supporting documentation: 🛛 Not applicable 🗌	
4. Op	erating permit and nitrogen BMP* – Compliance component #4	of 5 🛛 Not applicable
ls t	ne system operated under an Operating Permit?	If "yes", A below is required
ls t	ne system required to employ a Nitrogen BMP specified in the system design?  Yes No	If "yes", B below is required
ls t	BMP = Best Management Practice(s) specified in the system design? ☐ Yes ☐ No	If "yes", B below is required

#### Compliance criteria:

a. Have the operating permit requirements been met?

b. Is the required nitrogen BMP in place and properly functioning?

#### Any "no" answer indicates noncompliance.

Describe verification methods and results:

Attached supporting documentation: 
Operating permit (Attach)

5 of 10

Property Address:	4787 Northbrook	Blvd N, Ba	ytown Twp, MN 5	55082
-------------------	-----------------	------------	-----------------	-------

Business Name: Midwest Sewer Services

Date: 6/9/2021

#### 5. Soil separation – Compliance component #5 of 5

Date of installation 1979 (mm/dd/yyyy)	_ 🗌 Unkr	nown		
Shoreland/Wellhead protection/Food beverage lodging? Compliance criteria (select one): 5a. For systems built prior to April 1, 1996, and not located in Shoreland or Wellhead Protection Area or not serving a food, beverage or lodging establishment: Drainfield has at least a two-foot vertical separation distance from periodically saturated soil or bedrock.	☐ Yes	⊠ No ⊠ No*	Attached supporting documentation:	vertical separation
5b.Non-performance systems built April 1, 1996, or later or for non-	☐ Yes	🗌 No*	A. Bottom of distribution media	See Attached
performance systems located in Shoreland or Wellhead Protection Areas or serving a				Boring Log(s)
food, beverage, or lodging establishment:			B. Periodically saturated soil/bedrock	
Drainfield has a three-foot vertical separation distance from periodically			C. System separation	
saturated soil or bedrock.*			D. Required compliance separation*	
			*May be reduced up to 15 percent if allo Ordinance.	wed by Local
<ul> <li>5c. "Experimental", "Other", or "Performance" systems built under pre-2008 Rules; Type IV or V systems built under 2008 Rules 7080. 2350 or 7080.2400 (Intermediate Inspector License required ≤ 2,500 gallons per day; Advanced Inspector License required &gt; 2,500 gallons per day)</li> <li>Drainfield meets the designed vertical separation distance from periodically saturated soil or bedrock.</li> </ul>	☐ Yes	□ No*		

\*Any "no" answer above indicates the system is failing to protect groundwater.

Describe verification methods and results:

**Upgrade requirements:** (Minn. Stat. § 115.55) An imminent threat to public health and safety (ITPHS) must be upgraded, replaced, or its use discontinued within ten months of receipt of this notice or within a shorter period if required by local ordinance. If the system is failing to protect ground water, the system must be upgraded, replaced, or its use discontinued within the time required by local ordinance. If an existing system is not failing as defined in law, and has at least two feet of design soil separation, then the system need not be upgraded, replaced, or its use discontinued, notwithstanding any local ordinance that is more strict. This provision does not apply to systems in shoreland areas, Wellhead Protection Areas, or those used in connection with food, beverage, and lodging establishments as defined in law.

## <u>Midwest Sewer Testing</u>


#### Subsurface Sewage Treatment System Owner/Property Information

This information will be used for the purpose of conducting an MPCA Compliance Inspection.

Date of Inspection: June 9, 2021	Time: 1:45 PM			
,,,,,,,				
Property Address: 4787 Northbrook Blvd N, Baytown Twp, N	· · · · · · · · · · · · · · · · · · ·			
Property Owner: Kyle & Liz Taylor	Phone: 612-723-8163			
Tank(s)         Tank(s)Material         Soil Treatment System				
Septic 1 Fiberglass Rock trench	Alternative system			
Aerobic     Plastic     Gravelless trench       Lift     Metal     Chamber trench	Experimental system Cesspool system			
$\square Holding \qquad \square Concrete \qquad \square Seepage bed$	Other system			
Other: Block Mound				
Other At-grade				
Are the tank maintenance covers accessible? $\square$ Yes $\square$ No *	If no, proper maintenance must be			
performed through the maintenance holes. Maintenance hole co	overs should be made accessible to			
the ground surface to facilitate access and proper maintenance of	of the system.			
Year house built: 1979 Year septic installed: 1979	Tank size (gals ): 1200			
	residents in home?			
Number of bedrooms? 4 Are all floors drained by				
Garbage disposal? Whirlpool bat	<u> </u>			
More than one system (laundry, etc.)?				
Does this property have any footing drain tiles connected to the	septic system?			
	1 5			
Are any buildings on this property such as garages or out-buildings connected to this system?				
Are there any additional systems on this property serving other	buildings?			
Location of septic system on lot? East Side				
	the well a deep well? Y			
Have you ever experienced any problems with the system such	as: tree roots, sewage back-ups,			
surfacing of sewage onto the ground, septic tank overflowing, e				
to the system? If yes, explain:				
	umper: Meyer Sewer Service			
How often pumped in previous years? Is syst	em on a monitoring plan?			
Have you received notices from any government agency concerning this system?				
Is your property located in a shoreland management area? N				
Do you have any additional information that should be given to	the new owner?			

I hereby certify that the above information is correct to the best of my knowledge. I also understand that if the system is considered "non-compliant/failing" per MPCA rules, that the inspector must by law submit a copy of this report to the local government unit within 15 days of the date of inspection completion. I also agree that unless otherwise noted in this report, that I/we are ultimately responsible for payment of all fees for all work performed relative to this inspection by Inspect Minnesota and Midwest Soil Testing

Owner/Occupant:

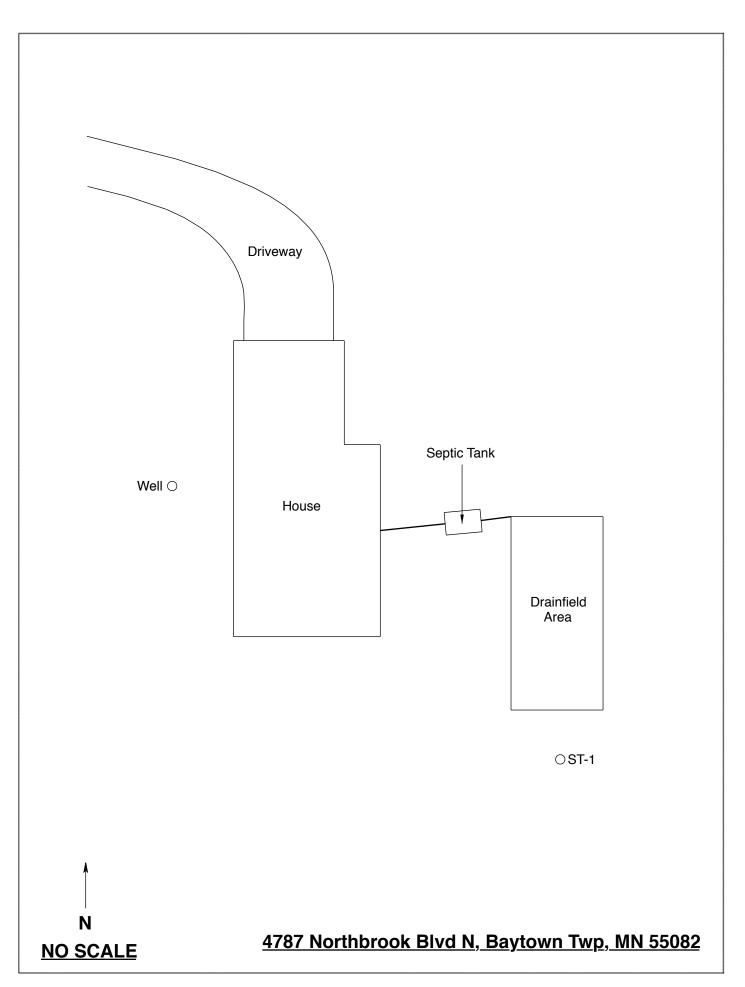

## Soil Observations Log

Location of Project: 4787 Northbrook Blvd N, Baytown Twp, MN 55082							
	servati	ons Made By:	Midwest Sewer Ser			Date:	6/9/2021
Cl	assifica	ation System:	USDA				
	Soil	Observation:	ST-1		Soil C	bservation:	
Surfa Elevati Observ	on of	-	nd surface as last field trench	Surface Elevation of Observation			
Depth In Inches	Rock %	<u>Soils E</u>	ncountered	Depth In Inches	Rock %	<u>Soils</u>	<u>Encountered</u>
0-3 3-8 8-23 23-40		10YR 3/ 7.5YF 7.5YR 4/4	2 Sandy Loam 4 Sandy Loam R 4/4 Loam Silt Loam With A 10YR 7/2 Redox				
23" [	23" Depth To End Of Soil Observation Or Redox			Depth T	o End Of Soil	Observation Or Redox	
Same E				Elevatio	n Of Observat	ion Relative To System	
-22" Depth To Bottom Of Distribution Media			Depth T	o Bottom Of	Distribution Media		
					Of Sepa		
End C		Observation At:	40"	End Of		servation At:	
		lox Present At:	23"			x Present At:	
Standing Water Present At: None		Standi	ng Wate	r Present At:			

Bottom Of Distribution Medium At: 22 Inches

Signature:

Afren Va

## **DISCLAIMER**

#### Brian L. Humpal, Inc. dba. Midwest Sewer Services, Inspect Minnesota, Midwest Soil Testing Relative to Subsurface Sewage Treatment System (SSTS) Compliance Inspections

- 1. This inspection/report is being performed for only the seller/owner of the property on which the SSTS is located. In such case that another party is paying for the inspection, the contract is between only said party and Brian L. Humpal, Inc.; there is no contract between Brian L. Humpal, Inc. and any other party unless otherwise noted.
- 3. Brian L. Humpal, Inc. has not been retained to warranty, guarantee, or certify the proper functioning of the SSTS for any period of time beyond the date of inspection or into the future. Because of the numerous factors (usage, maintenance, soil characteristics, previous failures, etc.) which may affect the proper operation of an SSTS, as well as the inability of Brian L. Humpal, Inc. to supervise or monitor the use or maintenance of the SSTS, the report shall not be construed as a warranty by Brian L. Humpal, Inc. that the SSTS will function properly for any particular party for any period of time.
- 4. Brian L. Humpal, Inc. is unable to verify the frequency and/or, quality of prior or future maintenance of the SSTS. Maintenance of the tank(s) must be performed through the tanks maintenance hole. The removal of solids from any location other than the maintenance hole is not a compliant method of maintenance. It is strongly recommended that maintenance covers be made accessible to the ground surface to facilitate proper maintenance.
- 5. Minimum Compliance Inspection requirements relative to this inspection and this report include <u>only</u> verification that the SSTS has tank(s) (septic tanks, lift tanks, dosing tanks, stilling tanks, etc.) which are watertight below the designed operating depth, the required separation between the bottom of the subsurface soil distribution medium and seasonally saturated soils, no back-ups of sewage into the dwelling, no discharge of sewage/effluent to the ground surface or surface waters, and no imminent safety hazards. Brian L. Humpal, Inc. does not inspect plumbing or pumps prior to the first SSTS component as these are plumbing components. The performance of exterior pumps and associated components are not inspected as they are considered to be maintenance items. Additionally, no indications relative to compliance with electrical code requirements have been made. It is recommended that any other applicable plumbing, electrical, housing, etc. inspections be performed by a qualified inspection business. Sewage back-up verification is limited to observing the floor drain area and/or the information supplied by the last occupants of the building prior to inspection. Brian L. Humpal, Inc. cannot guarantee that the information given to them by the last occupants of the building prior to inspection relative to back-ups is accurate.
- 4. Certification of this SSTS does not warranty future use beyond the date of the inspection. Any SSTS, old or new, can become hydraulically overloaded or discharge sewage/effluent to the ground surface as a result of more people moving into the house than were previously occupying the house, improper maintenance, heavy usage, leaking plumbing fixtures, groundwater infiltration, tree roots, freezing conditions, surface drainage problems, poor initial design, poor construction practices, or unsuitable materials used in constructing the system; the system can also simply stop working because of its age. An SSTS that has been properly designed and installed, properly maintained, and used in the manner for which the system was designed can be expected to provide service for twenty to twenty-five years on average. Some parts of the SSTS such as alarms, switches, pumps, filters, etc. will most likely have to be repaired or replaced over the lifetime of the system.
- 5. A Compliance Inspection is not meant to be a test or inspection for longevity of the system; a Compliance Inspection is strictly for the purpose of determining if the SSTS is protective of public health and safety, as well as the groundwater at the date and time the inspection was performed. This inspection is not intended to determine if the SSTS was originally designed or installed to past or present MPCA or other Local Government Unit code requirements. This inspection is not intended to determine if the SSTS was designed and/or installed to support the anticipated flow from the building as the use of the building may have changed since the design and construction of the SSTS due to the addition of bedrooms, occupants, etc. In addition, this inspection is not intended to determine the quality of the original SSTS design, the quality of the construction practices used while installing the SSTS, or the quality of the materials used in constructing the SSTS.
- 6. Brian L. Humpal, Inc. cannot guarantee the performance of SSTS products/components such as: gravelless pipe, chamber trenches, effluent filters, tanks, sewage pre-treatment components, piping, etc. Products such as gravelless pipe are no longer approved for installation in the State of Minnesota and may have a significantly reduced performance and/or life expectancy.
- 7. WINTER WORK: By accepting this report, it is understood that inspections conducted during winter months (approximately November 1<sup>st</sup> through April 1<sup>st</sup>) are more difficult to perform because of possible snow cover and/or ground frost. SSTS components such as tanks, maintenance covers, tank inspection pipes, subsurface distribution medium inspection pipes, and soil treatment areas are more difficult or impossible to locate due to snow cover and/or ground frost. In addition, soil borings are more difficult to perform due to snow cover and/or ground frost. Brian L. Humpal, Inc. will attempt to use the same level of standards when performing work during winter periods as when performing work during non-winter periods. However, the recipient of this report understands that because of the aforementioned considerations, the same level of standards may not be possible.
- 8. By accepting this report, the client understands that Brian L. Humpal, Inc. will not be responsible for any monetary damages exceeding the fee for the services provided.

# Subsurface Sewage Treatment Systems Non-transferable Business License

# **Midwest Sewer Services**

License # L2896

License Expires: 12/22/2021

Issued: 11/06/2020

## **Specialty Area(s):**

Installer Maintainer Service Provider Advanced Designer Advanced Inspector

# **Designated Certified Individual(s):**

Cert #	Name	Certification Expires:
C5342	Brian L Humpal	10/15/2023
	Installer, Maintainer, Serv Prov,	Adv Designer, Adv Inspector
C9852	Christopher R Uebe	3/4/2024
	Designer, Inspector	



520 Lafayette Road North St. Paul, Minnesota 55155-4194

Mich Haig

Nick Haig, Supervisor Certification and Training Unit