### **Inspect Minnesota & Midwest Soil Testing**

P.O. Box 383 Hugo, MN 55038

Brian Humpal

651-492-7550/Brian@midwestsoiltesting.com

MPCA Licensed Advanced Inspector

### SUBSURFACE SEWAGE TREATMENT SYSTEM (SSTS) COMPLIANCE REPORT

**Inspection Address:** 760 Oakgreen Ave N, West Lakeland, MN 55082

### REPORT SUMMARY

I have performed an "MPCA Compliance Inspection" on this system and have reviewed the original design/permit records, along with a previous compliance inspection from 2004, which were on file at Washington County. This system consists of two pre-cast septic tanks and a rock trench drainfield.

Predicated on my inspection of the system and my review of the records, it is my opinion that this system <u>presently meets</u> MPCA minimum compliance inspection requirements.

Inspect Minnesota and Midwest Soil Testing have been hired to perform a compliance inspection of this SSTS for compliance with local ordinances pursuant to Minn. Stat. § 115.55 (2013). This compliance inspection covers only the criteria required by Minn. Stat. § 115.55 Subd. 5a (2013) and Minn. R. 7080.1500 (2011). A compliance inspection is an indication of the current compliance status of the system and does not guarantee the performance or longevity of this system beyond the date of inspection, as it is impossible to determine the future performance of any system. Inspect Minnesota and Midwest Soil Testing disclaim any use of this compliance inspection beyond determining SSTS compliance pursuant to Minn. Stat. § 115.55 Subd. 5a (2013) and Minn. R. 7080.1500 (2011).

Please contact me should you have any questions.

Brian Humpal Brian Humpal



### **Compliance Inspection Form**

### Existing Subsurface Sewage Treatment Systems (SSTS)

Doc Type: Compliance and Enforcement

<b>Instructions:</b> Inspection results based on Minnesota Pollution Control Agency (MPCA) requirements and attached forms – additional local requirements may also apply.	For local tracking purposes:
Submit completed form to Local Unit of Government (LUG) and system owner within 15 days	
maini 10 days	
System Status	
System status on date (mm/dd/yyyy): 6/16/2016	
	mpliant – Notice of Noncompliance grade Requirements on page 3)
Reason(s) for noncompliance (check all applicable)	
☐ Impact on Public Health (Compliance Component #1) – Imminent threat t	o public health and safety
☐ Other Compliance Conditions (Compliance Component #3) – Imminent th	
☐ Tank Integrity (Compliance Component #2) – Failing to protect groundwa	
Other Compliance Conditions (Compliance Component #3) – Failing to pr	
Soil Separation (Compliance Component #4) – Failing to protect ground	
☐ Operating permit/monitoring plan requirements (Compliance Component	#5) – Noncompliant
Property Information	
Property Information Parcel ID# or Sec/Twp/Ran	
	for inspection: Property Sale
Property owner: Bill & Margaret Pierson Owner's or	priorie.
Owner's representative: Ingrid Friel (Better Homes & Garden Reality) Represe	ntative phone: 612-750-6392
	ory authority phone: 651-430-4052
Brief system description: Two pre-cast septic tanks and a rock trench drainfield.	
Comments or recommendations:	
Certification	
I hereby certify that all the necessary information has been gathered to determine the determination of future system performance has been nor can be made due to unknow possible abuse of the system, inadequate maintenance, or future water usage.	
Inspector name: Brian Humpal Certifica	tion number: L5342
Business name: Inspect Minnesota, Midwest Soil Testing Lice	nse number: L2896
$\sim$	one number: 651-492-7550
· • •	
Necessary or Locally Required Attachments	
	local ordinance
☑ Other information (list): Report Summary, Property Information, Disclaimer, Li	cense

1.	lm	npact on Public Health – Cor	mpliance compone	ent #1 of 5			
	Co	ompliance criteria:		Verification method(s):			
-		vstem discharge sewage to the ound surface.	☐ Yes ☒ No	<ul><li>☑ Searched for surface outlet</li><li>☑ Searched for seeping in yard/backup in home</li></ul>			
		stem discharge sewage to drain tile surface waters.	☐ Yes ⊠ No	<ul> <li>☑ Excessive ponding in soil system/D-boxes</li> <li>☐ Homeowner testimony (See Comments/Explanation)</li> </ul>			
		vstem cause sewage backup into velling or establishment.	☐ Yes ⊠ No	<ul><li>"Black soil" above soil dispersal system</li><li>System requires "emergency" pumping</li><li>Performed dye test</li></ul>			
		ny "yes" answer above indicates n Imminent Threat to Public Heal		☐ Unable to verify (See Comments/Explanation) ☐ Other methods not listed (See Comments/Explanation)			
	Comments/Explanation: None of the above found.						
2.	Ta	ank Integrity – Compliance con	nponent #2 of 5				
	Co	ompliance criteria:		Verification method(s):			
		stem consists of a seepage pit,	☐ Yes ⊠ No	□ Probed tank(s) bottom     □			
		sspool, drywell, or leaching pit.		⊠ Examined construction records			
		repage pits meeting 7080.2550 may be mpliant if allowed in local ordinance.		☐ Changed liquid level helesy energting death			
		ewage tank(s) leak below their	☐ Yes ⊠ No	<ul><li>Observed liquid level below operating depth</li><li>Examined empty (pumped) tanks(s)</li></ul>			
		esigned operating depth.		Probed outside tank(s) for "black soil"			
		If yes, which sewage tank(s) leaks:		☐ Unable to verify (See Comments/Explanation)			
		ny "yes" answer above indica ystem is Failing to Protect Gr		☐ Other methods not listed (See Comments/Explanation)			
		omments/Explanation:					
	Lo	wered underwater camera into tanks -	baffles and tank wa	ills OK.			
_	_						
3.	U	ther Compliance Conditions	6 – Compliance co	'			
	a.	Maintenance hole covers are damage	d, cracked, unsecure	d, or appear to structurally unsound. ☐ Yes* ☒ No ☐ Unknown			
	b. Other issues (electrical hazards, etc.) to immediately and adversely impact public health or safety. ☐ Yes* ☒ No ☐ Unknown *System is an imminent threat to public health and safety						
		Explain:					
	c. System is non-protective of ground water for other conditions as determined by inspector ☐ Yes* ☒ No *System is failing to protect groundwater						
		Explain:					

Property address: \_ 760 Oakgreen Ave N, West Lakeland, MN 55082

Inspector initials/Date: 6/16/2016

www.pca.state.mn.us • 651-296-6300 • 800-657-3864 • 3 off9TY 651-282-5332 or 800-657-3864 • Available in alternative formats wq-wwists4-31 • 1/24/12 Page 2 of 3

1.	Soil Separation — Compliance compor	nent #4 o	f 5			
	Date of installation: 1995	Unkn	own	V	erification method(s):	
	Shoreland/Wellhead protection/Food Beverage Lodging?	☐ Yes	⊠ No	Soil observation does not expire. Previous soil		
	Compliance criteria:				oservations by two independent p nless site conditions have been al	
	For systems built prior to April 1, 1996, and	⊠ Yes	☐ No		quirements differ.	
	not located in Shoreland or Wellhead Protection Area or not serving a food, beverage or lodging establishment:				<ul><li>Conducted soil observation(s) (and the conducted soil observations (Attail observations)</li><li>Two previous verifications (Attail observations)</li><li>Not applicable (Holding tank(s), not applicable)</li></ul>	ch boring logs)
	Drainfield has at least a two-foot vertical separation distance from periodically saturated soil or bedrock.			☐ Unable to verify (See Comments/Explanation) ☐ Other (See Comments/Explanation)		
	Non-performance systems built April 1,	☐ Yes	□ No C	C	omments/Explanation:	
	1996, or later or for non-performance systems located in Shoreland or Wellhead			R	eviewed previous compliance insp	pection from 2004.
	Protection Areas or serving a food, beverage, or lodging establishment:			R	eviewed design and permit record	ls.
	Drainfield has a three-foot vertical separation distance from periodically saturated soil or bedrock.*					
	"Experimental", "Other", or "Performance" systems built under pre-2008 Rules; Type IV or V systems built under 2008 Rules (7080. 2350 or 7080.2400 (Advanced Inspector License required)	☐ Yes ☐	☐ No	In	dicate depths of elevations	
				<u>A.</u>	Bottom of distribution media	See Attached Boring Log(s)
	Drainfield meets the designed vertical			В.	Periodically saturated soil/bedrock	
	separation distance from periodically saturated soil or bedrock.			C.	System separation	
				D.	Required compliance separation*	
Any "no" answer above indicates the system is Failing to Protect Groundwater.  *May be reduced up to 15 percent if allowed by L Ordinance.				f allowed by Local		
5.	Operating Permit and Nitrogen B	<b>MP*</b> – C	ompliance	com	ponent #5 of 5 🔀 <b>Not app</b>	licable
	Is the system operated under an Operating Per	mit?	☐ Yes [	⊠ No	If "yes", A below is required	
	Is the system required to employ a Nitrogen BMP?					
	BMP=Best Management Practice(s) specified in the system design					
If the answer to both questions is "no", this section does not need to be completed.						
	Compliance criteria					
	Operating Permit number:     Have the Operating Permit requirements been met?				☐ Yes ☐ No	
b. Is the required nitrogen BMP in place and properly functioning?			Yes No			
	Any "no" answer indicates Noncom	pliance.				

Inspector initials/Date: 6/16/2016

Upgrade Requirements (Minn. Stat. § 115.55) An imminent threat to public health and safety (ITPHS) must be upgraded, replaced, or its use discontinued within ten months of receipt of this notice or within a shorter period if required by local ordinance. If the system is failing to protect ground water, the system must be upgraded, replaced, or its use discontinued within the time required by local ordinance. If an existing system is not failing as defined in law, and has at least two feet of design soil separation, then the system need not be upgraded, repaired, replaced, or its use discontinued, notwithstanding any local ordinance that is more strict. This provision does not apply to systems in shoreland areas, Wellhead Protection Areas, or those used in connection with food, beverage, and lodging establishments as defined in law.


800-657-3864 • 4 of ISTY 651-282-5332 or 800-657-3864 • Available in alternative formats wq-wwists4-31 • 1/24/12 Page 3 of 3

Property address: 760 Oakgreen Ave N, West Lakeland, MN 55082

### **Inspect Minnesota & Midwest Soil Testing**

### Subsurface Sewage Treatment System Owner/Property Information This information will be used for the purpose of conducting an MPCA Compliance Inspection.

Date of Inspection: June 16, 2016	Time: 1:00 PM					
Property Address: 760 Oakgreen Ave N, West Lakeland, MN	Zip: 55082					
Property Owner: Bill & Margart Pierson	Phone:					
Tank(s) Septic 2 Fiberglass Aerobic Lift Holding Other: Block Other  Tank(s) Material Soil Treatment System Rock trench Gravelless trench Chamber trench Seepage bed Mound Other At-grade	Other  Alternative system Experimental system Cesspool system Other system					
performed through the maintenance holes. Maintenance hole cover the ground surface to facilitate access and proper maintenance of the ground surface to facilitate access and proper maintenance of the ground surface to facilitate access and proper maintenance of the ground surface to facilitate access and proper maintenance of the ground surface to facilitate access and proper maintenance of the ground surface to facilitate access and proper maintenance of the ground surface to facilitate access and proper maintenance of the ground surface to facilitate access and proper maintenance of the ground surface to facilitate access and proper maintenance of the ground surface to facilitate access and proper maintenance of the ground surface to facilitate access and proper maintenance of the ground surface to facilitate access and proper maintenance of the ground surface to facilitate access and proper maintenance of the ground surface to facilitate access and proper maintenance of the ground surface to facilitate access and proper maintenance of the ground surface to facilitate access and proper maintenance of the ground surface access and ground surface access and ground surface access and ground surface access access access and ground surface access acc	Are the tank maintenance covers accessible?   Yes   No *If no, proper maintenance must be performed through the maintenance holes. Maintenance hole covers should be made accessible to the ground surface to facilitate access and proper maintenance of the system.					
	Tank size (gals.): 1-1500 1-1000					
	sidents in home?					
Number of bedrooms? 4 Are all floors drained by g						
Garbage disposal? Whirlpool bath?						
More than one system (laundry, etc.)?  Does this property have any footing drain tiles connected to the se	ptic system?					
Are any buildings on this property such as garages or out-buildings connected to this system?						
Are there any additional systems on this property serving other buildings?						
Location of septic system on lot? West Side						
	e well a deep well? Y					
Have you ever experienced any problems with the system such as: tree roots, sewage back-ups, surfacing of sewage onto the ground, septic tank overflowing, etc.; or have any repairs been made to the system?  If yes, explain:						
When was the system last pumped? 2015 Name of pum	1					
How often pumped in previous years?  Is system on a monitoring plan?						
Have you received notices from any government agency concerning this system?						
Is your property located in a shoreland management area? N						
Do you have any additional information that should be given to the new owner?						
I hereby certify that the above information is correct to the best of my knowledge. I also understand that if the system is considered "non-compliant/failing" per MPCA rules, that the inspector must by law submit a copy of this report to the local government unit within 15 days of the date of inspection completion. I also agree that unless otherwise noted in this report, that I/we are ultimately responsible for payment of all fees for all work performed relative to this inspection by Inspect Minnesota and Midwest Soil Testing.						
Owner/Occupant:	Date:					

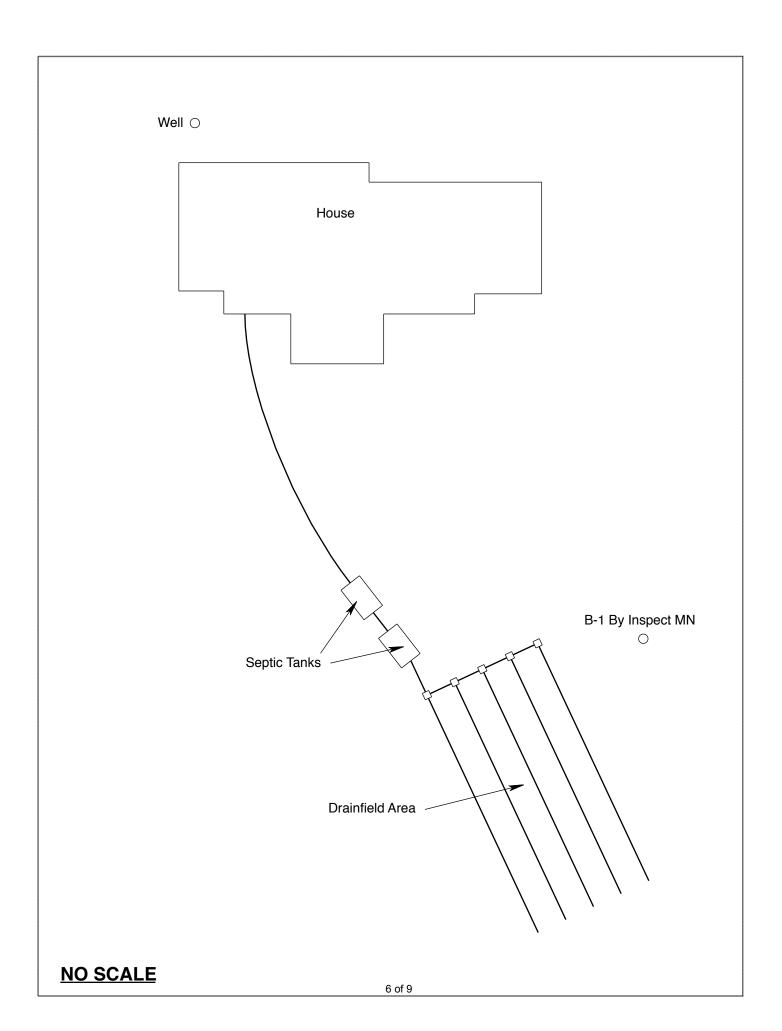

### **Log Of Soil Borings**

Location of Project: 760 Oakgreen Ave N, West Lakeland, MN 55082						
Borings Made By: Inspect Minnesota		Date:		6/16/16		
	Auger Used:	Hand/Bucket	Classification System:		USDA	
	Boring Number:	1		Boring Number:		
Surface	I Same arou	ind surface as last	Surface			
Elevation Boring	drair	nfield trench	Elevation Boring	01		
Depth In	0 11 5		Depth In	0 " -		
Inches	Soils E	<u>ncountered</u>	Inches	Soils En	Soils Encountered	
0-20 20-46 46-58 58-70	10YR 10YR 4/3 10YR 3/4 Medium 0 ≈10% Ro	am (Fill/Disturbed) 4/3 Loam Medium Sand Coarse Sand With Gravel ock Fragments sal at 70"				
70"	0" Depth To End Of Boring Or Redox			Depth To End Of Bo	oring Or Redox	
Same	Elevation Of Boring Relative To System			Elevation Of Boring	Relative To System	
-37" Depth To Bottom Of Distribution Media		Depth To Bottom Of Distribution Media				
≥33"	Of Separation		<u> </u>	Of Separation		
	End Of Boring At:	70"		End Of Boring At:		
Redox Present At: None		Redox Present At:				
Standing	Water Present At:	Present At: None Standing Water Present At:				

Bottom Of Distribu	ition Medium At: 37 Inches	
_	_	

### **DISCLAIMER**

### Brian L. Humpal, Inc. dba. Inspect Minnesota, Midwest Soil Testing Relative to Subsurface Sewage Treatment System (SSTS) Compliance Inspections

- 1. This inspection/report is being performed for only the seller/owner of the property on which the SSTS is located. In such case that another party is paying for the inspection, the contract is between only said party and Brian L. Humpal, Inc.; there is no contract between Brian L. Humpal, Inc. and any other party unless otherwise noted.
- 3. Brian L. Humpal, Inc. has not been retained to warranty, guarantee, or certify the proper functioning of the SSTS for any period of time beyond the date of inspection or into the future. Because of the numerous factors (usage, maintenance, soil characteristics, previous failures, etc.) which may affect the proper operation of an SSTS, as well as the inability of Brian L. Humpal, Inc. to supervise or monitor the use or maintenance of the SSTS, the report shall not be construed as a warranty by Brian L. Humpal, Inc. that the SSTS will function properly for any particular party for any period of time.
- 4. Brian L. Humpal, Inc. is unable to verify the frequency and/or, quality of prior or future maintenance of the SSTS. Maintenance of the tank(s) must be performed through the tanks maintenance hole. The removal of solids from any location other than the maintenance hole is not a compliant method of maintenance. It is strongly recommended that maintenance covers be made accessible to the ground surface to facilitate proper maintenance.
- 5. Minimum Compliance Inspection requirements relative to this inspection and this report include <u>only</u> verification that the SSTS has tank(s) (septic tanks, lift tanks, dosing tanks, stilling tanks, etc.) which are watertight below the designed operating depth, the required separation between the bottom of the subsurface soil distribution medium and seasonally saturated soils, no back-ups of sewage into the dwelling, no discharge of sewage/effluent to the ground surface or surface waters, and no imminent safety hazards. Brian L. Humpal, Inc. does not inspect plumbing or pumps prior to the first SSTS component as these are plumbing components. The performance of exterior pumps and associated components are not inspected as they are considered to be maintenance items. Additionally, no indications relative to compliance with electrical code requirements have been made. It is recommended that any other applicable plumbing, electrical, housing, etc. inspections be performed by a qualified inspection business. Sewage back-up verification is limited to observing the floor drain area and/or the information supplied by the last occupants of the building prior to inspection. Brian L. Humpal, Inc. cannot guarantee that the information given to them by the last occupants of the building prior to inspection relative to back-ups is accurate.
- 4. Certification of this SSTS does not warranty future use beyond the date of the inspection. Any SSTS, old or new, can become hydraulically overloaded or discharge sewage/effluent to the ground surface as a result of more people moving into the house than were previously occupying the house, improper maintenance, heavy usage, leaking plumbing fixtures, groundwater infiltration, tree roots, freezing conditions, surface drainage problems, poor initial design, poor construction practices, or unsuitable materials used in constructing the system; the system can also simply stop working because of its age. An SSTS that has been properly designed and installed, properly maintained, and used in the manner for which the system was designed can be expected to provide service for twenty to twenty-five years on average. Some parts of the SSTS such as alarms, switches, pumps, filters, etc. will most likely have to be repaired or replaced over the lifetime of the system.
- 5. A Compliance Inspection is not meant to be a test or inspection for longevity of the system; a Compliance Inspection is strictly for the purpose of determining if the SSTS is protective of public health and safety, as well as the groundwater at the date and time the inspection was performed. This inspection is not intended to determine if the SSTS was originally designed or installed to past or present MPCA or other Local Government Unit code requirements. This inspection is not intended to determine if the SSTS was designed and/or installed to support the anticipated flow from the building as the use of the building may have changed since the design and construction of the SSTS due to the addition of bedrooms, occupants, etc. In addition, this inspection is not intended to determine the quality of the original SSTS design, the quality of the construction practices used while installing the SSTS, or the quality of the materials used in constructing the SSTS.
- 6. Brian L. Humpal, Inc. cannot guarantee the performance of SSTS products/components such as: gravelless pipe, chamber trenches, effluent filters, tanks, sewage pre-treatment components, piping, etc. Products such as gravelless pipe are no longer approved for installation in the State of Minnesota and may have a significantly reduced performance and/or life expectancy.
- 7. WINTER WORK: By accepting this report, it is understood that inspections conducted during winter months (approximately November 1<sup>st</sup> through April 1<sup>st</sup>) are more difficult to perform because of possible snow cover and/or ground frost. SSTS components such as tanks, maintenance covers, tank inspection pipes, subsurface distribution medium inspection pipes, and soil treatment areas are more difficult or impossible to locate due to snow cover and/or ground frost. In addition, soil borings are more difficult to perform due to snow cover and/or ground frost. Brian L. Humpal, Inc. will attempt to use the same level of standards when performing work during winter periods as when performing work during non-winter periods. However, the recipient of this report understands that because of the aforementioned considerations, the same level of standards may not be possible.
- 8. By accepting this report, the client understands that Brian L. Humpal, Inc. will not be responsible for any monetary damages exceeding the fee for the services provided.

# Sulbsurface Sewage Treatment Systems

Non-transferable



License # L2896

Maintainer License Expires:

Adv Inspector License Expires:

Oct 28, 2015 Dec 22, 2016 Dec 22, 2016 Dec 22, 2016 Dec 22, 2016

Adv Designer License Expires:

Date of Issuance:

Installer License Expires:

### Certification

Inspect Minnesota, Midwest Soil Testing

Expires

10/15/2017 10/15/2017

Advanced Designer (Certified) Advanced Inspector (Certified)

Maintainer (Certified)

Certification Type

**Designated Certified** 

Individual (DCI) Brian L. Humpal Brian L. Humpal Brian L. Humpal Brian L. Humpal Brian L. Humpal

10/15/2017

10/15/2017

10/15/2017

Service Provider (Certified)

Installer (Certified)

Designer (Certified) Inspector (Certified)

Christopher R. Uebe Christopher R. Uebe

03/04/2018

03/04/2018

Steven Giddings Manager Environmental Business Assistance Section



## Minnesota Pollution Control Agency

520 Lafayette Road North St. Paul, Minnesota 55155-4194