Inspect Minnesota & Midwest Soil Testing

P.O. Box 383 Hugo, MN 55038

Brian Humpal

651-492-7550/Brian@midwestsoiltesting.com

MPCA Licensed Advanced Inspector

SUBSURFACE SEWAGE TREATMENT SYSTEM (SSTS) COMPLIANCE REPORT

Date: June 27, 2016 **Time:** 2:30 PM **Owner:** Tom & Susan Soderman

Inspection Address: 14539 Old Guslander Trail N, May Twp, MN 55047

REPORT SUMMARY

I have performed an "MPCA Compliance Inspection" on this system, have reviewed the history of the system with the owner, Susan Soderman, and have reviewed the original design/permit records on file at Washington County. This older system (installed in 1987) consists of a pre-cast septic tank and a rock trench drainfield.

Predicated on my inspection of the system, my review of the history of the system with the owner, and my review of the original design/permit records, it is my opinion that this system presently meets MPCA minimum compliance inspection requirements.

Inspect Minnesota and Midwest Soil Testing have been hired to perform a compliance inspection of this SSTS for compliance with local ordinances pursuant to Minn. Stat. § 115.55 (2013). This compliance inspection covers only the criteria required by Minn. Stat. § 115.55 Subd. 5a (2013) and Minn. R. 7080.1500 (2011). A compliance inspection is an indication of the current compliance status of the system and does not guarantee the performance or longevity of this system beyond the date of inspection, as it is impossible to determine the future performance of any system. Inspect Minnesota and Midwest Soil Testing disclaim any use of this compliance inspection beyond determining SSTS compliance pursuant to Minn. Stat. § 115.55 Subd. 5a (2013) and Minn. R. 7080.1500 (2011).

Please contact me should you have any questions.

Brian Humpal
Brian Humpal



Compliance Inspection Form

Existing Subsurface Sewage Treatment Systems (SSTS)

Doc Type: Compliance and Enforcement

System Status System status on date (mm/dd/yyyy): 6/27/2016 Compliant - Certificate of Compliance (Valid for 3 years from report date, unless shorter time frame outlined in Local Ordinance.) Reason(s) for noncompliance (check all applicable) Impact on Public Health (Compliance Component #1) - Imminent threat to public health and safety Impact on Public Health (Compliance Component #2) - Failing to protect groundwater Impact on Public Health (Compliance Component #2) - Failing to protect groundwater Impact on Public Health (Compliance Component #3) - Failing to protect groundwater Impact on Public Health (Compliance Component #3) - Failing to protect groundwater Impact on Public Health (Compliance Component #3) - Failing to protect groundwater Impact on Public Health (Compliance Component #3) - Failing to protect groundwater Impact on Public Health (Compliance Component #3) - Failing to protect groundwater Impact on Public Health (Compliance Component #3) - Failing to protect groundwater Impact on Public Health (Compliance Component #3) - Failing to protect groundwater Impact on Public Health (Compliance Component #3) - Failing to protect groundwater Impact on Public Health (Compliance Component #3) - Failing to protect groundwater Impact on Public Health (Compliance Component #3) - Failing to protect groundwater Impact on Public Health (Compliance Component #3) - Failing to protect groundwater Impact on Public Health (Compliance Component #3) - Failing to protect groundwater Impact Sec/Twp/Range: Property address: 14539 Old Guslander Trail N, May Twp, MN 55047 Reason for inspection: Property Sale Property owner: Tom & Susan Soderman Owner's phone: Property Sale Ow		
System Status System status on date (mm/dd/yyyy): 6/27/2016 Compliant - Certificate of Compliance (Valid for 3 years from report date, unless shorter time frame outlined in Local Ordinance.) Reason(s) for noncompliance (check all applicable) Imminent threat to public health and safety Impact on Public Health (Compliance Component #1) - Imminent threat to public health and safety Impact on Public Health (Compliance Component #2) - Imminent threat to public health and safety Impact on Public Health (Compliance Component #3) - Imminent threat to public health and safety Impact on Public Health (Compliance Component #3) - Imminent threat to public health and safety Impact on Public Health (Compliance Component #3) - Failing to protect groundwater Impact on Public Health (Compliance Component #3) - Failing to protect groundwater Impact on Public Health (Compliance Component #4) - Failing to protect groundwater Impact on Public Health (Compliance Component #4) - Failing to protect groundwater Impact on Public Health (Compliance Component #4) - Failing to protect groundwater Impact on Public Health (Compliance Component #4) - Failing to protect groundwater Impact on Public Health (Compliance Component #4) - Read (Compliance Component #4) - Failing to protect groundwater Impact on Public Health (Compliance Component #4) - Read (Compliance Component #4) - Read (Component #4) - Read (aron rigorios (ivii oni)
System status on date (mm/dd/yyyy): 6/27/2016 Compliant - Certificate of Compliance (Valid for 3 years from report date, unless shorter time frame outlined in Local Ordinance.) Reason(s) for noncompliance (check all applicable)	Submit completed form to Local Unit of Government (LUG) ar within 15 days	nd system owner
Compliant - Certificate of Compliance (Valid for 3 years from report date, unless shorter time frame outlined in Local Ordinance.) Reason(s) for noncompliance (check all applicable)	System Status	
(Valid for 3 years from report date, unless shorter time frame outlined in Local Ordinance.) Reason(s) for noncompliance (check all applicable) Impact on Public Health (Compliance Component #1) - Imminent threat to public health and safety Other Compliance Conditions (Compliance Component #3) - Imminent threat to public health and safety Tank Integrity (Compliance Component #2) - Failing to protect groundwater Other Compliance Conditions (Compliance Component #3) - Failing to protect groundwater Other Compliance Conditions (Compliance Component #3) - Failing to protect groundwater Other Compliance Component #4) - Failing to protect groundwater Operating permit/monitoring plan requirements (Compliance Component #5) - Noncompliant Property Information	System status on date (mm/dd/yyyy): 6/27/2016	
Impact on Public Health (Compliance Component #1) - Imminent threat to public health and safety Other Compliance Compliance Component #2) - Imminent threat to public health and safety Tank Integrity (Compliance Component #2) - Failing to protect groundwater Other Compliance Conditions (Compliance Component #3) - Failing to protect groundwater Other Compliance Component #4) - Failing to protect groundwater Operating permit/monitoring plan requirements (Compliance Component #5) - Noncompliant Property Information	(Valid for 3 years from report date, unless shorter time	☐ Noncompliant – Notice of Noncompliance (See Upgrade Requirements on page 3)
Property address:14539 Old Guslander Trail N, May Twp, MN 55047 Reason for inspection:Property Sale Property owner:Tom & Susan Soderman	☐ Impact on Public Health (Compliance Component #1) ☐ Other Compliance Conditions (Compliance Component ☐ Tank Integrity (Compliance Component #2) – Failing ☐ Other Compliance Conditions (Compliance Component ☐ Soil Separation (Compliance Component #4) – Failing	o) – Imminent threat to public health and safety nt #3) – Imminent threat to public health and safety to protect groundwater nt #3) – Failing to protect groundwater g to protect groundwater
Property address:14539 Old Guslander Trail N, May Twp, MN 55047 Reason for inspection:Property Sale Property owner:Tom & Susan Soderman		
Property address:14539 Old Guslander Trail N, May Twp, MN 55047 Reason for inspection:Property Sale Property owner:Tom & Susan Soderman	Property Information Baroot	ID# or Soc/Two/Pango
Property owner: Tom & Susan Soderman Owner's phone: Owner's representative: Jason Peltier (Edina Realty) Local regulatory authority: Washington County Regulatory authority phone: 651-402-3007 Regulatory authority phone: 651-430-4052 Brief system description: Pre-cast septic tank and a rock trench drainfield. Comments or recommendations: Certification I hereby certify that all the necessary information has been gathered to determine the compliance status of this system. No determination of future system performance has been nor can be made due to unknown conditions during system construction, possible abuse of the system, inadequate maintenance, or future water usage. Inspector name: Brian Humpal Certification number: L5342 Business name: Inspect Minnesota, Midwest Soil Testing License number: L2896 Inspector signature: Phone number: 651-492-7550 Necessary or Locally Required Attachments Soil boring logs System/As-built drawing Forms per local ordinance	• •	
Owner's representative: Jason Peltier (Edina Realty) Representative phone: 651-402-3007 Local regulatory authority: Washington County Regulatory authority phone: 651-430-4052 Brief system description: Pre-cast septic tank and a rock trench drainfield. Comments or recommendations: Certification I hereby certify that all the necessary information has been gathered to determine the compliance status of this system. No determination of future system performance has been nor can be made due to unknown conditions during system construction, possible abuse of the system, inadequate maintenance, or future water usage. Inspector name: Brian Humpal Certification number: L5342 Business name: Inspect Minnesota, Midwest Soil Testing License number: L2896 Inspector signature: Humpal Phone number: 651-492-7550 Necessary or Locally Required Attachments Soil boring logs System/As-built drawing Forms per local ordinance	· · · · ·	
Certification Perecast septic tank and a rock trench drainfield.	or	
Brief system description: Pre-cast septic tank and a rock trench drainfield. Comments or recommendations: Certification I hereby certify that all the necessary information has been gathered to determine the compliance status of this system. No determination of future system performance has been nor can be made due to unknown conditions during system construction, possible abuse of the system, inadequate maintenance, or future water usage. Inspector name: Brian Humpal Certification number: L5342 Business name: Inspect Minnesota, Midwest Soil Testing License number: L2896 Inspector signature: Phone number: 651-492-7550 Necessary or Locally Required Attachments Soil boring logs System/As-built drawing Forms per local ordinance	Owner's representative:Jason Peltier (Edina Realty)	Representative phone: 651-402-3007
Certification I hereby certify that all the necessary information has been gathered to determine the compliance status of this system. No determination of future system performance has been nor can be made due to unknown conditions during system construction, possible abuse of the system, inadequate maintenance, or future water usage. Inspector name: Brian Humpal Business name: Inspect Minnesota, Midwest Soil Testing Inspector signature: Brian Humpal Certification number: L5342 License number: L2896 Phone number: 651-492-7550 Necessary or Locally Required Attachments Soil boring logs System/As-built drawing	Local regulatory authority: Washington County	Regulatory authority phone: 651-430-4052
Certification I hereby certify that all the necessary information has been gathered to determine the compliance status of this system. No determination of future system performance has been nor can be made due to unknown conditions during system construction, possible abuse of the system, inadequate maintenance, or future water usage. Inspector name: Brian Humpal Certification number: L5342 Business name: Inspect Minnesota, Midwest Soil Testing License number: L2896 Phone number: 651-492-7550 Necessary or Locally Required Attachments Soil boring logs System/As-built drawing	Brief system description: Pre-cast septic tank and a rock trench	n drainfield.
I hereby certify that all the necessary information has been gathered to determine the compliance status of this system. No determination of future system performance has been nor can be made due to unknown conditions during system construction, possible abuse of the system, inadequate maintenance, or future water usage. Inspector name: Brian Humpal	Comments or recommendations:	
determination of future system performance has been nor can be made due to unknown conditions during system construction, possible abuse of the system, inadequate maintenance, or future water usage. Inspector name: Brian Humpal Certification number: L5342 Business name: Inspect Minnesota, Midwest Soil Testing License number: L2896 Inspector signature: Phone number: 651-492-7550 Necessary or Locally Required Attachments Soil boring logs System/As-built drawing Forms per local ordinance	Certification	
Business name: Inspect Minnesota, Midwest Soil Testing Inspector signature: Description	determination of future system performance has been nor can be	made due to unknown conditions during system construction,
Inspector signature:	Inspector name: Brian Humpal	Certification number: L5342
Necessary or Locally Required Attachments ☐ Soil boring logs ☐ System/As-built drawing ☐ Forms per local ordinance	Business name: Inspect Minnesota, Midwest Soil Testing	License number: L2896
Soil boring logs System/As-built drawing □ Forms per local ordinance	Inspector signature: Brian Humpal	Phone number: 651-492-7550
Soil boring logs System/As-built drawing □ Forms per local ordinance	Necessary or Locally Required Attachments	
		☐ Forms per local ordinance
		·

1.	lm	npact on Public Health – Cor	mpliance compone	nt #1 of 5			
Compliance criteria:				Verification method(s):			
		stem discharge sewage to the bund surface.	☐ Yes ⊠ No	☑ Searched for surface outlet☑ Searched for seeping in yard/backup in home			
		stem discharge sewage to drain tile surface waters.	☐ Yes ⊠ No	 ☑ Excessive ponding in soil system/D-boxes ☑ Homeowner testimony (See Comments/Explanation) ☐ "Black soil" above soil dispersal system 			
		stem cause sewage backup into velling or establishment.	☐ Yes ⊠ No	System requires "emergency" pumping Performed dye test			
		ny "yes" answer above indicates I Imminent Threat to Public Heal	•	☐ Unable to verify (See Comments/Explanation) ☐ Other methods not listed (See Comments/Explanation)			
		omments/Explanation: one of the above found.					
2.	Ta	ank Integrity – Compliance con	nponent #2 of 5				
	Co	ompliance criteria:	,	Verification method(s):			
		stem consists of a seepage pit,	☐ Yes ⊠ No	□ Probed tank(s) bottom			
		sspool, drywell, or leaching pit. epage pits meeting 7080.2550 may be		☐ Examined Construction records			
		mpliant if allowed in local ordinance.		Examined Tank Integrity Form (Attach)Observed liquid level below operating depth			
		wage tank(s) leak below their signed operating depth.	☐ Yes ⊠ No	Examined empty (pumped) tanks(s)			
		/es, which sewage tank(s) leaks:		☐ Probed outside tank(s) for "black soil"			
	A	ny "yes" answer above indica stem is Failing to Protect Gr		 ☐ Unable to verify (See Comments/Explanation) ☑ Other methods not listed (See Comments/Explanation) 			
		omments/Explanation:					
	Lo	wered underwater camera into tank - I	baffles and tank wall	s OK.			
2	01	thar Campliance Canditions					
3.	U	ther Compliance Conditions	·				
	a. Maintenance hole covers are damaged, cracked, unsecured, or appear to structurally unsound. ☐ Yes* ☒ No ☐ Unknow						
 b. Other issues (electrical hazards, etc.) to immediately and adversely impact public health or safety. ☐ Yes* ☒ No ☐ *System is an imminent threat to public health and safety 							
	C.	c. System is non-protective of ground water for other conditions as determined by inspector ☐ Yes* ☒ No *System is failing to protect groundwater					
		Explain:					

Property address: 14539 Old Guslander Trail N, May Twp, MN 55047

Inspector initials/Date: 6/27/2016

www.pca.state.mn.us • 651-296-6300 • 800-657-3864 • 3 off9TY 651-282-5332 or 800-657-3864 • Available in alternative formats wq-wwists4-31 • 1/24/12 Page 2 of 3

Date of installation: 1987	Unknown	Verification method(s):			
Shoreland/Wellhead protection/Food Beverage .odging?	☐ Yes No		Soil observation does not expire. Previous soil		
Compliance criteria:		observations by two independent punless site conditions have been a			
For systems built prior to April 1, 1996, and not located in Shoreland or Wellhead Protection Area or not serving a food, beverage or lodging establishment:	⊠ Yes □ No	Two previous verifications (Atta	requirements differ. Conducted soil observation(s) (Attach boring logs) Two previous verifications (Attach boring logs) Not applicable (Holding tank(s), no drainfield) Unable to verify (See Comments/Explanation) Other (See Comments/Explanation) Comments/Explanation:		
Drainfield has at least a two-foot vertical separation distance from periodically saturated soil or bedrock.		Unable to verify (See Comments			
Non-performance systems built April 1, 1996, or later or for non-performance	r later or for non-performance	Comments/Explanation: Reviewed design and permit recor			
systems located in Shoreland or Wellhead Protection Areas or serving a food, beverage, or lodging establishment:		,			
Drainfield has a three-foot vertical separation distance from periodically saturated soil or bedrock.*					
"Experimental", "Other", or "Performance" systems built under pre-2008 Rules; Type IV	☐ Yes ☐ No	Indicate depths of elevations			
or V systems built under 2008 Rules (7080. 2350 or 7080.2400 (Advanced Inspector License required)		A. Bottom of distribution media	See Attached Boring Log(s)		
Drainfield meets the designed vertical separation distance from periodically		B. Periodically saturated soil/bedrockC. System separation			
saturated soil or bedrock.		D. Required compliance separation*			
Any "no" answer above indicates to Failing to Protect Groundwater.	Any "no" answer above indicates the system is		if allowed by Local		
Operating Permit and Nitrogen B	MP* – Compliar	nce component #5 of 5 🔀 Not app	olicable		
the system operated under an Operating Per	mit?	oxdot No $oxdot$ If "yes", A below is required			
Is the system required to employ a Nitrogen BMP?					
BMP=Best Management Practice(s) specified in the system design					
the answer to both questions is "no", this section does not need to be completed.					
ompliance criteria					
a. Operating Permit number:					
Have the Operating Permit requirements to	neen met?	☐ Yes ☐ No			
and operating i offine requirements i	s the required nitrogen BMP in place and properly functioning?				

Property address: 14539 Old Guslander Trail N, May Twp, MN 55047

Upgrade Requirements (Minn. Stat. § 115.55) An imminent threat to public health and safety (ITPHS) must be upgraded, replaced, or its use discontinued within ten months of receipt of this notice or within a shorter period if required by local ordinance. If the system is failing to protect ground water, the system must be upgraded, replaced, or its use discontinued within the time required by local ordinance. If an existing system is not failing as defined in law, and has at least two feet of design soil separation, then the system need not be upgraded, repaired, replaced, or its use discontinued, notwithstanding any local ordinance that is more strict. This provision does not apply to systems in shoreland areas, Wellhead Protection Areas, or those used in connection with food, beverage, and lodging establishments as defined in law.

www.pca.state.mn.us • 651-296-6300 • 800-657-3864 wq-wwists4-31 • 1/24/12 Page 3 of 3

Inspector initials/Date: 6/27/2016

Inspect Minnesota & Midwest Soil Testing


Subsurface Sewage Treatment System Owner/Property Information

This information will be used for the purpose of conducting an MPCA Compliance Inspection.

Date of Inspection: June 27, 2016	Time: 2:30 PM					
Property Address: 14539 Old Guslander Trail N, I	May Twp, MN Zip: 55047					
Property Owner: Tom & Susan Soderman	Phone:					
Tank(s) Tank(s)Material Soil Tree Septic 1 Fiberglass Septic Plastic Aerobic Plastic Grav Lift Metal Char	eatment System trench Alternative system elless trench Description Description Description					
Year house built: 1987 Year septic installed	: 1987 Tank size (gals.): 1250					
1	Number of residents in home? 2					
	rs drained by gravity? Y					
	Whirlpool bath? Y					
More than one system (laundry, etc.)? N	•					
Does this property have any footing drain tiles com	nected to the septic system? N					
Are any buildings on this property such as garages	or out-buildings connected to this system? N					
Are there any additional systems on this property se	erving other buildings? N					
Location of septic system on lot? South Side						
Location of water well on lot? East Side	Is the well a deep well? Y					
Have you ever experienced any problems with the system such as: tree roots, sewage back-ups, surfacing of sewage onto the ground, septic tank overflowing, etc.; or have any repairs been made to the system? N If yes, explain:						
When was the system last pumped? Name of pumper: VES						
How often pumped in previous years?	Is system on a monitoring plan? N					
Have you received notices from any government ag						
Is your property located in a shoreland managemen						
Do you have any additional information that should	I be given to the new owner? N					

I hereby certify that the above information is correct to the best of my knowledge. I also understand that if the system is considered "non-compliant/failing" per MPCA rules, that the inspector must by law submit a copy of this report to the local government unit within 15 days of the date of inspection completion. I also agree that unless otherwise noted in this report, that I/we are ultimately responsible for payment of all fees for all work performed relative to this inspection by Inspect Minnesota and Midwest Soil Testing.

Owner/Occupant: Susan Soderman's Signature On File Date: 6/27/2016

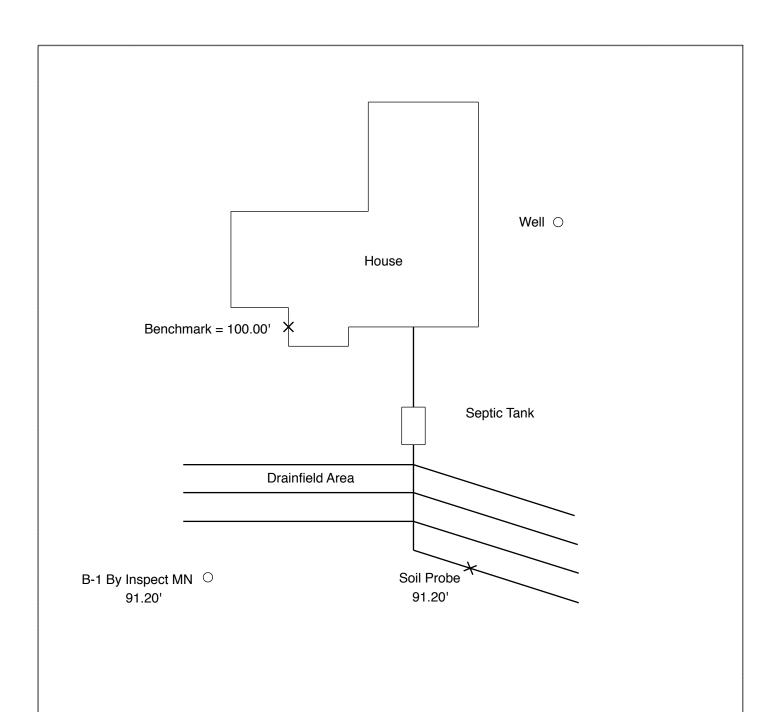

Log Of Soil Borings

Loc	Location of Project: 14539 Old Guslander Trail N, May Twp, MN 55047					
Borings Made By: Inspect Minnesota		Date:		6/27/16		
Auger Used: Bucket/Post Hole Digger/Heavy Bar		Classi	ification System:	USDA		
	Boring Number:	1		Boring Number:		
Surface		91.20'	Surface			
Elevation (of Benchmark	= 100.00' at patio	Elevation	of		
Boring	door	threshold	Boring			
Depth In	Soils Er	ncountered	Depth In	Soils E	ncountered	
Inches			Inches			
0-11 11-22 22-38 38-56	≈30-40% F 10YR 4/3 Mediu ≈30-40% F 10YR 3/4 Medium C ≈30 Roc 10YR 4/4 Medium C ≈30% Ro	m Sand With Gravel Rock & Cobbles m Sand With Gravel Rock & Cobbles coarse Sand With Gravel k Fragments coarse Sand With Gravel ck Fragments sal At 56"				
	Elevation To Botton Depth To Redox Or	n Of Distribution Media		Elevation To Bottom Depth To Redox	Of Distribution Media	
=2.59'/31" Of Separation		Of Separation				
End Of Boring At: 56"			End Of Boring At:			
	Redox Present At: None			Redox Present At:		
Standing Water Present At: None			Standing	Water Present At:		

Bottom Of Distribution Medium At: 25" Or Elevation89.12' At Soil Probe

DISCLAIMER

Brian L. Humpal, Inc. dba. Inspect Minnesota, Midwest Soil Testing Relative to Subsurface Sewage Treatment System (SSTS) Compliance Inspections

- 1. This inspection/report is being performed for only the seller/owner of the property on which the SSTS is located. In such case that another party is paying for the inspection, the contract is between only said party and Brian L. Humpal, Inc.; there is no contract between Brian L. Humpal, Inc. and any other party unless otherwise noted.
- 3. Brian L. Humpal, Inc. has not been retained to warranty, guarantee, or certify the proper functioning of the SSTS for any period of time beyond the date of inspection or into the future. Because of the numerous factors (usage, maintenance, soil characteristics, previous failures, etc.) which may affect the proper operation of an SSTS, as well as the inability of Brian L. Humpal, Inc. to supervise or monitor the use or maintenance of the SSTS, the report shall not be construed as a warranty by Brian L. Humpal, Inc. that the SSTS will function properly for any particular party for any period of time.
- 4. Brian L. Humpal, Inc. is unable to verify the frequency and/or, quality of prior or future maintenance of the SSTS. Maintenance of the tank(s) must be performed through the tanks maintenance hole. The removal of solids from any location other than the maintenance hole is not a compliant method of maintenance. It is strongly recommended that maintenance covers be made accessible to the ground surface to facilitate proper maintenance.
- 5. Minimum Compliance Inspection requirements relative to this inspection and this report include <u>only</u> verification that the SSTS has tank(s) (septic tanks, lift tanks, dosing tanks, stilling tanks, etc.) which are watertight below the designed operating depth, the required separation between the bottom of the subsurface soil distribution medium and seasonally saturated soils, no back-ups of sewage into the dwelling, no discharge of sewage/effluent to the ground surface or surface waters, and no imminent safety hazards. Brian L. Humpal, Inc. does not inspect plumbing or pumps prior to the first SSTS component as these are plumbing components. The performance of exterior pumps and associated components are not inspected as they are considered to be maintenance items. Additionally, no indications relative to compliance with electrical code requirements have been made. It is recommended that any other applicable plumbing, electrical, housing, etc. inspections be performed by a qualified inspection business. Sewage back-up verification is limited to observing the floor drain area and/or the information supplied by the last occupants of the building prior to inspection. Brian L. Humpal, Inc. cannot guarantee that the information given to them by the last occupants of the building prior to inspection relative to back-ups is accurate.
- 4. Certification of this SSTS does not warranty future use beyond the date of the inspection. Any SSTS, old or new, can become hydraulically overloaded or discharge sewage/effluent to the ground surface as a result of more people moving into the house than were previously occupying the house, improper maintenance, heavy usage, leaking plumbing fixtures, groundwater infiltration, tree roots, freezing conditions, surface drainage problems, poor initial design, poor construction practices, or unsuitable materials used in constructing the system; the system can also simply stop working because of its age. An SSTS that has been properly designed and installed, properly maintained, and used in the manner for which the system was designed can be expected to provide service for twenty to twenty-five years on average. Some parts of the SSTS such as alarms, switches, pumps, filters, etc. will most likely have to be repaired or replaced over the lifetime of the system.
- 5. A Compliance Inspection is not meant to be a test or inspection for longevity of the system; a Compliance Inspection is strictly for the purpose of determining if the SSTS is protective of public health and safety, as well as the groundwater at the date and time the inspection was performed. This inspection is not intended to determine if the SSTS was originally designed or installed to past or present MPCA or other Local Government Unit code requirements. This inspection is not intended to determine if the SSTS was designed and/or installed to support the anticipated flow from the building as the use of the building may have changed since the design and construction of the SSTS due to the addition of bedrooms, occupants, etc. In addition, this inspection is not intended to determine the quality of the original SSTS design, the quality of the construction practices used while installing the SSTS, or the quality of the materials used in constructing the SSTS.
- 6. Brian L. Humpal, Inc. cannot guarantee the performance of SSTS products/components such as: gravelless pipe, chamber trenches, effluent filters, tanks, sewage pre-treatment components, piping, etc. Products such as gravelless pipe are no longer approved for installation in the State of Minnesota and may have a significantly reduced performance and/or life expectancy.
- 7. WINTER WORK: By accepting this report, it is understood that inspections conducted during winter months (approximately November 1st through April 1st) are more difficult to perform because of possible snow cover and/or ground frost. SSTS components such as tanks, maintenance covers, tank inspection pipes, subsurface distribution medium inspection pipes, and soil treatment areas are more difficult or impossible to locate due to snow cover and/or ground frost. In addition, soil borings are more difficult to perform due to snow cover and/or ground frost. Brian L. Humpal, Inc. will attempt to use the same level of standards when performing work during winter periods as when performing work during non-winter periods. However, the recipient of this report understands that because of the aforementioned considerations, the same level of standards may not be possible.
- 8. By accepting this report, the client understands that Brian L. Humpal, Inc. will not be responsible for any monetary damages exceeding the fee for the services provided.

Sulbsurface Sewage Treatment Systems

Non-transferable



License # L2896

Maintainer License Expires:

Adv Inspector License Expires:

Oct 28, 2015 Dec 22, 2016 Dec 22, 2016 Dec 22, 2016 Dec 22, 2016

Adv Designer License Expires:

Date of Issuance:

Installer License Expires:

Certification

Inspect Minnesota, Midwest Soil Testing

Expires

10/15/2017 10/15/2017

Advanced Designer (Certified) Advanced Inspector (Certified)

Maintainer (Certified)

Certification Type

Designated Certified

Individual (DCI) Brian L. Humpal Brian L. Humpal Brian L. Humpal Brian L. Humpal Brian L. Humpal

10/15/2017

10/15/2017

10/15/2017

Service Provider (Certified)

Installer (Certified)

Designer (Certified) Inspector (Certified)

Christopher R. Uebe Christopher R. Uebe

03/04/2018

03/04/2018

Steven Giddings Manager Environmental Business Assistance Section



Minnesota Pollution Control Agency

520 Lafayette Road North St. Paul, Minnesota 55155-4194