# **Midwest Sewer Services**

P.O. Box 10853 White Bear L	Brian Humpal				
651-492-7550/Brian@Midwes	MPCA Licensed Advanced Inspector				
SUBSURFACE SEWAGE TR	M (SSTS) COMPLIANCE REPORT				
Date: 1/31/2022 & 2/1/2022	<b>Time:</b> 11:30 AM	Owner: Joe & Edie Brennan			
<b>Inspection Address:</b> 14946 15 <sup>th</sup>	Inspection Address: 14946 15 <sup>th</sup> St S, Afton, MN 55001				

#### **REPORT SUMMARY**

I have performed an "MPCA Compliance Inspection" on this septic system and have reviewed the original design/permit records, along with a previous compliance inspection from 2014, which were on file at Washington County. This very old system (installed in 1984) consists of a pre-cast septic tank and a rock trench drainfield. Additionally, there is a second system serving the basement that consists of a cesspool(s). It should be noted that the average life expectancy of a septic system is approximately 30 years. Pinky's Sewer Service pumped the septic tank on February 1, 2022.

At the time of our inspection, the manhole cover was broken. This manhole needs to be replaced as soon as possible. In addition, the manhole is buried. I recommend extending this cover to the ground surface to facilitate easier access and proper maintenance

Although not a compliance criteria, it should be noted that the well is located approximately 42 feet from the septic system; the required setback between the septic system and the well is 50 feet.

My inspection indicates that this system is presently an imminent threat to public health and safety in accordance with MPCA rules 7080.1500 Subp.4(A) because of the broken manhole and cesspool(s). The main system installed in 1984 presently meets MPCA minimum compliance inspection requirements.

In accordance with MPCA rules, I am sending a copy of this complete report to Washington County. I cannot officially speak on behalf of the County relative to the upgrade requirements of these non-compliant systems. Please contact the Washington County Department of Public Health & Environment (651-430-6655) to verify the County's position.

Please advise buyer, agents, lender, etc. to contact me should they have any questions regarding this system.

Christopher Uebe

Brian Humpal

Brian Humpal



520 Lafayette Road North St. Paul, MN 55155-4194

# Compliance inspection report form

Existing Subsurface Sewage Treatment System (SSTS)

Doc Type: Compliance and Enforcement

Instructions: Inspector must submit completed form to Local Governmental Unit (LGU) and system owner within 15 days of final determination of compliance or noncompliance. Instructions for filling out this form are located on the Minnesota Pollution Control Agency (MPCA) website at https://www.pca.state.mn.us/sites/default/files/wg-wwists4-31a.pdf.

2 of 10

Property information	Local tracking	number:	
Parcel ID# or Sec/Twp/Range:	Reason for Inspection	Property Transfer	
Local regulatory authority info: <u>Washington County</u>			
Property address: <u>14946</u> 15 <sup>th</sup> St S, Afton, MN 55001			
Owner/representative: Joe & Edie Brennan		Owner's phone: 651-775-7349	
Brief system description: A pre-cast septic tank and a rock tr	ench drainfield. A cesspool(s)	serves the basement.	

#### System status

System status on date (mm/dd/yyyy): 2/1/2022

Compliant – Certificate of compliance\*

(Valid for 3 years from report date unless evidence of an imminent threat to public health or safety requiring removal and abatement under section 145A.04. subdivision 8 is discovered or a shorter time frame exists in Local Ordinance.)

\*Note: Compliance indicates conformance with Minn. R. 7080.1500 as of system status date above and does not quarantee future performance.

#### Noncompliant – Notice of noncompliance

Systems failing to protect ground water must be upgraded, replaced, or use discontinued within the time required by local ordinance.

An imminent threat to public health and safety (ITPHS) must be upgraded, replaced, or its use discontinued within ten months of receipt of this notice or within a shorter period if required by local ordinance or under section 145A.04 subdivision 8.

#### Reason(s) for noncompliance (check all applicable)

□ Impact on public health (Compliance component #1) – Imminent threat to public health and safety

Tank integrity (Compliance component #2) – Failing to protect groundwater

Other Compliance Conditions (Compliance component #3) – Imminent threat to public health and safety

Other Compliance Conditions (Compliance component #3) – Failing to protect groundwater

System not abandoned according to Minn. R. 7080.2500 (Compliance component #3) - Failing to protect groundwater

Soil separation (Compliance component #5) – Failing to protect groundwater

Operating permit/monitoring plan requirements (Compliance component #4) – Noncompliant - local ordinance applies

#### Comments or recommendations

At the time of our inspection, the manhole cover was broken. This manhole needs to be replaced as soon as possible. In addition, the manhole is buried. I recommend extending this cover to the ground surface to facilitate easier access and proper maintenance. Although not a compliance criteria, it should be noted that the well is located approximately 42 feet from the septic system; the required setback between the septic system and the well is 50 feet.

## Certification

I hereby certify that all the necessary information has been gathered to determine the compliance status of this system. No determination of future system performance has been nor can be made due to unknown conditions during system construction, possible abuse of the system, inadequate maintenance, or future water usage.

By typing my name below, I certify the above statements to be true and correct, to the best of my knowledge, and that this information can be used for the purpose of processing this form.

Business name: Midwest Sewer Services Certification number: 5342/9852 Brian Humpal Hour Inspector signature: (This document has been electronically signed)

License number: L2896

Phone: 651-492-7550

## Necessary or locally required supporting documentation (must be attached)

Soil observation logs System/As-Built 🗌 Locally required forms 🖾 Tank Integrity Assessment Operating Permit Other information (list): Report Summary, Property Information, Disclaimer

Property Address:	14946 15 <sup>th</sup> St S, Afton, MN 55001
Business Name:	Midwest Sewer Services

Date: 2/1/2022

# 1. Impact on public health – Compliance component #1 of 5

Compliance criteria:		Attached supporting documentation:		
System discharges sewage to the ground surface	🗌 Yes* 🛛 No	Other: Not applicable		
System discharges sewage to drain tile or surface waters.	🗌 Yes* 🛛 No	_		
System causes sewage backup into dwelling or establishment.	🗌 Yes* 🛛 No			
Any "yes" answer above indicates imminent threat to public health ar				

#### Describe verification methods and results:

Although not a compliance criteria, it should be noted that the well is located approximately 42 feet from the septic system; the required setback between the septic system and the well is 50 feet.

## 2. Tank integrity – Compliance component #2 of 5

Compliance criteria:		Attached supporting doc	umentation:			
System consists of a seepage pit, 🛛 🖾 Yes* 🔲 No		Empty tank(s) viewed by inspector				
cesspool, drywell, leaching pit, or other pit?		Name of maintenance busi	Pinky's Sewer iness: <u>Service</u>			
Sewage tank(s) leak below their	🗌 Yes* 🔲 No	License number of mainter	nance business: L1673			
designed operating depth?		Date of maintenance:	2/1/2022			
		Existing tank integrity asse	essment (Attach)			
If yes, which sewage tank(s) leaks:	Laundry/Basement	Date of maintenance (mm/dd/yyyy): (i	must be within three years)			
Any "yes" answer above indicates the system is failing to protect groundwater.		(See form instructions to er Minn. R. 7082.0700 subp.	nsure assessment complies with 4 B (1))			
		Tank is Noncompliant (pum	nping not necessary – explain below)			
		Other:				

#### Describe verification methods and results:

At the time of our inspection, the manhole cover was broken. This manhole needs to be replaced as soon as possible. In addition, the manhole is buried. I recommend extending this cover to the ground surface to facilitate easier access and proper maintenance.

Property Address:	14946 15" St S, Afton, MN 55001
Business Name:	Midwest Sewer Services

th

Date: 2/1/2022

## 3. Other compliance conditions – Compliance component #3 of 5

	За.	Maintenance hole covers appear to be structurally unsound (damaged, cracked, etc.), or unsec	ured?
		⊠ Yes* □ No □ Unknown	
	3b.	Other issues (electrical hazards, etc.) to immediately and adversely impact public health or safety?	? 🗌 Yes* 🔲 No 🗌 Unknown
		*Yes to 3a or 3b - System is an imminent threat to public health and safety.	
	3c.	System is non-protective of ground water for other conditions as determined by inspector?	□ Yes* □ No
	3d.	System not abandoned in accordance with Minn. R. 7080.2500?	□ Yes* □ No
		*Yes to 3c or 3d - System is failing to protect groundwater.	
		Describe verification methods and results:	
		Attached supporting documentation:  Not applicable	
4.	Ор	erating permit and nitrogen BMP* – Compliance component #4 of	5 🛛 Not applicable
	Is th	e system operated under an Operating Permit?	"yes", A below is required
	Is th	e system required to employ a Nitrogen BMP specified in the system design?  Yes No If	"yes", B below is required
		BMP = Best Management Practice(s) specified in the system design	
	lf th	ne answer to both questions is "no", this section does not need to be completed.	
	Cor	npliance criteria:	
	а	. Have the operating permit requirements been met? ☐ Yes ☐ No	
	b	. Is the required nitrogen BMP in place and properly functioning?	

#### Any "no" answer indicates noncompliance.

Describe verification methods and results:

Attached supporting documentation: Operating permit (Attach)

5 of	10
------	----

Property Address:	14946 15" St S, Afton, MN 55001
Business Name:	Midwest Sewer Services

Date: 2/1/2022

# 5. Soil separation – Compliance component #5 of 5

Date of installation 1984 (mm/dd/yyyy)	Unknown			
Shoreland/Wellhead protection/Food beverage lodging? Compliance criteria (select one): 5a. For systems built prior to April 1, 1996, and not located in Shoreland or Wellhead	⊠ Yes □ No	Attached supporting documentation: Soil observation logs completed for the report Two previous verifications of required vertical separation Not applicable (No soil treatment area)		
Protection Area or not serving a food, beverage or lodging establishment: Drainfield has at least a two-foot vertical separation distance from periodically saturated soil or bedrock.		⊠ Review compliance Inspection from 2	014.	
<ul> <li>5b. Non-performance systems built April 1, 1996, or later or for non- performance systems located in Shoreland or Wellhead Protection Areas or serving a food, beverage, or lodging establishment:</li> <li>Drainfield has a three-foot vertical separation distance from periodically saturated soil or bedrock.*</li> </ul>	⊠ Yes □ No*	Indicate depths or elevations         A. Bottom of distribution media         B. Periodically saturated soil/bedrock         C. System separation         D. Required compliance separation*         *May be reduced up to 15 percent if allo Ordinance.	See Attached Boring Log(s) wed by Local	
<ul> <li>5c. "Experimental", "Other", or "Performance" systems built under pre-2008 Rules; Type IV or V systems built under 2008 Rules 7080. 2350 or 7080.2400 (Intermediate Inspector License required ≤ 2,500 gallons per day; Advanced Inspector License required &gt; 2,500 gallons per day)</li> <li>Drainfield meets the designed vertical separation distance from periodically saturated soil or bedrock.</li> </ul>	☐ Yes ☐ No*			

\*Any "no" answer above indicates the system is failing to protect groundwater.

Describe verification methods and results:


**Upgrade requirements:** (Minn. Stat. § 115.55) An imminent threat to public health and safety (ITPHS) must be upgraded, replaced, or its use discontinued within ten months of receipt of this notice or within a shorter period if required by local ordinance. If the system is failing to protect ground water, the system must be upgraded, replaced, or its use discontinued within the time required by local ordinance. If an existing system is not failing as defined in law, and has at least two feet of design soil separation, then the system need not be upgraded, replaced, or its use discontinued, notwithstanding any local ordinance that is more strict. This provision does not apply to systems in shoreland areas, Wellhead Protection Areas, or those used in connection with food, beverage, and lodging establishments as defined in law.

# <u>Midwest Šewer Testing</u> Subsurface Sewage Treatment System Owner/Property Information

This information will be used for the purpose of conducting an MPCA Compliance Inspection. Date of Inspection: 1/31/2022 & 2/1/2022 Time: 11:30 AM Property Address: 14946 15<sup>th</sup> St S, Afton, MN Zip: 55001 Property Owner: Joe & Edie Brennan Phone: 651-775-7349 Tank(s) Tank(s)Material Soil Treatment System Other Septic 1 Fiberglass Rock trench Alternative system Aerobic Plastic Gravelless trench Experimental system Lift Metal Chamber trench Cesspool system 1 Or More Holding Concrete Seepage bed Other system Other: Block Mound Other At-grade Are the tank maintenance covers accessible?  $\Box$  Yes  $\boxtimes$  No \*If no, proper maintenance must be performed through the maintenance holes. Maintenance hole covers should be made accessible to the ground surface to facilitate access and proper maintenance of the system. Year house built: 1901 Year septic installed: 1984 Tank size (gals.): 1250 How long has seller owned the property? Number of residents in home? Number of bedrooms? 2 Are all floors drained by gravity? Y Garbage disposal? N Whirlpool bath? N More than one system (laundry, etc.)? N Does this property have any footing drain tiles connected to the septic system? N Are any buildings on this property such as garages or out-buildings connected to this system? N Are there any additional systems on this property serving other buildings? N Location of septic system on lot? Main System - Northwest Side, Cesspool(s) - East Side? Location of water well on lot? Basement Is the well a deep well? Y Have you ever experienced any problems with the system such as: tree roots, sewage back-ups, surfacing of sewage onto the ground, septic tank overflowing, etc.; or have any repairs been made to the system? If yes, explain: When was the system last pumped? 2/1/2022Name of pumper: Pinky's Sewer Service Is system on a monitoring plan? How often pumped in previous years? Have you received notices from any government agency concerning this system? Is your property located in a shoreland management area? Y Do you have any additional information that should be given to the new owner?

I hereby certify that the above information is correct to the best of my knowledge. I also understand that if the system is considered "non-compliant/failing" per MPCA rules, that the inspector must by law submit a copy of this report to the local government unit within 15 days of the date of inspection completion. I also agree that unless otherwise noted in this report, that I/we are ultimately responsible for payment of all fees for all work performed relative to this inspection by Inspect Minnesota and Midwest Soil Testing

Owner/Occupant:

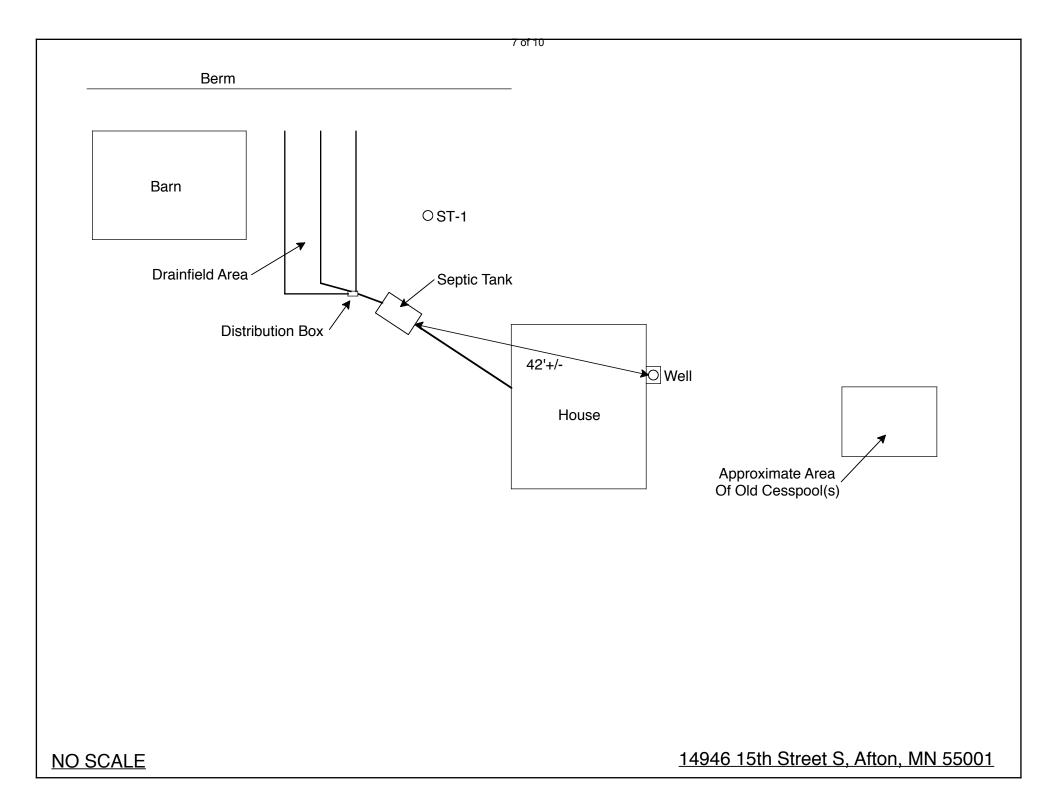

#### 8 of 10

# Soil Observations Log

Location of Project: 14946 15th St S, Afton, MN 55001							
Obs			Midwest Sewer Ser			Date:	1/31/2022
Cla	assifica	ation System:	USDA				
	Soil	Observation:	ST-1		Soil C	bservation:	
Surfa Elevatio Observa	on of	-	nd surface as last field trench	Surface Elevation of Observation			
Depth In Inches	Rock %	<u>Soils E</u>	ncountered	Depth In Inches	Rock %	<u>Soils</u>	Encountered
0-17 17-30 30-42 42-90	≤20	Wit 10YR 2/2 S Medium 7.5YR 4/4	ledium Sand (Fill) th Gravel andy Loam With Sand Layers 4 Medium Sand te To Medium Sand				
90" C	Depth T	o End Of Soil O	bservation Or Redox		Depth T	o End Of Soil	Observation Or Redox
Same E	Elevatio	n Of Observatio	n Relative To System		Elevatio	n Of Observat	ion Relative To System
-56" C	Depth T	o Bottom Of Dis	stribution Media	Depth To Bottom Of Distribution Media			
	Of Sepa				Of Sepa		
			0.5."				
		Observation At:	90"			servation At:	
		Conditions At:	None			onditions At:	
Standing Water Present At: None Standing Water Present At:							

Bottom Of Distribution Medium At: 56 Inches

Signature:

Other Ula

# Log Of Soil Borings

Location of Project: 14946 15th Street S, Afton, MN 55001					
Borings Made By: Inspect Minnesota					10/27/14
		Hand/Bucket	Classi	fication System:	USDA
B	oring Number:			, Boring Number:	
Surface Elevation of Boring	Same grour	nd surface as septic nspection pipe	Surface Elevation of Boring		
Depth In Inches	Soils E	ncountered	Depth In Inches	Soils En	countered
10-14	7.5YR 2.5/2 Lo 7.5YR 3/4 Loamy	ly Loam (Fil/Disturbed) oam (Fill/Disturbed) / Sand (Fill/Disturbed) ine Medium Sand			
100" De	epth To End Of B	oring Or Redox	[	Depth To End Of Bo	oring Or Redox
Same El	evation Of Borin	g Relative To System	Elevation Of Boring Relative To System		Relative To System
-56" De	epth To Bottom (	Of System		Depth To Bottom O	f System
	Separation			Of Separation	
		100		End Of Daving At	
	nd Of Boring At:			End Of Boring At:	
	edox Present At:	None	Redox Present At: Standing Water Present At:		
Standing Water Present At: None Standing Water Present At:					

Bottom Of Distribution Medium At: 56 Inches

# **DISCLAIMER**

#### Brian L. Humpal, Inc. dba. Midwest Sewer Services, Inspect Minnesota, Midwest Soil Testing Relative to Subsurface Sewage Treatment System (SSTS) Compliance Inspections

- 1. This inspection/report is being performed for only the seller/owner of the property on which the SSTS is located. In such case that another party is paying for the inspection, the contract is between only said party and Brian L. Humpal, Inc.; there is no contract between Brian L. Humpal, Inc. and any other party unless otherwise noted.
- 3. Brian L. Humpal, Inc. has not been retained to warranty, guarantee, or certify the proper functioning of the SSTS for any period of time beyond the date of inspection or into the future. Because of the numerous factors (usage, maintenance, soil characteristics, previous failures, etc.) which may affect the proper operation of an SSTS, as well as the inability of Brian L. Humpal, Inc. to supervise or monitor the use or maintenance of the SSTS, the report shall not be construed as a warranty by Brian L. Humpal, Inc. that the SSTS will function properly for any particular party for any period of time.
- 4. Brian L. Humpal, Inc. is unable to verify the frequency and/or, quality of prior or future maintenance of the SSTS. Maintenance of the tank(s) must be performed through the tanks maintenance hole. The removal of solids from any location other than the maintenance hole is not a compliant method of maintenance. It is strongly recommended that maintenance covers be made accessible to the ground surface to facilitate proper maintenance.
- 5. Minimum Compliance Inspection requirements relative to this inspection and this report include <u>only</u> verification that the SSTS has tank(s) (septic tanks, lift tanks, dosing tanks, stilling tanks, etc.) which are watertight below the designed operating depth, the required separation between the bottom of the subsurface soil distribution medium and seasonally saturated soils, no back-ups of sewage into the dwelling, no discharge of sewage/effluent to the ground surface or surface waters, and no imminent safety hazards. Brian L. Humpal, Inc. does not inspect plumbing or pumps prior to the first SSTS component as these are plumbing components. The performance of exterior pumps and associated components are not inspected as they are considered to be maintenance items. Additionally, no indications relative to compliance with electrical code requirements have been made. It is recommended that any other applicable plumbing, electrical, housing, etc. inspections be performed by a qualified inspection business. Sewage back-up verification is limited to observing the floor drain area and/or the information supplied by the last occupants of the building prior to inspection. Brian L. Humpal, Inc. cannot guarantee that the information given to them by the last occupants of the building prior to inspection relative to back-ups is accurate.
- 4. Certification of this SSTS does not warranty future use beyond the date of the inspection. Any SSTS, old or new, can become hydraulically overloaded or discharge sewage/effluent to the ground surface as a result of more people moving into the house than were previously occupying the house, improper maintenance, heavy usage, leaking plumbing fixtures, groundwater infiltration, tree roots, freezing conditions, surface drainage problems, poor initial design, poor construction practices, or unsuitable materials used in constructing the system; the system can also simply stop working because of its age. An SSTS that has been properly designed and installed, properly maintained, and used in the manner for which the system was designed can be expected to provide service for twenty to twenty-five years on average. Some parts of the SSTS such as alarms, switches, pumps, filters, etc. will most likely have to be repaired or replaced over the lifetime of the system.
- 5. A Compliance Inspection is not meant to be a test or inspection for longevity of the system; a Compliance Inspection is strictly for the purpose of determining if the SSTS is protective of public health and safety, as well as the groundwater at the date and time the inspection was performed. This inspection is not intended to determine if the SSTS was originally designed or installed to past or present MPCA or other Local Government Unit code requirements. This inspection is not intended to determine if the SSTS was designed and/or installed to support the anticipated flow from the building as the use of the building may have changed since the design and construction of the SSTS due to the addition of bedrooms, occupants, etc. In addition, this inspection is not intended to determine the quality of the original SSTS design, the quality of the construction practices used while installing the SSTS, or the quality of the materials used in constructing the SSTS.
- 6. Brian L. Humpal, Inc. cannot guarantee the performance of SSTS products/components such as: gravelless pipe, chamber trenches, effluent filters, tanks, sewage pre-treatment components, piping, etc. Products such as gravelless pipe are no longer approved for installation in the State of Minnesota and may have a significantly reduced performance and/or life expectancy.
- 7. WINTER WORK: By accepting this report, it is understood that inspections conducted during winter months (approximately November 1<sup>st</sup> through April 1<sup>st</sup>) are more difficult to perform because of possible snow cover and/or ground frost. SSTS components such as tanks, maintenance covers, tank inspection pipes, subsurface distribution medium inspection pipes, and soil treatment areas are more difficult or impossible to locate due to snow cover and/or ground frost. In addition, soil borings are more difficult to perform due to snow cover and/or ground frost. Brian L. Humpal, Inc. will attempt to use the same level of standards when performing work during winter periods as when performing work during non-winter periods. However, the recipient of this report understands that because of the aforementioned considerations, the same level of standards may not be possible.
- 8. By accepting this report, the client understands that Brian L. Humpal, Inc. will not be responsible for any monetary damages exceeding the fee for the services provided.