Midwest Sewer Services

| P.O. Box 10853 White Bear Lake, | MN 55110 | Brian Humpal | |
|---|-----------------------|----------------------------------|--|
| 651-492-7550/Brian@Midwestsoil | testing.com MPCA | MPCA Licensed Advanced Inspector | |
| SUBSURFACE SEWAGE TREA | TMENT SYSTEM (SSTS) | COMPLIANCE REPORT | |
| Date: 11/14/2022 & 11/16/2022 | Time: 10:15 AM | Owner: David Reed | |
| Inspection Address: 10810 121 st St N | N, May Twp, MN 55082 | | |

REPORT SUMMARY

I have performed an "MPCA Compliance Inspection" on this system and have reviewed the original design/permit records, along with a previous compliance inspection from 2013, which were on file at Washington County. This system consists of two pre-cast septic tanks, a pre-cast lift tank, and a rock trench drainfield. Pinky's Sewer Service pumped the septic tank on November 16, 2022. This house is presently vacant.

Predicated on my inspection of the system and my review of the records, it is my opinion that this system <u>presently meets</u> MPCA minimum compliance inspection requirements.

Midwest Sewer Services have been hired to perform a compliance inspection of this SSTS for compliance with local ordinances pursuant to Minn. Stat. § 115.55 (2013). This compliance inspection covers only the criteria required by Minn. Stat. § 115.55 Subd. 5a (2013) and Minn. R. 7080.1500 (2011). A compliance inspection is an indication of the current compliance status of the system and does not guarantee the performance or longevity of this system beyond the date of inspection, as it is impossible to determine the future performance of any system. Midwest Sewer Services disclaim any use of this compliance inspection beyond determining SSTS compliance pursuant to Minn. Stat. § 115.55 Subd. 5a (2013) and Minn. R. 7080.1500 (2011).

Please contact me should you have any questions.

Christopher Uebe

Brian Humpal

Brian Humpal



520 Lafayette Road North St. Paul, MN 55155-4194

Compliance inspection report form

Existing Subsurface Sewage Treatment System (SSTS)

Doc Type: Compliance and Enforcement

Instructions: Inspector must submit completed form to Local Governmental Unit (LGU) and system owner within 15 days of final determination of compliance or noncompliance. Instructions for filling out this form are located on the Minnesota Pollution Control Agency (MPCA) website at https://www.pca.state.mn.us/sites/default/files/wq-wwists4-31a.pdf.

| Property information | Local tracking number: | | |
|---|------------------------|-----------------------------|--|
| Parcel ID# or Sec/Twp/Range: | Reason for Inspection | Property Transfer | |
| Local regulatory authority info: Washington County | | | |
| Property address: 10810 121 st St N, May Twp, MN 55082 | | | |
| Owner/representative: David Reed | | Owner's phone: 651-230-0251 | |

Brief system description: Two pre-cast septic tanks, a pre-cast lift tank, and a rock trench drainfield.

System status

System status on date (mm/dd/yyyy): 11/16/2022

Compliant – Certificate of compliance*

(Valid for 3 years from report date unless evidence of an imminent threat to public health or safety requiring removal and abatement under section 145A.04, subdivision 8 is discovered or a shorter time frame exists in Local Ordinance.)

*Note: Compliance indicates conformance with Minn. R. 7080.1500 as of system status date above and does not guarantee future performance.

□ Noncompliant – Notice of noncompliance

Systems failing to protect ground water must be upgraded, replaced, or use discontinued within the time required by local ordinance.

An imminent threat to public health and safety (ITPHS) must be upgraded, replaced, or its use discontinued within ten months of receipt of this notice or within a shorter period if required by local ordinance or under section 145A.04 subdivision 8.

Reason(s) for noncompliance (check all applicable)

Impact on public health (Compliance component #1) – Imminent threat to public health and safety

Tank integrity (Compliance component #2) – Failing to protect groundwater

Other Compliance Conditions (Compliance component #3) – Imminent threat to public health and safety

Other Compliance Conditions (Compliance component #3) – Failing to protect groundwater

System not abandoned according to Minn. R. 7080.2500 (Compliance component #3) – Failing to protect groundwater

Soil separation (Compliance component #5) – *Failing to protect groundwater*

Operating permit/monitoring plan requirements (Compliance component #4) – Noncompliant - local ordinance applies

Comments or recommendations

Certification

I hereby certify that all the necessary information has been gathered to determine the compliance status of this system. No determination of future system performance has been nor can be made due to unknown conditions during system construction, possible abuse of the system, inadequate maintenance, or future water usage.

By typing my name below, I certify the above statements to be true and correct, to the best of my knowledge, and that this information can be used for the purpose of processing this form.

Business name: Midwest Sewer Services

Brian Humpal Hoter Ul

Certification number: 5342/9852

Inspector signature:

| nt has been electronicall | y signed) |
|---------------------------|-----------|
|---------------------------|-----------|

License number: L2896

Phone: 651-492-7550

Necessary or locally required supporting documentation (must be attached)

Soil observation logs System/As-Built Locally required forms Tank Integrity Assessment Operating Permit Other information (list): Report Summary, Property Information, Disclaimer

https://www.pca.state.mn.us • 651-296-6300 • 800-657-3864 • Use your preferred relay service • Available in alternative formats wq-wwists4-31b • 4/28/2021 Page 1 of 4

| Property Address: 10810 121 st St N, May Twp, MN 55082 |
|---|
|---|

Business Name: Midwest Sewer Services

Date: 11/16/2022

1. Impact on public health – Compliance component #1 of 5

| Compliance criteria: | | Attached supporting documentation: | |
|---|-------------|------------------------------------|--|
| System discharges sewage to the ground surface | 🗌 Yes* 🛛 No | Other: Not applicable | |
| System discharges sewage to drain tile or surface waters. | 🗌 Yes* 🛛 No | | |
| System causes sewage backup into dwelling or establishment. | 🗌 Yes* 🛛 No | | |
| Any "yes" answer above indicates imminent threat to public health an | | | |
| Describe verification methods and | results: | | |

None of the above found.

2. Tank integrity – Compliance component #2 of 5

| Compliance criteria: | | Attached supporting de | ocumentation: | |
|---|-------------|---|---------------------|--------------------------|
| System consists of a seepage pit, | 🗌 Yes* 🛛 No | Empty tank(s) viewed by | y inspector | |
| cesspool, drywell, leaching pit, or other pit? | | _ Name of maintenance business: | | Pinky's Sewer Service |
| Sewage tank(s) leak below their | 🗌 Yes* 🛛 No | License number of main | tenance business | : <u>L1673</u> |
| designed operating depth? | | Date of maintenance: | | 11/16/2022 |
| | | Existing tank integrity as | ssessment (Attach |) |
| | | Date of maintenance | | |
| If yes, which sewage tank(s) leaks: | | (mm/dd/yyyy): | (must be within | three years) |
| Any "yes" answer above indic is failing to protect groundwat | • | (See form instructions to Minn. R. 7082.0700 sub | | ent complies with |
| | | Tank is Noncompliant (p | oumping not necessa | ary – explain below) |
| | | Other: | | |
| Describe verification methods and | d results: | | | |

Property Address: 10810 121st St N, May Twp, MN 55082

Business Name: Midwest Sewer Services

Date: 11/16/2022

3. Other compliance conditions - Compliance component #3 of 5

| | Is th | e system operated under an Operating Permit? | ∃Yes □No Ⅰ | f "ves". A | below is required |
|----|-------|--|-------------------|-----------------|-------------------|
| 4. | Ор | erating permit and nitrogen BMP* – Compliance comp | onent #4 o | f5 ⊠ № | lot applicable |
| | | Attached supporting documentation: 🛛 Not applicable | | | |
| | | | | | |
| | | | | | |
| | | | | | |
| | | | | | |
| | | | | | |
| | | | | | |
| | | Describe verification methods and results: | | | |
| | 00. | *Yes to 3c or 3d - System is failing to protect groundwater. | | | |
| | | System not abandoned in accordance with Minn. R. 7080.2500? | y mopector : | □ res □ Yes* | |
| | 20 | *Yes to 3a or 3b - System is an imminent threat to public health and safe System is non-protective of ground water for other conditions as determined b | | □ Yes* | |
| | 3b. | Other issues (electrical hazards, etc.) to immediately and adversely impact public | | y? ∐ Yes* | 🖾 No 📋 Unknown |
| | | □ Yes* ⊠ No □ Unknown | | | |
| | За. | Maintenance hole covers appear to be structurally unsound (damaged, cracke | d, etc.), or unse | cured? | |

| Is the system required to employ a Nitrogen BMP specified in the system design? Yes No | If "yes", B below is required |
|---|-------------------------------|
| BMP = Best Management Practice(s) specified in the system design | |

If the answer to both questions is "no", this section does not need to be completed.

Compliance criteria:

a. Have the operating permit requirements been met?

b. Is the required nitrogen BMP in place and properly functioning? \Box Yes \Box No

Any "no" answer indicates noncompliance.

Describe verification methods and results:

Attached supporting documentation: Operating permit (Attach)

Business Name: Midwest Sewer Services

Date: 11/16/2022

5. Soil separation – Compliance component #5 of 5

| Date of installation 2002 (mm/dd/yyyy) | Unknown | | |
|---|---------------|---|---|
| Shoreland/Wellhead protection/Food beverage lodging? Compliance criteria (select one): 5a. For systems built prior to April 1, 1996, and not located in Shoreland or Wellhead Protection Area or not serving a food, beverage or lodging establishment: Drainfield has at least a two-foot vertical separation distance from periodically saturated soil or bedrock. | ☐ Yes ⊠ No | Attached supporting documentation: Soil observation logs completed for th Two previous verifications of required Not applicable (No soil treatment area Reviewed previous compliance insperies Reviewed design and permit records. | vertical separation a) ction from 2013. |
| 5b. Non-performance systems built April 1, 1996, or later or for non- performance systems located in Shoreland or Wellhead Protection Areas or serving a food, beverage, or lodging establishment: Drainfield has a three-foot vertical separation distance from periodically saturated soil or bedrock.* | ⊠ Yes □ No* | Indicate depths or elevations A. Bottom of distribution media B. Periodically saturated soil/bedrock C. System separation D. Required compliance separation* *May be reduced up to 15 percent if allo Ordinance. | See Attached Boring Log(s) |
| 5c. "Experimental", "Other", or "Performance" systems built under pre-2008 Rules; Type IV or V systems built under 2008 Rules 7080. 2350 or 7080.2400 (Intermediate Inspector License required ≤ 2,500 gallons per day; Advanced Inspector License required > 2,500 gallons per day) Drainfield meets the designed vertical separation distance from periodically saturated soil or bedrock. | ☐ Yes ☐ No* | | |

*Any "no" answer above indicates the system is failing to protect groundwater.

Describe verification methods and results:


Upgrade requirements: (Minn. Stat. § 115.55) An imminent threat to public health and safety (ITPHS) must be upgraded, replaced, or its use discontinued within ten months of receipt of this notice or within a shorter period if required by local ordinance. If the system is failing to protect ground water, the system must be upgraded, replaced, or its use discontinued within the time required by local ordinance. If an existing system is not failing as defined in law, and has at least two feet of design soil separation, then the system need not be upgraded, replaced, or its use discontinued, notwithstanding any local ordinance that is more strict. This provision does not apply to systems in shoreland areas, Wellhead Protection Areas, or those used in connection with food, beverage, and lodging establishments as defined in law.

<u>Midwest Sewer Testing</u> Subsurface Sewage Treatment System Owner/Property Information

| This information will be used for the purpose of conducting an MPCA Compliance Inspection. | | | | | |
|---|---|--|--|--|--|
| Date of Inspection: 11/14/2022 & 11/16/2022 | Time: 10:15 AM | | | | |
| Property Address: 10810 121 st St N, May Twp, MN | Zip: 55082 | | | | |
| Property Owner: David Reed | Phone: 651-230-0251 | | | | |
| Tank(s) Tank(s)Material Soil Treatment System Septic 2 Fiberglass Rock trench Aerobic Plastic Gravelless trench XLift Metal Chamber trench Holding Concrete Seepage bed Other: Block Mound Other Other At-grade | Other Alternative system Experimental system Cesspool system Other system | | | | |
| Are the tank maintenance covers accessible? \square Yes \square No *If | | | | | |
| performed through the maintenance holes. Maintenance hole cover | | | | | |
| the ground surface to facilitate access and proper maintenance of t | he system. | | | | |
| Year house built: 2002 Year septic installed: 2002 | Tank size (gals.): 1-1500, 1-1000 | | | | |
| | sidents in home? | | | | |
| Number of bedrooms?5Are all floors drained by g | ravity? Y | | | | |
| Garbage disposal? Y Whirlpool bath? | N | | | | |
| More than one system (laundry, etc.)? N | | | | | |
| Does this property have any footing drain tiles connected to the se | ptic system? | | | | |
| Are any buildings on this property such as garages or out-buildings connected to this system? | | | | | |
| Are there any additional systems on this property serving other bu | ildings? | | | | |
| Location of septic system on lot? South Side | | | | | |
| Location of water well on lot? Is the well a deep well? Y | | | | | |
| Have you ever experienced any problems with the system such as: tree roots, sewage back-ups, | | | | | |
| surfacing of sewage onto the ground, septic tank overflowing, etc.; or have any repairs been made | | | | | |
| to the system? If yes, explain: | | | | | |
| When was the system last pumped? 11/16/2022Name of pumper: Pinky's Sewer Service | | | | | |
| How often pumped in previous years?Is system on a monitoring plan? | | | | | |
| Have you received notices from any government agency concerning this system? | | | | | |
| Is your property located in a shoreland management area? N | 2 | | | | |
| Do you have any additional information that should be given to the new owner? | | | | | |

I hereby certify that the above information is correct to the best of my knowledge. I also understand that if the system is considered "non-compliant/failing" per MPCA rules, that the inspector must by law submit a copy of this report to the local government unit within 15 days of the date of inspection completion. I also agree that unless otherwise noted in this report, that I/we are ultimately responsible for payment of all fees for all work performed relative to this inspection by Inspect Minnesota and Midwest Soil Testing

Owner/Occupant:

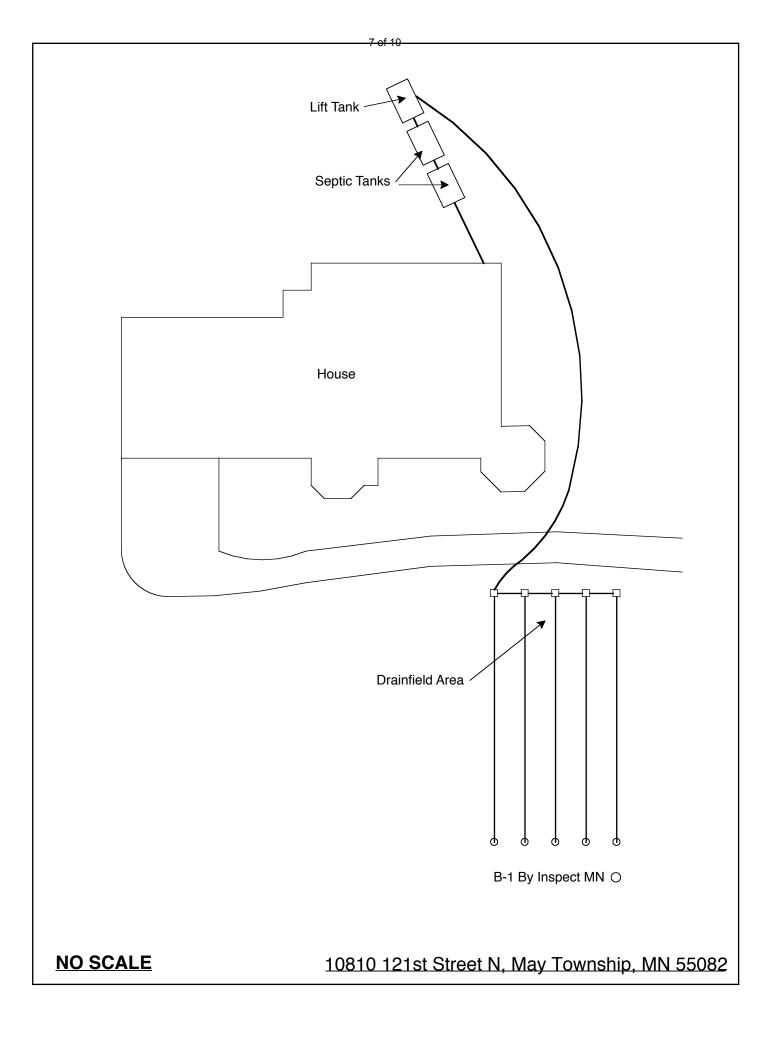

Log Of Soil Borings

| Location of Project: 110810 121st Street N, May Township, MN 55082 Borings Made By: Inspect Minnesota Date: 9/12/13 Auger Used: Hand/Bucket Classification System: USDA Boring Number: 1 Boring Number: Surface Elevation of Boring Same ground surface as inspection pipe at end of last drainfield trench Boring Surface Elevation of Boring Depth In Inches Soils Encountered Depth In Inches Soils Encountered Depth In Inches 16 - 28 10YR 2/2 Loam (Very Dry) 16-28 10YR 3/4 Loam (Very Dry) Same Same Same Same Same Same Same Same | | | | | | |
|--|------------------------|---|--|--|------------------|----------------|
| Auger Used: Hand/Bucket Classification System: USDA Surface Elevation of Boring Same ground surface as inspection pipe at end of last drainfield trench Boring Surface Elevation of Boring Surface Elevation of Boring Surface Elevation of Boring Depth In Inches Soils Encountered Depth In Inches Soils Encountered Depth In Inches Soils Encountered 0-8 10YR 2/2 Loam (Very Dry) 54-76 7.5YR 2.5/3 Loam (Very Dry) Soils Encountered Depth In Inches Soils Encountered 3-6 7.5YR 3/4 Loam (Very Dry) 7.5YR 4/4 Loamy Sand Soils Encountered Soils Encountered 54-76 10YR 5/4 Fine Sand With 7.5YR 4/4 Lamellae Bands 7.5YR 4/4 Lamellae Bands Soils Encountered 76" Depth To End Of Boring Or Redox Depth To End Of Boring Or Redox Elevation Of Boring Relative To System 54-76 Depth To End Of Boring Or Redox Elevation Of Boring Relative To System Elevation Of Boring Relative To System 76" Depth To Bottom Of System Depth To Bottom Of System System -29" Depth To Bottom Of System Depth To Bottom Of System Of Separation -29" Depth To B | | | | i, May Tow | | |
| Boring Number: 1 Boring Number: Surface Elevation of Boring Same ground surface as inspection pipe at end of last drainfield trench Boring Surface Elevation of Boring Surface Elevation of Boring Depth In Inches Soils Encountered 10YR 3/2 Loam (Very Dry) Depth In Inches Soils Encountered 0-8 10YR 3/4 Loam (Very Dry) 7.SYR 4/4 Loam (Very Dry) Inches Soils Encountered 16-28 10YR 5/4 Fine Sand With 7.SYR 4/4 Lamellae Bands 7.SYR 4/4 Lamellae Bands Depth To End Of Boring Or Redox 76" Depth To End Of Boring Or Redox Depth To End Of Boring Or Redox Depth To End Of Boring Or Redox Same Elevation Of Boring Relative To System Elevation Of Boring Relative To System Elevation Of System -29" Depth To Bottom Of System Depth To Bottom Of System Of Separation -29" To Boting At: 76" End Of Boring At: 76" | | | | | | |
| Surface Elevation of Boring Same ground surface as inspection pipe at end of last drainfield trench Depth In Inches Suils Encountered Burface Elevation of Boring 0-8 10YR 2/2 Loam (Very Dry) Soils Encountered Soils Encountered 0-8 10YR 3/2 Loam (Very Dry) Soils Encountered Soils Encountered 16-28 10YR 3/4 Loam (Very Dry) 7.5YR 4/4 Loamy Sand Soils Encountered 54-76 10YR 5/4 Fine Sand With 7.5YR 4/4 Lamellae Bands 7.5YR 4/4 Lamellae Bands Depth To End Of Boring Or Redox 28-54 54-76 Elevation of Boring Or Redox Depth To End Of Boring Or Redox 54-76 Depth To End Of Boring Or Redox Elevation Of Boring Relative To System 28-54 54-76 Depth To End Of Boring Relative To System 76" Depth To Bottom Of System Depth To Bottom Of System -29" Depth To Bottom Of System Depth To Bottom Of System >47" Of Separation Of Separation | | | | Classi | | USDA |
| Elevation of Boring Same ground surface as inspection pipe at end of last drainfield trench pipe at end of last drainfield trench inches Elevation of Boring Depth In Inches Soils Encountered Depth In Inches Soils Encountered 0-8 10YR 2/2 Loam (Very Dry) IoYR 3/4 Loam (Very Dry) IoYR 3/4 Loam (Very Dry) 16-28 10YR 3/4 Loam (Very Dry) IoYR 3/4 Loam (Very Dry) IoYR 5/4 Fine Sand With 54-76 10YR 5/4 Fine Sand With 7.5YR 4/4 Lamellae Bands IoYR 5/4 Fine Sand With 7.5YR 4/4 Lamellae Bands 7.5YR 4/4 Lamellae Bands IoYR 5/4 Fine Sand With IoYR 5/4 Fine Sand With 7.5YR 4/4 Lamellae Bands IoYR 5/4 Fine Sand With IoYR 5/4 Fine Sand With IoYR 5/4 Fine Sand With 7.5YR 4/4 Lamellae Bands IoYR 5/4 Fine Sand With IoYR 5/4 Fine Sand With IoYR 5/4 Fine Sand With 7.5YR 4/4 Lamellae Bands IoYR 5/4 Fine Sand With IoYR 5/4 Fine Sand With IoYR 5/4 Fine Sand With 7.5YR 4/4 Lamellae Bands IoYR 5/4 Fine Sand With IoYR 5/4 Fine Sand With IoYR 5/4 Fine Sand With 7.5YR 4/4 Lamellae Bands IoYR 5/4 Fine Sand With IoYR 5/4 Fine Sand With IoYR 5/4 Fine Sand With 76" Depth To End Of Boring Relative To System Elevation Of Boring Relative To System | | oring Number: | 1 | | Boring Number: | |
| Elevation of Boring pipe at end of last drainfield trench Boring Boring Depth In Inches Soils Encountered Depth In Inches Soils Encountered 0-8 10YR 2/2 Loam (Very Dry) Free Sandow (Very Dry) Soils Encountered 16-28 10YR 3/4 Loam (Very Dry) Free Sandow (Very Dry) Soils Encountered 28-54 7.5YR 4/4 Loamy Sand Free Sandow (Very Dry) Soils Encountered 54-76 10YR 5/4 Fine Sand With 7.5YR 4/4 Lameliae Bands Soils Encountered 7.5'' Depth To End Of Boring Or Redox Depth To End Of Boring Or Redox Same Elevation Of Boring Relative To System Elevation Of Boring Relative To System -29'' Depth To End Of System Depth To Bottom Of System ≥47''' Of Separation Of Separation | | Same ground | surface as inspection | | | |
| Borning Product Borning Depth In Inches Soils Encountered Depth In Inches Soils Encountered 0-8 10YR 2/2 Loam (Very Dry) Inches Soils Encountered 8-16 7.5YR 2.5/3 Loam (Very Dry) Inches Soils Encountered 16-28 10YR 3/4 Loam (Very Dry) Inches Soils Encountered 28-54 7.5YR 4/4 Loamy Sand Soils Encountered Soils Encountered 54-76 10YR 5/4 Fine Sand With 7.5YR 4/4 Lamellae Bands Soils Encountered 76" Depth To End Of Boring Or Redox Depth To End Of Boring Or Redox Same Elevation Of Boring Relative To System Elevation Of Boring Relative To System -29" Depth To Bottom Of System Depth To Bottom Of System ≥47" Of Separation Of Separation | | - | - | | of | |
| Inches Soils Encountered Inches Soils Encountered 0-8 10YR 2/2 Loam (Very Dry) 16 7.5YR 2.5/3 Loam (Very Dry) 8-16 7.5YR 4/4 Loams (Very Dry) 16-28 10YR 5/4 Fine Sand With 54-76 10YR 5/4 Fine Sand With 7.5YR 4/4 Lamellae Bands 16 7.5YR 4/4 Lamellae Bands 7.5YR 4/4 Lamellae Bands 10YR 5/4 Fine Sand With 7.5YR 4/4 Lamellae Bands 7.5YR 4/4 Lamellae Bands 10YR 5/4 Fine Sand With 7.5YR 4/4 Lamellae Bands 10YR 5/4 Fine Sand With 10YR 5/4 Fine Sand With 7.5YR 4/4 Lamellae Bands 10YR 5/4 Fine Sand With 10YR 5/4 Fine Sand With 7.5YR 4/4 Lamellae Bands 10YR 5/4 Fine Sand With 10YR 5/4 Fine Sand With 7.5YR 4/4 Lamellae Bands 10YR 5/4 Fine Sand With 10YR 5/4 Fine Sand With 7.5YR 4/4 Lamellae Bands 10YR 5/4 Fine Sand With 10YR 5/4 Fine Sand With 7.5YR 4/4 Lamellae Bands 10YR 5/4 Fine Sand With 10YR 5/4 Fine Sand With 7.5YR 4/4 Lamellae Bands 10YR 5/4 Fine Sand With 10YR 5/4 Fine Sand With 7.5YR 4/4 Lamellae Bands 10YR 5/4 Fine Sand With 10YR 5/4 Fine Sand With 7.5YR 4/4 La | | | | | | |
| Incres Incres 0-8 10YR 2/2 Loam (Very Dry) 8-16 7.5YR 2.5/3 Loam (Very Dry) 16-28 10YR 3/4 Loamy Sand 54-76 10YR 5/4 Fine Sand With 7.5YR 4/4 Lamellae Bands 7.5YR 4/4 Lamellae Bands 76" Depth To End Of Boring Or Redox Same Elevation Of Boring Relative To System -29" Depth To Bottom Of System -29" Depth To Bottom Of System ≥47" Of Separation Of Separation Of Separation End Of Boring At: 76" End Of Boring At: None Redox Present At: None | | Soils E | ncountered | | Soils En | countered |
| 8-16 7.5YR 2.5/3 Loam (Very Dry) 16-28 10YR 3/4 Loamy Sand 28-54 7.5YR 4/4 Loamy Sand 54-76 10YR 5/4 Fine Sand With 7.5YR 4/4 Lamellae Bands 7.5YR 4/4 Lamellae Bands 76" Depth To End Of Boring Or Redox Same Elevation Of Boring Relative To System -29" Depth To Bottom Of System -29" Depth To Bottom Of System >47" Of Separation Of Separation Of Separation End Of Boring At: 76" | | | | Inches | | |
| Same Elevation Of Boring Relative To System Elevation Of Boring Relative To System -29" Depth To Bottom Of System Depth To Bottom Of System ≥47" Of Separation Of Separation End Of Boring At: 76" End Of Boring At: Redox Present At: None Redox Present At: | 8-16 16-28 28-54 | 7.5YR 2.5/3 10YR 3/4 L 7.5YR 4/ 10YR 5/4 | Loam (Very Dry) Loam (Very Dry) 4 Loamy Sand Fine Sand With | | | |
| -29" Depth To Bottom Of System Depth To Bottom Of System ≥47" Of Separation Of Separation End Of Boring At: 76" End Of Boring At: Redox Present At: None Redox Present At: | 76" De | epth To End Of B | oring Or Redox | Redox Depth To End Of Boring Or Redox | | oring Or Redox |
| ≥47" Of Separation End Of Boring At: 76" End Of Boring At: 76" Redox Present At: None | | | | Elevation Of Boring Relative To System | | • |
| End Of Boring At: 76" End Of Boring At: Redox Present At: None Redox Present At: | | | | | f System | |
| Redox Present At: None Redox Present At: | ≥47" 01 | Separation | | (| Of Separation | |
| Redox Present At: None Redox Present At: | | nd Of Boring At. | 76" | | End Of Boring At | |
| | | | | | | |
| | | | | | | |

Bottom Of Distribution Medium At: 29 Inches


JOB (DRY ARKELL PARCEL A, WITHROW HILLS 1215 ST., MAY TWSP.

DATE 6-27-02

BORING LOG 9 of 10

NORTH LOT

BOREHOLE DIAMETER 4-3%" HAND BUGER

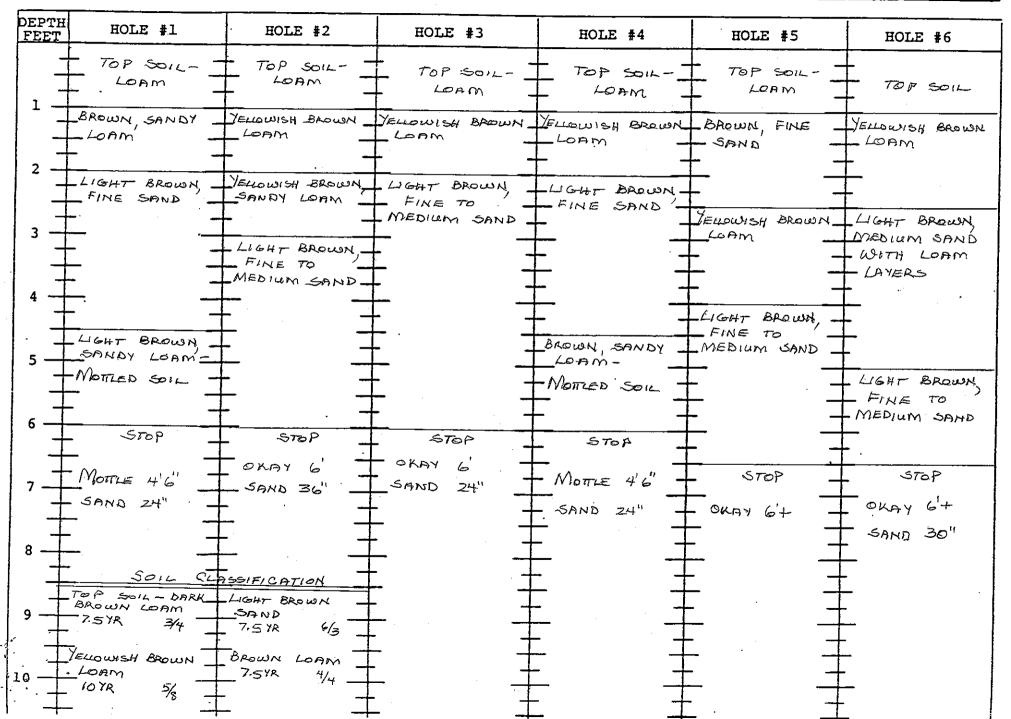

DISCLAIMER

Brian L. Humpal, Inc. dba. Midwest Sewer Services, Inspect Minnesota, Midwest Soil Testing Relative to Subsurface Sewage Treatment System (SSTS) Compliance Inspections

- 1. This inspection/report is being performed for only the seller/owner of the property on which the SSTS is located. In such case that another party is paying for the inspection, the contract is between only said party and Brian L. Humpal, Inc.; there is no contract between Brian L. Humpal, Inc. and any other party unless otherwise noted.
- 3. Brian L. Humpal, Inc. has not been retained to warranty, guarantee, or certify the proper functioning of the SSTS for any period of time beyond the date of inspection or into the future. Because of the numerous factors (usage, maintenance, soil characteristics, previous failures, etc.) which may affect the proper operation of an SSTS, as well as the inability of Brian L. Humpal, Inc. to supervise or monitor the use or maintenance of the SSTS, the report shall not be construed as a warranty by Brian L. Humpal, Inc. that the SSTS will function properly for any particular party for any period of time.
- 4. Brian L. Humpal, Inc. is unable to verify the frequency and/or, quality of prior or future maintenance of the SSTS. Maintenance of the tank(s) must be performed through the tanks maintenance hole. The removal of solids from any location other than the maintenance hole is not a compliant method of maintenance. It is strongly recommended that maintenance covers be made accessible to the ground surface to facilitate proper maintenance.
- 5. Minimum Compliance Inspection requirements relative to this inspection and this report include <u>only</u> verification that the SSTS has tank(s) (septic tanks, lift tanks, dosing tanks, stilling tanks, etc.) which are watertight below the designed operating depth, the required separation between the bottom of the subsurface soil distribution medium and seasonally saturated soils, no back-ups of sewage into the dwelling, no discharge of sewage/effluent to the ground surface or surface waters, and no imminent safety hazards. Brian L. Humpal, Inc. does not inspect plumbing or pumps prior to the first SSTS component as these are plumbing components. The performance of exterior pumps and associated components are not inspected as they are considered to be maintenance items. Additionally, no indications relative to compliance with electrical code requirements have been made. It is recommended that any other applicable plumbing, electrical, housing, etc. inspections be performed by a qualified inspection business. Sewage back-up verification is limited to observing the floor drain area and/or the information supplied by the last occupants of the building prior to inspection. Brian L. Humpal, Inc. cannot guarantee that the information given to them by the last occupants of the building prior to inspection relative to back-ups is accurate.
- 4. Certification of this SSTS does not warranty future use beyond the date of the inspection. Any SSTS, old or new, can become hydraulically overloaded or discharge sewage/effluent to the ground surface as a result of more people moving into the house than were previously occupying the house, improper maintenance, heavy usage, leaking plumbing fixtures, groundwater infiltration, tree roots, freezing conditions, surface drainage problems, poor initial design, poor construction practices, or unsuitable materials used in constructing the system; the system can also simply stop working because of its age. An SSTS that has been properly designed and installed, properly maintained, and used in the manner for which the system was designed can be expected to provide service for twenty to twenty-five years on average. Some parts of the SSTS such as alarms, switches, pumps, filters, etc. will most likely have to be repaired or replaced over the lifetime of the system.
- 5. A Compliance Inspection is not meant to be a test or inspection for longevity of the system; a Compliance Inspection is strictly for the purpose of determining if the SSTS is protective of public health and safety, as well as the groundwater at the date and time the inspection was performed. This inspection is not intended to determine if the SSTS was originally designed or installed to past or present MPCA or other Local Government Unit code requirements. This inspection is not intended to determine if the SSTS was designed and/or installed to support the anticipated flow from the building as the use of the building may have changed since the design and construction of the SSTS due to the addition of bedrooms, occupants, etc. In addition, this inspection is not intended to determine the quality of the original SSTS design, the quality of the construction practices used while installing the SSTS, or the quality of the materials used in constructing the SSTS.
- 6. Brian L. Humpal, Inc. cannot guarantee the performance of SSTS products/components such as: gravelless pipe, chamber trenches, effluent filters, tanks, sewage pre-treatment components, piping, etc. Products such as gravelless pipe are no longer approved for installation in the State of Minnesota and may have a significantly reduced performance and/or life expectancy.
- 7. WINTER WORK: By accepting this report, it is understood that inspections conducted during winter months (approximately November 1st through April 1st) are more difficult to perform because of possible snow cover and/or ground frost. SSTS components such as tanks, maintenance covers, tank inspection pipes, subsurface distribution medium inspection pipes, and soil treatment areas are more difficult or impossible to locate due to snow cover and/or ground frost. In addition, soil borings are more difficult to perform due to snow cover and/or ground frost. Brian L. Humpal, Inc. will attempt to use the same level of standards when performing work during winter periods as when performing work during non-winter periods. However, the recipient of this report understands that because of the aforementioned considerations, the same level of standards may not be possible.
- 8. By accepting this report, the client understands that Brian L. Humpal, Inc. will not be responsible for any monetary damages exceeding the fee for the services provided.