### **Inspect Minnesota & Midwest Soil Testing**

P.O. Box 383 Hugo, MN 55038

Brian Humpal

651-492-7550/Brian@midwestsoiltesting.com

MPCA Licensed Designer & Inspector

### SUBSURFACE SEWAGE TREATMENT SYSTEM COMPLIANCE REPORT

Inspection Address: 11777 102nd St N, Grant, MN 55082

### **REPORT SUMMARY**

I have performed an "MPCA Compliance Inspection" on this septic system and have reviewed the original design/permit records on file at Washington County. This system consists a rock trench drainfield installed in 1995. Two pre-cast septic tanks and a lift tank were added in approximately 2005.

My inspection indicates that this system is presently "non-compliant" in accordance with MPCA rules 7080.1500 Subp.4(B)(D) because of the lack of the required three foot separation between the bottom of the drainfield and seasonally saturated soils. This system is not an imminent threat to public health or safety per MPCA rule 7080.1500 Subp. 4(A). Washington County issued sewage treatment permit #87-95065 for the installation of this septic system.

In accordance with MPCA rules, I am sending a copy of this complete report to Washington County. I cannot officially speak on behalf of the County relative to the upgrade requirements of these non-compliant systems. Please contact Washington County Environmental Specialist, Mr. Chris LeClair (651-430-4052), to verify the County's position.

Please advise buyer, agents, lender, etc. to contact me should they have any questions regarding this system.

Brian Humpal



### **Compliance Inspection Form**

### Existing Subsurface Sewage Treatment Systems (SSTS)

Doc Type: Compliance and Enforcement

<b>Instructions:</b> Inspection results based on Minnesota Pollution Control Agency (M requirements and attached forms – additional local requirements may also apply.	PCA) For local tracking purposes:
Submit completed form to Local Unit of Government (LUG) and system own	ner .
within 15 days	iei
System Status	
System status on date (mm/dd/yyyy): 8/16/2016	
	ncompliant – Notice of Noncompliance e Upgrade Requirements on page 3)
Reason(s) for noncompliance (check all applicable)  Impact on Public Health (Compliance Component #1) – Imminent the Other Compliance Conditions (Compliance Component #3) – Immine	ent threat to public health and safety
<ul> <li>☐ Tank Integrity (Compliance Component #2) – Failing to protect grou</li> <li>☐ Other Compliance Conditions (Compliance Component #3) – Failing</li> </ul>	
<ul> <li>Soil Separation (Compliance Component #4) – Failing to protect growth</li> </ul>	
	unawater
☐ Operating permit/monitoring plan requirements (Compliance Compo	nent #5) – Noncompliant
☐ Operating permit/monitoring plan requirements (Compliance Composition Parcel ID# or Sec/Twip Property address: 11777 102nd St N, Grant, MN 55082 Readers	nent #5) – Noncompliant
Property Information Property address: 11777 102nd St N, Grant, MN 55082 Property owner: Patricia Bodin Operating permit/monitoring plan requirements (Compliance Composite Comp	nent #5) – Noncompliant  D/Range: ason for inspection: Property Sale
Property Information Property address: 11777 102nd St N, Grant, MN 55082 Property owner: Patricia Bodin Owner's representative: Replaced regulatory authority: Washington County  Property (Compliance Composite Composi	nent #5) – Noncompliant  D/Range:  ason for inspection: Property Sale ner's phone: 651-280-5428  Dresentative phone: 651-430-4052
Property Information Property address: 11777 102nd St N, Grant, MN 55082 Property owner: Patricia Bodin Owner's representative: Reposition of the composition of the	nent #5) – Noncompliant  D/Range:  ason for inspection: Property Sale ner's phone: 651-280-5428  Dresentative phone: 651-430-4052
Property Information Property address: 11777 102nd St N, Grant, MN 55082 Property owner: Patricia Bodin Owner's representative: Local regulatory authority: Washington County Brief system description: Two pre-cast septic tanks, a pre-cast lift tank, and reserved.	nent #5) – Noncompliant  D/Range:  ason for inspection: Property Sale ner's phone: 651-280-5428  Dresentative phone: 651-430-4052
Property Information Property address: 11777 102nd St N, Grant, MN 55082 Property owner: Patricia Bodin Owner's representative: Rel Local regulatory authority: Washington County Brief system description: Two pre-cast septic tanks, a pre-cast lift tank, and recomments or recommendations:	phent #5) – Noncompliant  phonomer #5) – Noncompliant  phonomer property Sale phonomer's phone: 651-280-5428  presentative phone: 651-430-4052  pock trench drainfield.
Property Information Property address: 11777 102nd St N, Grant, MN 55082 Property owner: Patricia Bodin Owner's representative: Local regulatory authority: Washington County Brief system description: Two pre-cast septic tanks, a pre-cast lift tank, and recomments or recommendations:  Certification I hereby certify that all the necessary information has been gathered to determined determination of future system, inadequate maintenance, or future water usage.	phent #5) – Noncompliant  phonomer #5) – Noncompliant  phonomer property Sale phonomer's phone: 651-280-5428  presentative phone: 651-430-4052  pock trench drainfield.
Property Information Property address: 11777 102nd St N, Grant, MN 55082 Property owner: Patricia Bodin Owner's representative: Replaced regulatory authority: Washington County Brief system description: Two pre-cast septic tanks, a pre-cast lift tank, and recomments or recommendations:  Certification I hereby certify that all the necessary information has been gathered to determine determination of future system performance has been nor can be made due to upossible abuse of the system, inadequate maintenance, or future water usage.  Business name: Inspect Minnesota, Midwest Soil Testing	phent #5) – Noncompliant  phonograms  phonograms  property Sale  presentative phone:  gulatory authority phone:  gulatory authority phone:  pock trench drainfield.  ethe compliance status of this system. No phonograms phonograms paystem construction,
Property Information Property address:11777_102nd St N, Grant, MN 55082 Property owner:Patricia Bodin	phent #5) – Noncompliant  phonomer #5) – Noncompliant  phonomer property Sale phonomer's phone: 651-280-5428  presentative phone: 651-430-4052  pock trench drainfield.  pet the compliance status of this system. No phonomer phono
Property Information Property address: 11777 102nd St N, Grant, MN 55082 Property owner: Patricia Bodin Owner's representative: Replaced regulatory authority: Washington County Brief system description: Two pre-cast septic tanks, a pre-cast lift tank, and recomments or recommendations:  Certification I hereby certify that all the necessary information has been gathered to determine determination of future system performance has been nor can be made due to upossible abuse of the system, inadequate maintenance, or future water usage.  Business name: Inspect Minnesota, Midwest Soil Testing	phent #5) – Noncompliant  phonomer #5) – Noncompliant  phonomer #5) – Noncompliant  phonomer #5) – Noncompliant  phonomer #5) – Noncompliant  property Sale  presentative phone:  gulatory authority phone:  gulatory authority phone:  phonomer #5) – Noncompliant  ### ### ### ### ### ### ### ### ### #
Property Information Property address: 11777 102nd St N, Grant, MN 55082 Property owner: Patricia Bodin Owner's representative: Report system description: Two pre-cast septic tanks, a pre-cast lift tank, and recomments or recommendations:  Certification I hereby certify that all the necessary information has been gathered to determine determination of future system performance has been nor can be made due to upossible abuse of the system, inadequate maintenance, or future water usage.  Inspector name: Brian Humpal Cellusiness name: Inspect Minnesota, Midwest Soil Testing Inspector signature: Brian Humpal Necessary or Locally Required Attachments	phent #5) – Noncompliant  phonomer #5) – Noncompliant  phonomer #5) – Noncompliant  phonomer #5) – Noncompliant  phonomer #5) – Noncompliant  property Sale  presentative phone:  gulatory authority phone:651-430-4052  pock trench drainfield.  per the compliance status of this system. No phonomer p

1.	In	npact on Public Health – Co	mpliance component	#1 of 5			
	C	ompliance criteria:		Verification method(s):			
		vstem discharge sewage to the ound surface.	☐ Yes ⊠ No	<ul><li>☒ Searched for surface outlet</li><li>☒ Searched for seeping in yard/backup in home</li></ul>			
		stem discharge sewage to drain tile surface waters.	☐ Yes ⊠ No	<ul> <li>☑ Excessive ponding in soil system/D-boxes</li> <li>☐ Homeowner testimony (See Comments/Explanation)</li> </ul>			
		vstem cause sewage backup into velling or establishment.	☐ Yes ⊠ No	<ul> <li>"Black soil" above soil dispersal system</li> <li>System requires "emergency" pumping</li> <li>Performed dye test</li> </ul>			
		ny "yes" answer above indicate n Imminent Threat to Public Hea		☐ Unable to verify (See Comments/Explanation) ☐ Other methods not listed (See Comments/Explanation)			
		omments/Explanation: one of the above found					
2.	Ta	ank Integrity — Compliance con	nponent #2 of 5				
	C	ompliance criteria:		Verification method(s):			
		rstem consists of a seepage pit, sspool, drywell, or leaching pit.	☐ Yes ☒ No	<ul><li>☑ Probed tank(s) bottom</li><li>☑ Examined construction records</li></ul>			
	Se	epage pits meeting 7080.2550 may be mpliant if allowed in local ordinance.		<ul><li>Examined Tank Integrity Form (Attach)</li><li>Observed liquid level below operating depth</li></ul>			
	de	ewage tank(s) leak below their signed operating depth.	☐ Yes ⊠ No	☐ Examined empty (pumped) tanks(s) ☐ Probed outside tank(s) for "black soil"			
		yes, which sewage tank(s) leaks:		☐ Unable to verify (See Comments/Explanation)			
	Any "yes" answer above indicates the system is Failing to Protect Groundwater.			Other methods not listed (See Comments/Explanation			
3.	Lo Lif	omments/Explanation: owered underwater camera into tanks - it pump and alarm were operational at ther Compliance Conditions	the time of the inspect	ion.			
	a.	Maintenance hole covers are damage	d, cracked, unsecured,	or appear to structurally unsound. ☐ Yes* ☒ No ☐ Unknown			
	b.	Other issues (electrical hazards, etc.) to *System is an imminent threat to pu		rely impact public health or safety. ☐ Yes* ☒ No ☐ Unknown			
		Explain:					
	C.	System is non-protective of ground wa *System is failing to protect ground		as determined by inspector ☐ Yes* ☒ No			
		Explain:					

Property address: 11777 102nd St N, Grant, MN 55082

Inspector initials/Date: 8/16/2016

www.pca.state.mn.us • 651-296-6300 • 800-657-3864 • 3 of **TO**Y 651-282-5332 or 800-657-3864 • Available in alternative formats wq-wwists4-31 • 1/24/12 Page 2 of 3

1.	Soil Separation – Compliance compor	nent #4 c	of 5			
	Date of installation: 1995?/2005? Shoreland/Wellhead protection/Food Beverage	Unkr			erification method(s):	,
	Lodging?	☐ Yes	⊠ NO		oil observation does not expire. Pr bservations by two independent pa	
	Compliance criteria:	T			nless site conditions have been all	tered or local
	For systems built prior to April 1, 1996, and not located in Shoreland or Wellhead Protection Area or not serving a food, beverage or lodging establishment:	☐ Yes	□ No		requirements differ.  Conducted soil observation(s) (Attach boring laws) Two previous verifications (Attach boring logs) Not applicable (Holding tank(s), no drainfield)	
	Drainfield has at least a two-foot vertical separation distance from periodically saturated soil or bedrock.			_ [	Unable to verify (See Comments/ Other (See Comments/Explanation	
	Non-performance systems built April 1, 1996, or later or for non-performance systems located in Shoreland or Wellhead Protection Areas or serving a food, beverage, or lodging establishment:	☐ Yes	⊠ No	С	comments/Explanation:	
	Drainfield has a three-foot vertical separation distance from periodically saturated soil or bedrock.*			_		
	"Experimental", "Other", or "Performance"	☐ Yes	☐ No	Ir	ndicate depths of elevations	
	systems built under pre-2008 Rules; Type IV or V systems built under 2008 Rules (7080. 2350 or 7080.2400 (Advanced Inspector License required)			_A.	Bottom of distribution media	See Attached Boring Log(s)
	Drainfield meets the designed vertical			<u>B</u> .	Periodically saturated soil/bedrock	
	separation distance from periodically saturated soil or bedrock.	eparation distance from periodically aturated soil or bedrock.		System separation		
				D.	. Required compliance separation*	
	Any "no" answer above indicates to Failing to Protect Groundwater.	he syst	em is		May be reduced up to 15 percent in Ordinance.	f allowed by Local
5.	Operating Permit and Nitrogen B	<b>MP*</b> – C	Compliand	ce com	ponent #5 of 5 🔀 <b>Not app</b>	licable
	Is the system operated under an Operating Per	mit?	☐ Yes	⊠ No	If "yes", A below is required	
	Is the system required to employ a Nitrogen BM	IP?	☐ Yes	⊠ No	If "yes", B below is required	
	BMP=Best Management Practice(s) specifi	ied in the	system de	esign		
	If the answer to both questions is "no",	this sec	tion doe	s not r	need to be completed.	
	Compliance criteria					
	a. Operating Permit number:				□ Voc. □ No	
	Have the Operating Permit requirements to	peen met	?	☐ Yes ☐ No		
	b. Is the required nitrogen BMP in place and	properly	functioning	g?		
	Any "no" answer indicates Noncompliance.					

Property address: 11777 102nd St N, Grant, MN 55082

Inspector initials/Date: 8/16/2016


**Upgrade Requirements** (Minn. Stat. § 115.55) An imminent threat to public health and safety (ITPHS) must be upgraded, replaced, or its use discontinued within ten months of receipt of this notice or within a shorter period if required by local ordinance. If the system is failing to protect ground water, the system must be upgraded, replaced, or its use discontinued within the time required by local ordinance. If an existing system is not failing as defined in law, and has at least two feet of design soil separation, then the system need not be upgraded, replaced, or its use discontinued, notwithstanding any local ordinance that is more strict. This provision does not apply to systems in shoreland areas, Wellhead Protection Areas, or those used in connection with food, beverage, and lodging establishments as defined in law.

www.pca.state.mn.us • 651-296-6300 • 800-657-3864 •4 of TOY 651-282-5332 or 800-657-3864 • Available in alternative formats wq-wwists4-31 • 1/24/12 Page 3 of 3

### **Inspect Minnesota & Midwest Soil Testing**

### Subsurface Sewage Treatment System Owner/Property Information This information will be used for the purpose of conducting an MPCA Compliance Inspection.

Date of Inspection: August 16, 2016	Time: 1:30 PM
Property Address: 11777 102nd St N, Grant, MN	Zip: 55082
Property Owner: Patricia Bodin	Phone: 651-280-5428
Tank(s)       Tank(s)Material       Soil Treatment System         Septic 2       □Fiberglass       □Rock trench         □ Aerobic       □Plastic       □Gravelless trench         □ Lift       □ Metal       □Chamber trench         □ Holding       □Concrete       □ Seepage bed         □ Other:       □Block       □ Mound         □ Other       □ At-grade	Other  Alternative system Experimental system Cesspool system Other system
Are the tank maintenance covers accessible? ⊠ Yes ☐ No *If performed through the maintenance holes. Maintenance hole cover the ground surface to facilitate access and proper maintenance of the second surface to facilitate access and proper maintenance of the second surface to facilitate access and proper maintenance of the second surface to facilitate access and proper maintenance of the second surface to facilitate access and proper maintenance of the second surface to facilitate access and proper maintenance of the second surface to facilitate access and proper maintenance of the second surface to facilitate access and proper maintenance of the second surface to facilitate access and proper maintenance of the second surface to facilitate access and proper maintenance of the second surface to facilitate access and proper maintenance of the second surface to facilitate access and proper maintenance of the second surface to facilitate access and proper maintenance of the second surface to facilitate access and proper maintenance of the second surface to facilitate access and proper maintenance of the second surface to facilitate access and proper maintenance of the second surface to facilitate access and proper maintenance of the second surface to facilitate access and proper maintenance of the second surface to facilitate access and proper maintenance of the second surface to facilitate access and proper maintenance of the second surface to facilitate access and proper maintenance of the second surface to facilitate access and proper maintenance of the second surface to facilitate access and proper maintenance of the second surface to facilitate access and proper maintenance of the second surface to facilitate access and the second surface to facilita	ers should be made accessible to the system.
Year house built: 2005 Year septic installed: 1995	Tank size (gals.): 2-1000
	sidents in home?
Number of bedrooms? 4 Are all floors drained by g	
Garbage disposal? Whirlpool bath?	
More than one system (laundry, etc.)?	
Does this property have any footing drain tiles connected to the se	ptic system?
Are any buildings on this property such as garages or out-building	s connected to this system?
Are there any additional systems on this property serving other bu	ildings?
Location of septic system on lot? Tanks - Southwest Side, Drainfi	eld - East Side
	e well a deep well? Y
Have you ever experienced any problems with the system such as surfacing of sewage onto the ground, septic tank overflowing, etc. to the system?  If yes, explain:	
When was the system last pumped? Name of pum	1
	n on a monitoring plan?
Have you received notices from any government agency concerning	ng this system?
Is your property located in a shoreland management area? N	
Do you have any additional information that should be given to the	e new owner?
I hereby certify that the above information is correct to the best of my knowledg considered "non-compliant/failing" per MPCA rules, that the inspector must by local government unit within 15 days of the date of inspection completion. I a this report, that I/we are ultimately responsible for payment of all fees for all we by Inspect Minnesota and Midwest Soil Testing.	law submit a copy of this report to the lso agree that unless otherwise noted in
Owner/Occupant:	Date:

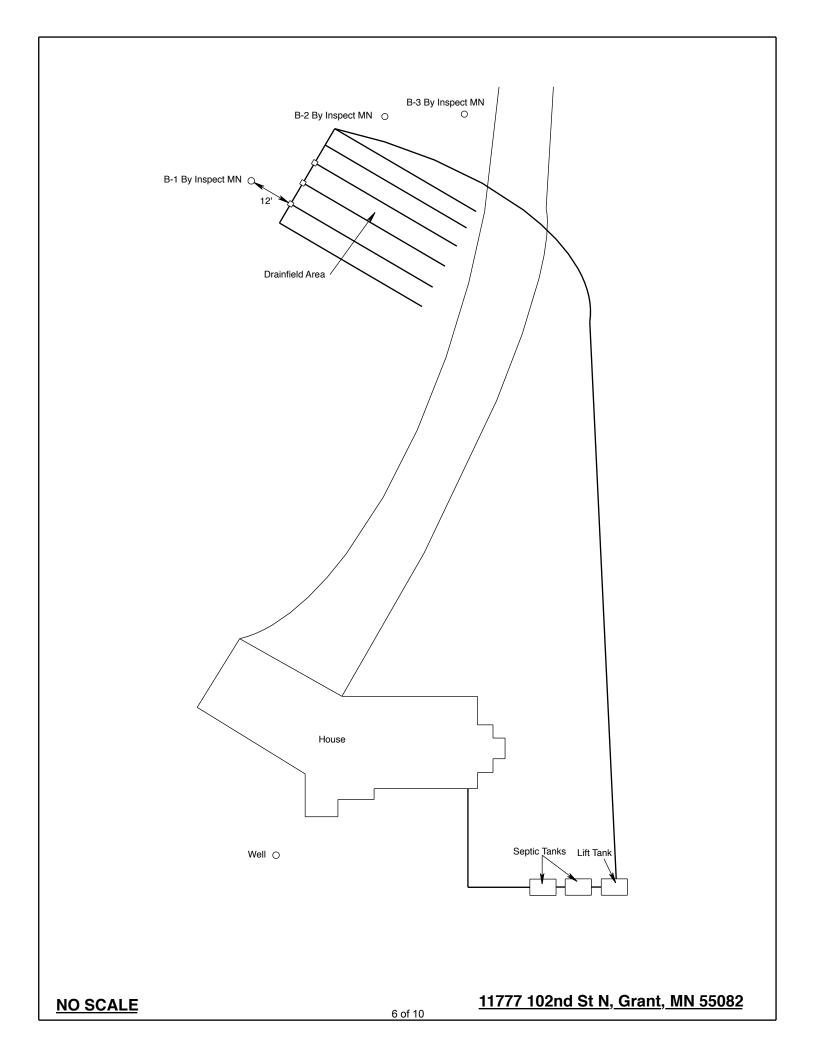

### **Log Of Soil Borings**

Location of Project: 11777 102nd St N, Grant, MN 55082				55082	
Borings Made By: Inspect Minnesota				Date	: 8/16/16
Auger Used: Hand/Bucket			Class	sification System	: USDA
Вс	ring Number:	1	Boring Number:		: 2
Surface Elevation of Boring  Same ground surface as last drainfield trench		Surface Elevation of Boring  Same ground surface as drainfield trench			
<u> </u>		Depth In Inches	Soils E	ncountered	
0-48 7.5	SYR 4/6 Clay Loa	R 3/3, 10YR 4/3, & am (Fill/Disturbed) With /2, & 7.5YR 5/8 Redox	0-11	10YR 5/3 Silt Loam	2.5/3 Loam (Moist To Saturated) With 6/2, & 7.5YR 7/8 Redox
0" De	pth To End Of B	oring Or Redox	11"	Depth To End Of	Boring Or Redox
Same Elevation Of Boring Relative To System		Same		ng Relative To System	
-48" Depth To Bottom Of Distribution Media =0" Of Separation		-48" =0"	Depth To Bottom Of Separation	Of Distribution Media	
Fn	d Of Boring At:	48"		End Of Boring At	:: 33"
	dox Present At:	0"		Redox Present At	
Standing Water Present At: None		Standing	Water Present At		

Bottom Of Distribution Medium At: 48 Inches

### **Log Of Soil Borings**

Location of Project: 11777 102nd St N, Grant, MN 55082					
Borings Made By: Inspect Minnesota				Date:	8/16/16
Auger Used: Hand/Bucket			Classi	ification System:	USDA
Boring Number: 3			Boring Number:		
Surface Elevation of Boring  Same ground surface as last drainfield trench		Surface Elevation Boring			
Depth In Inches	h In Soils Encountered		Depth In Inches	Soils Er	ncountered
0-12 12-19	s 7.5YR 2.5/3 Loam				
12"	Depth To End Of B	oring Or Redox	I	Depth To End Of Bo	oring Or Redox
Same Elevation Of Boring Relative To System			Elevation Of Boring	Relative To System	
-48" Depth To Bottom Of Distribution Media				of Distribution Media	
=0" Of Separation			Of Separation		
	End Of Boring At:	19"		End Of Boring At:	
	Redox Present At:	12"		Redox Present At:	
Standing Water Present At: None				Water Present At:	
Standing Water Freschit Att			Ctarraing		

Bottom Of Distribution Medium At: 48 Inches

### **DISCLAIMER**

### Brian L. Humpal, Inc. dba. Inspect Minnesota, Midwest Soil Testing Relative to Subsurface Sewage Treatment System (SSTS) Compliance Inspections

- 1. This inspection/report is being performed for only the seller/owner of the property on which the SSTS is located. In such case that another party is paying for the inspection, the contract is between only said party and Brian L. Humpal, Inc.; there is no contract between Brian L. Humpal, Inc. and any other party unless otherwise noted.
- 3. Brian L. Humpal, Inc. has not been retained to warranty, guarantee, or certify the proper functioning of the SSTS for any period of time beyond the date of inspection or into the future. Because of the numerous factors (usage, maintenance, soil characteristics, previous failures, etc.) which may affect the proper operation of an SSTS, as well as the inability of Brian L. Humpal, Inc. to supervise or monitor the use or maintenance of the SSTS, the report shall not be construed as a warranty by Brian L. Humpal, Inc. that the SSTS will function properly for any particular party for any period of time.
- 4. Brian L. Humpal, Inc. is unable to verify the frequency and/or, quality of prior or future maintenance of the SSTS. Maintenance of the tank(s) must be performed through the tanks maintenance hole. The removal of solids from any location other than the maintenance hole is not a compliant method of maintenance. It is strongly recommended that maintenance covers be made accessible to the ground surface to facilitate proper maintenance.
- 5. Minimum Compliance Inspection requirements relative to this inspection and this report include <u>only</u> verification that the SSTS has tank(s) (septic tanks, lift tanks, dosing tanks, stilling tanks, etc.) which are watertight below the designed operating depth, the required separation between the bottom of the subsurface soil distribution medium and seasonally saturated soils, no back-ups of sewage into the dwelling, no discharge of sewage/effluent to the ground surface or surface waters, and no imminent safety hazards. Brian L. Humpal, Inc. does not inspect plumbing or pumps prior to the first SSTS component as these are plumbing components. The performance of exterior pumps and associated components are not inspected as they are considered to be maintenance items. Additionally, no indications relative to compliance with electrical code requirements have been made. It is recommended that any other applicable plumbing, electrical, housing, etc. inspections be performed by a qualified inspection business. Sewage back-up verification is limited to observing the floor drain area and/or the information supplied by the last occupants of the building prior to inspection. Brian L. Humpal, Inc. cannot guarantee that the information given to them by the last occupants of the building prior to inspection relative to back-ups is accurate.
- 4. Certification of this SSTS does not warranty future use beyond the date of the inspection. Any SSTS, old or new, can become hydraulically overloaded or discharge sewage/effluent to the ground surface as a result of more people moving into the house than were previously occupying the house, improper maintenance, heavy usage, leaking plumbing fixtures, groundwater infiltration, tree roots, freezing conditions, surface drainage problems, poor initial design, poor construction practices, or unsuitable materials used in constructing the system; the system can also simply stop working because of its age. An SSTS that has been properly designed and installed, properly maintained, and used in the manner for which the system was designed can be expected to provide service for twenty to twenty-five years on average. Some parts of the SSTS such as alarms, switches, pumps, filters, etc. will most likely have to be repaired or replaced over the lifetime of the system.
- 5. A Compliance Inspection is not meant to be a test or inspection for longevity of the system; a Compliance Inspection is strictly for the purpose of determining if the SSTS is protective of public health and safety, as well as the groundwater at the date and time the inspection was performed. This inspection is not intended to determine if the SSTS was originally designed or installed to past or present MPCA or other Local Government Unit code requirements. This inspection is not intended to determine if the SSTS was designed and/or installed to support the anticipated flow from the building as the use of the building may have changed since the design and construction of the SSTS due to the addition of bedrooms, occupants, etc. In addition, this inspection is not intended to determine the quality of the original SSTS design, the quality of the construction practices used while installing the SSTS, or the quality of the materials used in constructing the SSTS.
- 6. Brian L. Humpal, Inc. cannot guarantee the performance of SSTS products/components such as: gravelless pipe, chamber trenches, effluent filters, tanks, sewage pre-treatment components, piping, etc. Products such as gravelless pipe are no longer approved for installation in the State of Minnesota and may have a significantly reduced performance and/or life expectancy.
- 7. WINTER WORK: By accepting this report, it is understood that inspections conducted during winter months (approximately November 1<sup>st</sup> through April 1<sup>st</sup>) are more difficult to perform because of possible snow cover and/or ground frost. SSTS components such as tanks, maintenance covers, tank inspection pipes, subsurface distribution medium inspection pipes, and soil treatment areas are more difficult or impossible to locate due to snow cover and/or ground frost. In addition, soil borings are more difficult to perform due to snow cover and/or ground frost. Brian L. Humpal, Inc. will attempt to use the same level of standards when performing work during winter periods as when performing work during non-winter periods. However, the recipient of this report understands that because of the aforementioned considerations, the same level of standards may not be possible.
- 8. By accepting this report, the client understands that Brian L. Humpal, Inc. will not be responsible for any monetary damages exceeding the fee for the services provided.

# Sulbsurface Sewage Treatment Systems

Non-transferable



License # L2896

Date of Issuance:

Oct 28, 2015 Dec 22, 2016 Dec 22, 2016 Dec 22, 2016 Dec 22, 2016

Adv Designer License Expires:

Adv Inspector License Expires: Maintainer License Expires: Installer License Expires:

### Certification

Inspect Minnesota, Midwest Soil Testing

10/15/2017 Expires

10/15/2017

Advanced Designer (Certified) Advanced Inspector (Certified)

Maintainer (Certified)

Certification Type

**Designated Certified** 

Individual (DCI) Brian L. Humpal Brian L. Humpal

10/15/2017

10/15/2017

10/15/2017

Service Provider (Certified)

Installer (Certified)

Inspector (Certified) Designer (Certified)

Christopher R. Uebe Christopher R. Uebe

03/04/2018

03/04/2018

Steven Giddings Manager Environmental Business Assistance Section



## Minnesota Pollution Control Agency

520 Lafayette Road North St. Paul, Minnesota 55155-4194

Brian L. Humpal Brian L. Humpal

Brian L. Humpal