Midwest Sewer Services

P.O. Box 10853 White Bea	ar Lake, MN 55110	Brian Humpal		
651-492-7550/Brian@Mid	westsoiltesting.com M	PCA Licensed Advanced Inspector		
SUBSURFACE SEWAGE TREATMENT SYSTEM (SSTS) COMPLIANCE REPOR				
Date: May 13, 2021	Time: 10:00 AM	Owner: Peter Davis		
Inspection Address: 11233 24 th St N, Lake Elmo, MN 55042				

REPORT SUMMARY

I have performed an "MPCA Compliance Inspection" on this system and have reviewed the original design/permit records on file at City of Lake Elmo. This very old system (installed in 1991) consists of a pre-cast septic tank and a rock trench drainfield. It should be noted that the average life expectancy of a septic system is approximately 30 years. Pinky's Sewer Service pumped the septic tank on May 13, 2021.

Predicated on my inspection of the system and my review of the original design/permit records, it is my opinion that this system <u>presently meets</u> MPCA minimum compliance inspection requirements.

Midwest Sewer Services have been hired to perform a compliance inspection of this SSTS for compliance with local ordinances pursuant to Minn. Stat. § 115.55 (2013). This compliance inspection covers only the criteria required by Minn. Stat. § 115.55 Subd. 5a (2013) and Minn. R. 7080.1500 (2011). A compliance inspection is an indication of the current compliance status of the system and does not guarantee the performance or longevity of this system beyond the date of inspection, as it is impossible to determine the future performance of any system. Midwest Sewer Services disclaim any use of this compliance inspection beyond determining SSTS compliance pursuant to Minn. Stat. § 115.55 Subd. 5a (2013) and Minn. R. 7080.1500 (2011).

Please contact me should you have any questions.

After the

Brian Humpal

Brian Humpal

Christopher

Uebe



520 Lafayette Road North St. Paul, MN 55155-4194

Compliance inspection report form

Existing Subsurface Sewage Treatment System (SSTS)

Doc Type: Compliance and Enforcement

Owner's phone: 651-731-0875

Instructions: Inspection results based on Minnesota Pollution Control Agency (MPCA) requirements and attached supporting documentation – additional local requirements may also apply. Further information can be found here: https://www.pca.state.mn.us/sites/default/files/wq-wwists4-31a.pdf.

2 of 11

Inspector must submit completed form to Local Governmental Unit (LGU) and system owner within 15 days of final determination of compliance or noncompliance.

Local tracking number:

Parcel ID# or Sec/Twp/Range:	Local regulatory authority:	Washington County
Property address: <u>11233 24th St N, Lake Elmo, MN 55042</u>		

Owner/representative: Peter Davis / Kevin Carlson - EXP Realty

Brief system description: A pre-cast septic tank and a rock trench drainfield.

System status

System status on date (mm/dd/yyyy): _ 5/13/2021

Compliant – Certificate of compliance*

(Valid for 3 years from report date unless evidence of an imminent threat to public health or safety requiring removal and abatement under section 145A.04, subdivision 8 is discovered or a shorter time frame exists in Local Ordinance.)

*Note: Compliance indicates conformance with Minn. R. 7080.1500 as of system status date above and does not guarantee future performance.

□ Noncompliant – Notice of noncompliance

An imminent threat to public health and safety (ITPHS) must be upgraded, replaced, or its use discontinued within ten months of receipt of this notice or within a shorter period if required by local ordinance or under section 145A.04 subdivision 8.

Systems failing to protect ground water must be upgraded, replaced, or use discontinued within the time required by local ordinance.

Reason(s) for noncompliance (check all applicable)

Impact on public health (Compliance component #1) – Imminent threat to public health and safety

- Tank integrity (Compliance component #2) *Failing to protect groundwater*
- Other Compliance Conditions (Compliance component #3) Imminent threat to public health and safety
- □ Other Compliance Conditions (Compliance component #3) Failing to protect groundwater
- System not abandoned according to Minn. R. 7080.2500 (Compliance component #3) Failing to protect groundwater
- Soil separation (Compliance component #5) Failing to protect groundwater
- Operating permit/monitoring plan requirements (Compliance component #4) Noncompliant local ordinance applies

Comments or recommendations

Certification

I hereby certify that all the necessary information has been gathered to determine the compliance status of this system. No determination of future system performance has been nor can be made due to unknown conditions during system construction, possible abuse of the system, inadequate maintenance, or future water usage.

By typing my name below, I certify the above statements to be true and correct, to the best of my knowledge, and that this information can be used for the purpose of processing this form.

Business name: Midwest Sewer Services

wan Humpal Inspector signature: (This document has been electronically signed)

Certification number: C5342/C9852

License number: L2896

Phone: 651-492-7550

Necessary or locally required supporting documentation (must be attached)

- Soil observation logs Other information (list):
- Locally required forms
- Tank Integrity Assessment

Operating Permit

Report Summary, Property Information, Disclaimer, License

^{3 of 11} **1. Impact on public health** – Compliance component #1 of 5

		Attached supporting documentation:
System discharges sewage to the ground surface	🗋 Yes* 🛛 No	☐ Other: ☐ Not applicable
System discharges sewage to drain ile or surface waters.	🗌 Yes* 🛛 No	_
System causes sewage backup into dwelling or establishment.	🗌 Yes* 🛛 No	

None of the above found.

Describe verification methods and results:

2. Tank integrity – Compliance component #2 of 5

Compliance criteria:		Attached supporting documentatio	n:			
System consists of a seepage pit,	🗌 Yes* 🛛 No	Pumped at time of inspection Pinky's Se Name of maintenance business: Service				
cesspool, drywell, leaching pit, or other pit?						
Sewage tank(s) leak below their	🗌 Yes* 🛛 No	License number of maintenance business: L1673				
designed operating depth?		Date of maintenance:	5/13/2021			
			Existing tank integrity assessment (Attach)			
If yes, which sewage tank(s) leaks:		Date of maintenance (mm/dd/yyyy): (must be with	nin three years)			
Any "yes" answer above indicates the system is failing to protect groundwater.		(See form instructions to ensure asses Minn. R. 7082.0700 subp. 4 B (1))	sment complies with			
		Tank is Noncompliant (pumping not necessary – explain belov				
		Other:				

Describe verification methods and results:

3. Other compliance conditions – Compliance component #3 of 5

3a. Maintenance hole covers appear to be structurally unsound (damaged, cracked, etc.), or un ☐ Yes*	secured?
3b. Other issues (electrical hazards, etc.) to immediately and adversely impact public health or sat	
*Yes to 3a or 3b - System is an imminent threat to public health and safety.	
3c. System is non-protective of ground water for other conditions as determined by inspector?	☐ Yes* ⊠ No
3d. System not abandoned in accordance with Minn. R. 7080.2500?	🗌 Yes* 🛛 No
*Yes to 3c or 3d - System is failing to protect groundwater.	
Describe verification methods and results:	
Operating permit and nitrogen BMP* – Compliance component #4 Is the system operated under an Operating Permit?	of 5 ⊠ Not applicable If "yes", A below is require
Is the system required to employ a Nitrogen BMP specified in the system design? \Box Yes \Box No	
BMP = Best Management Practice(s) specified in the system design	
If the answer to both questions is "no", this section does not need to be complet	ed.
Compliance criteria:	
b. Is the required nitrogen BMP in place and properly functioning?	
b. Is the required nitrogen BMP in place and properly functioning? Yes No Any "no" answer indicates noncompliance.	
b. Is the required nitrogen BMP in place and properly functioning?	
b. Is the required nitrogen BMP in place and properly functioning? Yes No Any "no" answer indicates noncompliance.	
b. Is the required nitrogen BMP in place and properly functioning? Yes No Any "no" answer indicates noncompliance.	
b. Is the required nitrogen BMP in place and properly functioning? Yes No Any "no" answer indicates noncompliance.	
b. Is the required nitrogen BMP in place and properly functioning? Yes No Any "no" answer indicates noncompliance.	
b. Is the required nitrogen BMP in place and properly functioning? Yes No Any "no" answer indicates noncompliance.	
b. Is the required nitrogen BMP in place and properly functioning? Yes No Any "no" answer indicates noncompliance.	
b. Is the required nitrogen BMP in place and properly functioning? Yes No Any "no" answer indicates noncompliance.	

4 of 11

Attached supporting documentation:

5 of 11 **5. Soil separation** – Compliance component #5 of 5

Date of installation 1991 (mm/dd/yyyy)	Unknown				
Shoreland/Wellhead protection/Food	🛛 Yes 🗌 No	Attached supporting documentation:			
beverage lodging?		$oxed{i}$ Soil observation logs completed for th	e report (Attach)		
Compliance criteria (select one):		Two previous verifications of required separation (Attach)	vertical		
5a. For systems built prior to April 1, 1996, and not located in Shoreland or Wellhe	Yes 🗌 No*	\square Not applicable (No soil treatment area)			
Protection Area or not serving a food, beverage or lodging establishment:		Reviewed design and permit records.			
Drainfield has at least a two-foot vertica separation distance from periodically saturated soil or bedrock.	1				
5b. Non-performance systems built April 1,	🖾 Yes 🗌 No*	Indicate depths or elevations			
1996, or later or for non-performance systems located in Shoreland or Wellhe Protection Areas or serving a food.	ad	A. Bottom of distribution media	See Attached Boring Log(s)		
beverage, or lodging establishment:		B. Periodically saturated soil/bedrock			
Drainfield has a three-foot vertical separation distance from periodically		C. System separation			
saturated soil or bedrock.*		D. Required compliance separation*			
		*May be reduced up to 15 percent if allo Ordinance.	owed by Local		
5c. "Experimental", "Other", or "Performance systems built under pre-2008 Rules; Type IV or V systems built under 2008 Rules 7080. 2350 or 7080.2400 (Advanced Inspector License required)	ce″ □ Yes □ No*				
Drainfield meets the designed vertical separation distance from periodically saturated soil or bedrock.					

*Any "no" answer above indicates the system is failing to protect groundwater.

Describe verification methods and results:


Upgrade requirements: (*Minn. Stat.* § 115.55) An imminent threat to public health and safety (ITPHS) must be upgraded, replaced, or its use discontinued within ten months of receipt of this notice or within a shorter period if required by local ordinance. If the system is failing to protect ground water, the system must be upgraded, replaced, or its use discontinued within the time required by local ordinance. If an existing system is not failing as defined in law, and has at least two feet of design soil separation, then the system need not be upgraded, replaced, or its use discontinued, notwithstanding any local ordinance that is more strict. This provision does not apply to systems in shoreland areas, Wellhead Protection Areas, or those used in connection with food, beverage, and lodging establishments as defined in law.

<u>Midwest Sewer Testing</u> Subsurface Sewage Treatment System Owner/Property Information

This information will be used for the purpose of conducting an MPCA Compliance Inspection.					
Date of Inspection: May 13, 2021	Time: 10:00 AM				
Property Address: 11233 24 th St N, Lake Elmo, MN	Zip: 55042				
Property Owner: Peter Davis	Phone:				
Tank(s)Tank(s)MaterialSoil Treatment SystemSeptic 1FiberglassRock trenchAerobicPlasticGravelless trenchLiftMetalChamber trenchHoldingConcreteSeepage bedOther:BlockMoundOtherAt-grade	Other Alternative system Experimental system Cesspool system Other system				
Are the tank maintenance covers accessible? \boxtimes Yes \square No *If					
performed through the maintenance holes. Maintenance hole cov					
the ground surface to facilitate access and proper maintenance of	the system.				
Year house built: 1991 Year septic installed: 1991	Tank size (gals.): 1500				
	esidents in home?				
Number of bedrooms? 4 Are all floors drained by g	gravity? Y				
Garbage disposal? Whirlpool bath	?				
More than one system (laundry, etc.)?					
Does this property have any footing drain tiles connected to the s	eptic system?				
Are any buildings on this property such as garages or out-buildings connected to this system?					
Are there any additional systems on this property serving other by	aildings?				
Location of septic system on lot? West Side					
	e well a deep well? Y				
Have you ever experienced any problems with the system such as: tree roots, sewage back-ups, surfacing of sewage onto the ground, septic tank overflowing, etc.; or have any repairs been made to the system? If yes, explain:					
When was the system last pumped? 5/13/2021 Name of pumper: Pinky's Sewer Service					
How often pumped in previous years? Is system on a monitoring plan?					
Have you received notices from any government agency concerning this system?					
Is your property located in a shoreland management area? Y					
Do you have any additional information that should be given to the new owner?					

I hereby certify that the above information is correct to the best of my knowledge. I also understand that if the system is considered "non-compliant/failing" per MPCA rules, that the inspector must by law submit a copy of this report to the local government unit within 15 days of the date of inspection completion. I also agree that unless otherwise noted in this report, that I/we are ultimately responsible for payment of all fees for all work performed relative to this inspection by Inspect Minnesota and Midwest Soil Testing

Owner/Occupant:

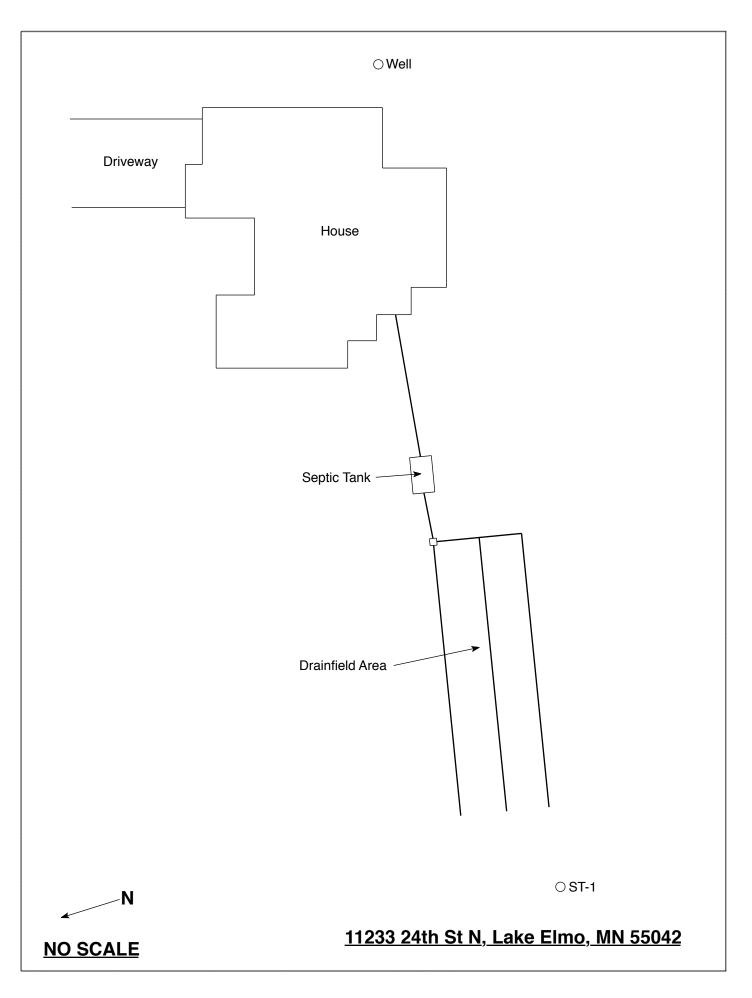

8 of 11

Soil Observations Log

	Location of Project: 11233 24th St N, Lake Elmo, MN 55042						
Obs	Observations Made By: Midwest Sewer Server				Date:	5/13/2021	
Cl	assifica	ation System:	USDA				
	Soil	Observation:	ST-1		Soil C	bservation:	
Elevati	Surface Elevation of Observation Same ground surface as last drainfield trench		Surface Elevation of Observation				
Depth In Inches	Rock %	<u>Soils E</u>	ncountered	Depth In Inches	Rock %	<u>Soils</u>	Encountered
0-12 12-44 44-72		10YR 3 10YR 4/4 L	3 Silt Loam 4 Silt Loam oamy Sand With 1 & Few Iron Nodules	Inches			
72" [Depth T	o End Of Soil O		Depth 1	o End Of Soil	Observation Or Redox	
Same E					Elevatio	n Of Observat	tion Relative To System
-39" Depth To Bottom Of Distribution Media				Depth 7	o Bottom Of I	Distribution Media	
≥33" Of Separation				Of Sepa			
L						'	
End C		Observation At:	72"	End Of		servation At:	
		lox Present At:	None			x Present At:	
Stand	Standing Water Present At: None		Standi	ng Wate	r Present At:		

Bottom Of Distribution Medium At: 39 Inches

Signature:

Afren Va

LOG OF SOIL BORINGS

BOR	ING NO. /	BOR	ING NO. 2	BORI	NO NO. 3	BORI	NG NO. 4
OEPTH IN POTT	COIL DECEMPTION	DEPTH IN PRET	DESCRIPTION	DEPTH IN FEET	BOIL DESCRIPTION	DEPTH IN PERT	BOIL DESCRIPTION
0	DRK. BRN. Fine Sanoy Loam	0	DRK.IBRN. Line Sanay LOAM	0	ORK. BEN. FINE SALLOY LOAM	0	DEK.BEA. Rine Samoy LOAM
	BRY. FINE SILTY LOAM		LT. 4110W - - Вен- гінё SILTY LOAM		LT. В 22.4. У ВНО Ш FILLE SILTY LOAM	24	LT. JEHOW BRA. FILLE SILTY LOAM
36."	CT. BRN. FILLE - MED. LOAM SAHD HROCKS	36" 43"	LT: R 600 is H ВКЛ. FILE CONMY SAHO V ROCKS I CT. BRN. FILE - MED.	42	ст. к во 13 к н. Гінб Свату Бано	<u>36</u> 47	CT. BRN. LILE GAMY SOLO (FILM) VROCES CT. BRN. TAN
60"	LT. 13 RA . MED. 5440 V 120 CKS		5940 YROCKS		4 Ro ck S	60-	ст. Ван. 144 Гіне - 4 св. SAHO LROCKS L.T. KEODISH TAH Гіне - MED. SAND
8:0"		7:6"	08575UCT1041 7-6"	8'-0	640 8.2	8:0"	

EHO B.1

640 8.2

840 8.4

DISCLAIMER

Brian L. Humpal, Inc. dba. Midwest Sewer Services, Inspect Minnesota, Midwest Soil Testing Relative to Subsurface Sewage Treatment System (SSTS) Compliance Inspections

- 1. This inspection/report is being performed for only the seller/owner of the property on which the SSTS is located. In such case that another party is paying for the inspection, the contract is between only said party and Brian L. Humpal, Inc.; there is no contract between Brian L. Humpal, Inc. and any other party unless otherwise noted.
- 3. Brian L. Humpal, Inc. has not been retained to warranty, guarantee, or certify the proper functioning of the SSTS for any period of time beyond the date of inspection or into the future. Because of the numerous factors (usage, maintenance, soil characteristics, previous failures, etc.) which may affect the proper operation of an SSTS, as well as the inability of Brian L. Humpal, Inc. to supervise or monitor the use or maintenance of the SSTS, the report shall not be construed as a warranty by Brian L. Humpal, Inc. that the SSTS will function properly for any particular party for any period of time.
- 4. Brian L. Humpal, Inc. is unable to verify the frequency and/or, quality of prior or future maintenance of the SSTS. Maintenance of the tank(s) must be performed through the tanks maintenance hole. The removal of solids from any location other than the maintenance hole is not a compliant method of maintenance. It is strongly recommended that maintenance covers be made accessible to the ground surface to facilitate proper maintenance.
- 5. Minimum Compliance Inspection requirements relative to this inspection and this report include <u>only</u> verification that the SSTS has tank(s) (septic tanks, lift tanks, dosing tanks, stilling tanks, etc.) which are watertight below the designed operating depth, the required separation between the bottom of the subsurface soil distribution medium and seasonally saturated soils, no back-ups of sewage into the dwelling, no discharge of sewage/effluent to the ground surface or surface waters, and no imminent safety hazards. Brian L. Humpal, Inc. does not inspect plumbing or pumps prior to the first SSTS component as these are plumbing components. The performance of exterior pumps and associated components are not inspected as they are considered to be maintenance items. Additionally, no indications relative to compliance with electrical code requirements have been made. It is recommended that any other applicable plumbing, electrical, housing, etc. inspections be performed by a qualified inspection business. Sewage back-up verification is limited to observing the floor drain area and/or the information supplied by the last occupants of the building prior to inspection. Brian L. Humpal, Inc. cannot guarantee that the information given to them by the last occupants of the building prior to inspection relative to back-ups is accurate.
- 4. Certification of this SSTS does not warranty future use beyond the date of the inspection. Any SSTS, old or new, can become hydraulically overloaded or discharge sewage/effluent to the ground surface as a result of more people moving into the house than were previously occupying the house, improper maintenance, heavy usage, leaking plumbing fixtures, groundwater infiltration, tree roots, freezing conditions, surface drainage problems, poor initial design, poor construction practices, or unsuitable materials used in constructing the system; the system can also simply stop working because of its age. An SSTS that has been properly designed and installed, properly maintained, and used in the manner for which the system was designed can be expected to provide service for twenty to twenty-five years on average. Some parts of the SSTS such as alarms, switches, pumps, filters, etc. will most likely have to be repaired or replaced over the lifetime of the system.
- 5. A Compliance Inspection is not meant to be a test or inspection for longevity of the system; a Compliance Inspection is strictly for the purpose of determining if the SSTS is protective of public health and safety, as well as the groundwater at the date and time the inspection was performed. This inspection is not intended to determine if the SSTS was originally designed or installed to past or present MPCA or other Local Government Unit code requirements. This inspection is not intended to determine if the SSTS was designed and/or installed to support the anticipated flow from the building as the use of the building may have changed since the design and construction of the SSTS due to the addition of bedrooms, occupants, etc. In addition, this inspection is not intended to determine the quality of the original SSTS design, the quality of the construction practices used while installing the SSTS, or the quality of the materials used in constructing the SSTS.
- 6. Brian L. Humpal, Inc. cannot guarantee the performance of SSTS products/components such as: gravelless pipe, chamber trenches, effluent filters, tanks, sewage pre-treatment components, piping, etc. Products such as gravelless pipe are no longer approved for installation in the State of Minnesota and may have a significantly reduced performance and/or life expectancy.
- 7. WINTER WORK: By accepting this report, it is understood that inspections conducted during winter months (approximately November 1st through April 1st) are more difficult to perform because of possible snow cover and/or ground frost. SSTS components such as tanks, maintenance covers, tank inspection pipes, subsurface distribution medium inspection pipes, and soil treatment areas are more difficult or impossible to locate due to snow cover and/or ground frost. In addition, soil borings are more difficult to perform due to snow cover and/or ground frost. Brian L. Humpal, Inc. will attempt to use the same level of standards when performing work during winter periods as when performing work during non-winter periods. However, the recipient of this report understands that because of the aforementioned considerations, the same level of standards may not be possible.
- 8. By accepting this report, the client understands that Brian L. Humpal, Inc. will not be responsible for any monetary damages exceeding the fee for the services provided.

Subsurface Sewage Treatment Systems Mon-transferable Business License

Midwest Sewer Services

License # L2896

License Expires: 12/22/2021

Issued: 11/06/2020

Specialty Area(s):

Installer Maintainer Service Provider Advanced Designer Advanced Inspector

Designated Certified Individual(s):

Cert #	Name	Certification Expires
C5342	Brian L Humpal	10/15/2023
	Installer, Maintainer, Serv Prov,	Adv Designer, Adv Inspector
C9852	Christopher R Uebe	3/4/2024
	Designer, Inspector	



520 Lafayette Road North St. Paul, Minnesota 55155-4194

Mich Haig

Nick Haig, Supervisor Certification and Training Unit