# **Midwest Sewer Services**

P.O. Box 10853 White Bear Lake,	MN 55110	Brian Humpal	
651-492-7550/Brian@Midwestsoilt	esting.com MP	CA Licensed Advanced Inspector	
SUBSURFACE SEWAGE TREAT	ГМЕ <b>NT SYSTEM (S</b> S	TS) COMPLIANCE REPORT	
Date: 5/21/2021 & 5/24/2021	<b>Time:</b> 3:00 PM	Owner: Teresa Mathieu	
Inspection Address: 2470 Oriole Ave N, West Lakeland, MN 55082			

# **REPORT SUMMARY**

I have performed an "MPCA Compliance Inspection" on this system and have reviewed the original design/permit records on file at Washington County. This older system (installed in 1994) consists of two pre-cast septic tanks and a rock trench drainfield. Pinky's Sewer Service pumped the septic tanks on May 24, 2021.

Predicated on my inspection of the system and my review of the original design/permit records, it is my opinion that this system <u>presently meets</u> MPCA minimum compliance inspection requirements.

Midwest Sewer Services have been hired to perform a compliance inspection of this SSTS for compliance with local ordinances pursuant to Minn. Stat. § 115.55 (2013). This compliance inspection covers only the criteria required by Minn. Stat. § 115.55 Subd. 5a (2013) and Minn. R. 7080.1500 (2011). A compliance inspection is an indication of the current compliance status of the system and does not guarantee the performance or longevity of this system beyond the date of inspection, as it is impossible to determine the future performance of any system. Midwest Sewer Services disclaim any use of this compliance inspection beyond determining SSTS compliance pursuant to Minn. Stat. § 115.55 Subd. 5a (2013) and Minn. R. 7080.1500 (2011).

Please contact me should you have any questions.

the the

Brian Humpal

Brian Humpol

Christopher

Uebe



520 Lafayette Road North St. Paul, MN 55155-4194

# Compliance inspection report form

# **Existing Subsurface Sewage Treatment System (SSTS)**

Doc Type: Compliance and Enforcement

Instructions: Inspection results based on Minnesota Pollution Control Agency (MPCA) requirements and attached supporting documentation - additional local requirements may also apply. Further information can be found here: https://www.pca.state.mn.us/sites/default/files/wq-wwists4-31a.pdf.

2 of 11

#### Inspector must submit completed form to Local Governmental Unit (LGU) and system owner within 15 days of final determination of compliance or noncompliance.

# **Property information**

Parcel ID# or Sec/Twp/Range:

Owner/representative: Teresa Mathieu

Local regulatory authority: Washington County

Owner's phone: 651-303-8245

Brief system description: Two pre-cast septic tanks and a rock trench drainfield.

# System status

System status on date (mm/dd/yyyy): 5/21/2021

## Compliant – Certificate of compliance\*

(Valid for 3 years from report date unless evidence of an imminent threat to public health or safety requiring removal and abatement under section 145A.04. subdivision 8 is discovered or a shorter time frame exists in Local Ordinance.)

Property address: 2470 Oriole Ave N, West Lakeland, MN 55082

\*Note: Compliance indicates conformance with Minn. R. 7080.1500 as of system status date above and does not guarantee future performance.

#### □ Noncompliant – Notice of noncompliance

Local tracking number:

An imminent threat to public health and safety (ITPHS) must be upgraded, replaced, or its use discontinued within ten months of receipt of this notice or within a shorter period if required by local ordinance or under section 145A.04 subdivision 8.

Systems failing to protect ground water must be upgraded, replaced, or use discontinued within the time required by local ordinance.

#### Reason(s) for noncompliance (check all applicable)

□ Impact on public health (Compliance component #1) – Imminent threat to public health and safety

Tank integrity (Compliance component #2) – Failing to protect groundwater

Other Compliance Conditions (Compliance component #3) – Imminent threat to public health and safety

Other Compliance Conditions (Compliance component #3) – Failing to protect groundwater

System not abandoned according to Minn. R. 7080.2500 (Compliance component #3) – Failing to protect groundwater

Soil separation (Compliance component #5) – Failing to protect groundwater

Operating permit/monitoring plan requirements (Compliance component #4) – Noncompliant - local ordinance applies

## **Comments or recommendations**

# Certification

I hereby certify that all the necessary information has been gathered to determine the compliance status of this system. No determination of future system performance has been nor can be made due to unknown conditions during system construction, possible abuse of the system, inadequate maintenance, or future water usage.

By typing my name below, I certify the above statements to be true and correct, to the best of my knowledge, and that this information can be used for the purpose of processing this form.

Business name: Midwest Sewer Services

Inspector signature:	Brian	Humpal	After the

Certification number: C5342/C9852

License number: L2896

(This document has been electronically signed)

Phone: 651-492-7550

# Necessary or locally required supporting documentation (must be attached)

Soil observation logs

- Locally required forms
- Other information (list):

Tank Integrity Assessment

Operating Permit

Report Summary, Property Information, Disclaimer, License

# <sup>3 of 11</sup> **1. Impact on public health** – Compliance component #1 of 5

Compliance criteria:		Attached supporting documentation:
System discharges sewage to the ground surface	🗌 Yes* 🛛 No	☐ Other: ☐ Not applicable
System discharges sewage to drain tile or surface waters.	🗌 Yes* 🛛 No	_
System causes sewage backup into dwelling or establishment.	🗌 Yes* 🛛 No	
Any "yes" answer above indicates imminent threat to public health ar		-

#### Describe verification methods and results:

None of the above found.

# 2. Tank integrity – Compliance component #2 of 5

Compliance criteria:		Attached supporting d	locumentation:	
System consists of a seepage pit,	🗌 Yes* 🛛 No	☑ Pumped at time of inspection		
cesspool, drywell, leaching pit, or other pit?		Name of maintenance I	ousiness:	Pinky's Sewer Service
Sewage tank(s) leak below their	🗌 Yes* 🛛 No	License number of main	s: <u>L1973</u>	
designed operating depth?		Date of maintenance:		5/24/2021
		Existing tank integrity a	ssessment (Attach	ı)
		Date of maintenance		
If yes, which sewage tank(s) leaks:		(mm/dd/yyyy):	(must be within	three years)
Any "yes" answer above indicates the system is failing to protect groundwater.		(See form instructions to ensure assess Minn. R. 7082.0700 subp. 4 B (1))		ent complies with
		Tank is Noncompliant (	pumping not necess	ary – explain below)
		☐ Other:		

Describe verification methods and results:

•

#### 4 of 11

# **3.** Other compliance conditions – Compliance component #3 of 5

5.		
	3a. Maintenance hole covers appear to be structurally unsound (damaged, cracked, etc.), or uns ☐ Yes* ⊠ No ☐ Unknown	secured?
	3b. Other issues (electrical hazards, etc.) to immediately and adversely impact public health or safe	ety? 🗌 Yes* 🛛 No 🗌 Unknown
	*Yes to 3a or 3b - System is an imminent threat to public health and safety.	
	3c. System is non-protective of ground water for other conditions as determined by inspector?	🗌 Yes* 🛛 No
	3d. System not abandoned in accordance with Minn. R. 7080.2500?	🗌 Yes* 🛛 No
	*Yes to 3c or 3d - System is failing to protect groundwater.	
	Describe verification methods and results:	
	Attached supporting documentation: 🛛 Not applicable	
4.	Operating permit and nitrogen BMP* - Compliance component #4 (	of 5 🛛 Not applicable
	Is the system operated under an Operating Permit?	If "yes", A below is required
		•
	Is the system required to employ a Nitrogen BMP specified in the system design?  Yes No	If "yes", B below is required
	BMP = Best Management Practice(s) specified in the system design	
	If the answer to both questions is "no", this section does not need to be complete	ed.
	Compliance criteria:	
	a. Have the operating permit requirements been met?	
	b. Is the required nitrogen BMP in place and properly functioning?	

# Any "no" answer indicates noncompliance.

Describe verification methods and results:

Attached supporting documentation: 
Operating permit (Attach)

## 5 of 11 5. Soil separation – Compliance component #5 of 5

Date of installation	1994 (mm/dd/yyyy)	_ 🗌 Unki	nown		
Shoreland/Wellhead	protection/Food	🗌 Yes	🛛 No	Attached supporting documentation:	
beverage lodging?				$\boxtimes$ Soil observation logs completed for th	e report (Attach)
Compliance criteri		Two previous verifications of required separation ( <i>Attach</i> )		vertical	
5a.For systems built prior to April 1, 1996, and not located in Shoreland or Wellhead		🖾 Yes	🗌 No*	□ Not applicable (No soil treatment area	)
Protection Area or beverage or lodgin				$\boxtimes$ Reviewed design and permit records.	
Drainfield has at le separation distance saturated soil or be					
5b.Non-performance systems built April 1, 1996, or later or for non-performance systems located in Shoreland or Wellhead Protection Areas or serving a food,			🗌 No*	Indicate depths or elevations	
				A. Bottom of distribution media	See Attached Boring Log(s)
beverage, or lodgir	ng establishment:			B. Periodically saturated soil/bedrock	
Drainfield has a thr separation distance				C. System separation	
saturated soil or be			-	D. Required compliance separation*	
				*May be reduced up to 15 percent if allo Ordinance.	wed by Local
systems built unde Type IV or V syste Rules 7080. 2350 d	ms built under 2008 or 7080.2400 or License required) e designed vertical e from periodically	☐ Yes	□ No*		

\*Any "no" answer above indicates the system is failing to protect groundwater.

Describe verification methods and results:

**Upgrade requirements:** (*Minn. Stat.* § 115.55) An imminent threat to public health and safety (ITPHS) must be upgraded, replaced, or its use discontinued within ten months of receipt of this notice or within a shorter period if required by local ordinance. If the system is failing to protect ground water, the system must be upgraded, replaced, or its use discontinued within the time required by local ordinance. If an existing system is not failing as defined in law, and has at least two feet of design soil separation, then the system need not be upgraded, replaced, or its use discontinued, notwithstanding any local ordinance that is more strict. This provision does not apply to systems in shoreland areas, Wellhead Protection Areas, or those used in connection with food, beverage, and lodging establishments as defined in law.

# <u>Midwest Sewer Testing</u> <u>Subsurface Sewage Treatment System Owner/Property Information</u>


This information will be used for the purpose of conducting an MPCA Compliance Inspection.

I his information will be used for the purpose of conducting an MPCA					
Date of Inspection: 5/21/2021 & 5/24/2021	Time: 3:00 PM				
Property Address: 2470 Oriole Ave N, West Lakeland, MN	Zip: 55082				
Property Owner: Teresa Mathieu	Phone: 651-303-8245				
Tank(s)       Tank(s)Material       Soil Treatment System         Septic 2       Fiberglass       Rock trench         Aerobic       Plastic       Gravelless trench         Lift       Metal       Chamber trench         Holding       Concrete       Seepage bed         Other:       Block       Mound         Other       At-grade	Other Alternative system Experimental system Cesspool system Other system				
Are the tank maintenance covers accessible? $\square$ Yes $\square$ No *If	no, proper maintenance must be				
performed through the maintenance holes. Maintenance hole cover	ers should be made accessible to				
the ground surface to facilitate access and proper maintenance of t	he system.				
	Tank size (gals.): 2-1000				
	sidents in home?				
Number of bedrooms?3Are all floors drained by g	<i>.</i>				
Garbage disposal? Whirlpool bath?					
More than one system (laundry, etc.)?					
Does this property have any footing drain tiles connected to the se	ptic system?				
Are any buildings on this property such as garages or out-buildings connected to this system?					
Ano there are additional systems on this monanty serving other has	ildin as 9				
Are there any additional systems on this property serving other bu	lidings?				
Location of septic system on lot? East Side					
	e well a deep well? Y				
Have you ever experienced any problems with the system such as					
surfacing of sewage onto the ground, septic tank overflowing, etc.; or have any repairs been made					
to the system? If yes, explain:					
When was the system last pumped? 5/24/2021   Name of pumper: Pinky's Sewer Service					
How often pumped in previous years?Is system on a monitoring plan?					
Have you received notices from any government agency concerning this system?					
Is your property located in a shoreland management area? N					
Do you have any additional information that should be given to the new owner?					

I hereby certify that the above information is correct to the best of my knowledge. I also understand that if the system is considered "non-compliant/failing" per MPCA rules, that the inspector must by law submit a copy of this report to the local government unit within 15 days of the date of inspection completion. I also agree that unless otherwise noted in this report, that I/we are ultimately responsible for payment of all fees for all work performed relative to this inspection by Inspect Minnesota and Midwest Soil Testing

Owner/Occupant:

7 of 11

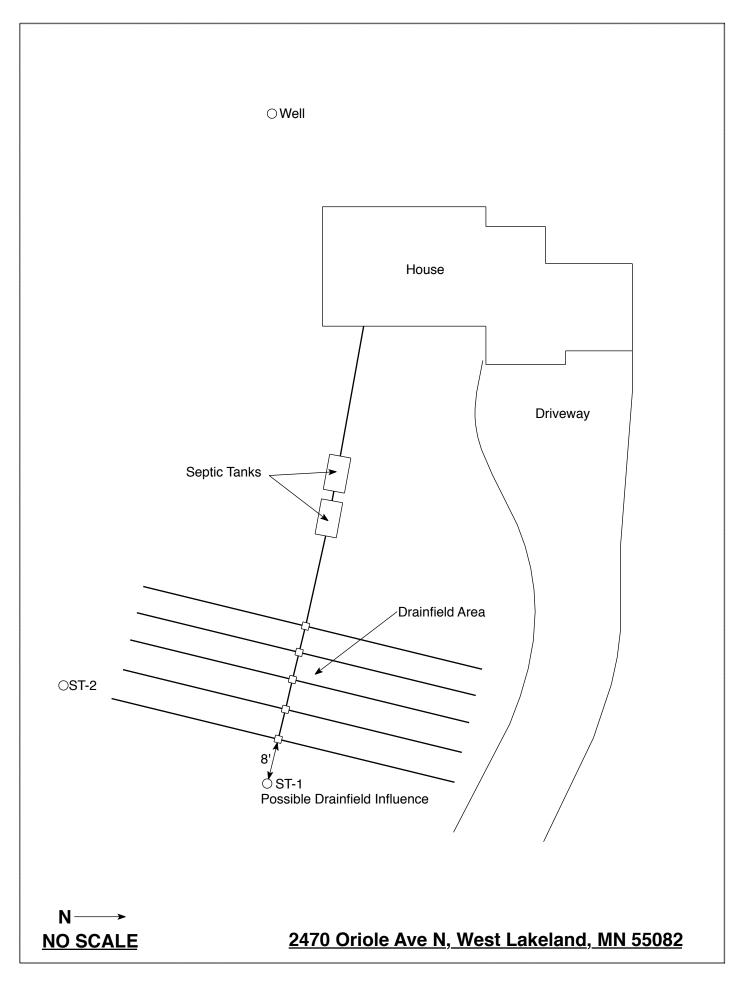

# Soil Observations Log

	Location of Project: 2470 Oriole Ave N, West Lakeland, MN 55082						
Ob	Observations Made By: Midwest Sewer Serv				Date:	5/21/2021	
		ation System:	USDA				
	Soil	Observation:	ST-1		Soil C	bservation:	ST-2
Surf Elevat Observ	ion of	-	nd surface as last Tield trench	Eleva	face tion of vation	-	und surface as last nfield trench
Depth In Inches	Rock %	<u>Soils E</u>	ncountered	Depth In Inches	Rock %	<u>Soils</u>	Encountered
0-23 23-36 36-53 53-58		10YR 4 10YR 4/4 7.5YR 5/8 8 10YR 4/4 Sand	I/2 Silt Loam Silt Loam Silt Loam With 10YR 6/2 Redox Jy Loam (Saturated) ainfield Influence	0-10 10-32 32-42 42-64	≈10 ≈20-30	10YR 4/3 S 10YR 3/4 10YR 3/4 Me	8 4/2 Silt Loam Fandy Clay Loam With Gravel 4 Loamy Fine Sand dium Sand With Gravel efusal At 64"
26"	Dopth T	o End Of Soil O	bearstian Or Boday	64"	Dopth T	a End Of Sail	Observation Or Roday
							Observation Or Redox tion Relative To System
	,			-40"			Distribution Media
				≥24"	Of Sepa		
End	End Of Soil Observation At: 58"			End Of		servation At:	64"
Redox Present At: 36"					x Present At:	None	
Standing Water Present At: None			Standi	ng Wate	r Present At:	None	

Bottom Of Distribution Medium At: 40 Inches

Signature:

Other Ula

تمسيد ..... JOB KFAIT IFFEFERANT

BORING LOG of 11

.

and the second second

DATE 12-14-19-9-

BOREHOLE DIAMETER 21-25 Aug - Aug A

DEPTH FEET	HOLE #1	HOLE #2	HOLE #3	HOLE #4	HOLE #5	HOLE #6
	- DARH BROWN -	DARA GROWIJ	DARK BROWN -	DARA DAGUNI		+
	- Loam -	- Loam -	-0AM			<b>+</b>
			<u>-</u>	GROWN, MEDIUM		
	- BROWN LOAM -			SAND - HEAUY		+- +
2	·	ékowa Lohra	6 Korwa LoAm	איב סאי "2 פרי "י		+
_	- BROWN, MEDIUM-					
	- SANE WITH 12" -	47 C	· ·			
	- 12" Rock	- GROWN, MEDIUM-	• • •	+ +		<u> </u>
	OEFOSITS -	The Marker of				+
4 -	<u> </u>	┼╌ —╡	- Bhows, MEDIUM-			· ·
	- GROWN, SANDY -		SANG WITH	+		<u>_</u>
5		SANC - NEAUS ASE				+
		ROCKS SAVING INTO BH	- ·			+
		- STOP -	-	$\frac{1}{1}$		+
6			••••••••••••••••••••••••••••••••••••••	+ -		
			- STOP			<u>+-</u>
7				STOF	— —	
	- Stop -					
8						+
		+ -	-	+ -	• <b>-</b> .	<u>_</u>
				+ $-$		+
9						+-
		<u>+-</u>		<u> </u>		
10						
	_		-	<u> </u>	-	<u>+</u>

# **DISCLAIMER**

## Brian L. Humpal, Inc. dba. Midwest Sewer Services, Inspect Minnesota, Midwest Soil Testing Relative to Subsurface Sewage Treatment System (SSTS) Compliance Inspections

- 1. This inspection/report is being performed for only the seller/owner of the property on which the SSTS is located. In such case that another party is paying for the inspection, the contract is between only said party and Brian L. Humpal, Inc.; there is no contract between Brian L. Humpal, Inc. and any other party unless otherwise noted.
- 3. Brian L. Humpal, Inc. has not been retained to warranty, guarantee, or certify the proper functioning of the SSTS for any period of time beyond the date of inspection or into the future. Because of the numerous factors (usage, maintenance, soil characteristics, previous failures, etc.) which may affect the proper operation of an SSTS, as well as the inability of Brian L. Humpal, Inc. to supervise or monitor the use or maintenance of the SSTS, the report shall not be construed as a warranty by Brian L. Humpal, Inc. that the SSTS will function properly for any particular party for any period of time.
- 4. Brian L. Humpal, Inc. is unable to verify the frequency and/or, quality of prior or future maintenance of the SSTS. Maintenance of the tank(s) must be performed through the tanks maintenance hole. The removal of solids from any location other than the maintenance hole is not a compliant method of maintenance. It is strongly recommended that maintenance covers be made accessible to the ground surface to facilitate proper maintenance.
- 5. Minimum Compliance Inspection requirements relative to this inspection and this report include <u>only</u> verification that the SSTS has tank(s) (septic tanks, lift tanks, dosing tanks, stilling tanks, etc.) which are watertight below the designed operating depth, the required separation between the bottom of the subsurface soil distribution medium and seasonally saturated soils, no back-ups of sewage into the dwelling, no discharge of sewage/effluent to the ground surface or surface waters, and no imminent safety hazards. Brian L. Humpal, Inc. does not inspect plumbing or pumps prior to the first SSTS component as these are plumbing components. The performance of exterior pumps and associated components are not inspected as they are considered to be maintenance items. Additionally, no indications relative to compliance with electrical code requirements have been made. It is recommended that any other applicable plumbing, electrical, housing, etc. inspections be performed by a qualified inspection business. Sewage back-up verification is limited to observing the floor drain area and/or the information supplied by the last occupants of the building prior to inspection. Brian L. Humpal, Inc. cannot guarantee that the information given to them by the last occupants of the building prior to inspection relative to back-ups is accurate.
- 4. Certification of this SSTS does not warranty future use beyond the date of the inspection. Any SSTS, old or new, can become hydraulically overloaded or discharge sewage/effluent to the ground surface as a result of more people moving into the house than were previously occupying the house, improper maintenance, heavy usage, leaking plumbing fixtures, groundwater infiltration, tree roots, freezing conditions, surface drainage problems, poor initial design, poor construction practices, or unsuitable materials used in constructing the system; the system can also simply stop working because of its age. An SSTS that has been properly designed and installed, properly maintained, and used in the manner for which the system was designed can be expected to provide service for twenty to twenty-five years on average. Some parts of the SSTS such as alarms, switches, pumps, filters, etc. will most likely have to be repaired or replaced over the lifetime of the system.
- 5. A Compliance Inspection is not meant to be a test or inspection for longevity of the system; a Compliance Inspection is strictly for the purpose of determining if the SSTS is protective of public health and safety, as well as the groundwater at the date and time the inspection was performed. This inspection is not intended to determine if the SSTS was originally designed or installed to past or present MPCA or other Local Government Unit code requirements. This inspection is not intended to determine if the SSTS was designed and/or installed to support the anticipated flow from the building as the use of the building may have changed since the design and construction of the SSTS due to the addition of bedrooms, occupants, etc. In addition, this inspection is not intended to determine the quality of the original SSTS design, the quality of the construction practices used while installing the SSTS, or the quality of the materials used in constructing the SSTS.
- 6. Brian L. Humpal, Inc. cannot guarantee the performance of SSTS products/components such as: gravelless pipe, chamber trenches, effluent filters, tanks, sewage pre-treatment components, piping, etc. Products such as gravelless pipe are no longer approved for installation in the State of Minnesota and may have a significantly reduced performance and/or life expectancy.
- 7. WINTER WORK: By accepting this report, it is understood that inspections conducted during winter months (approximately November 1<sup>st</sup> through April 1<sup>st</sup>) are more difficult to perform because of possible snow cover and/or ground frost. SSTS components such as tanks, maintenance covers, tank inspection pipes, subsurface distribution medium inspection pipes, and soil treatment areas are more difficult or impossible to locate due to snow cover and/or ground frost. In addition, soil borings are more difficult to perform due to snow cover and/or ground frost. Brian L. Humpal, Inc. will attempt to use the same level of standards when performing work during winter periods as when performing work during non-winter periods. However, the recipient of this report understands that because of the aforementioned considerations, the same level of standards may not be possible.
- 8. By accepting this report, the client understands that Brian L. Humpal, Inc. will not be responsible for any monetary damages exceeding the fee for the services provided.

# Subsurface Sewage Treatment Systems Mon-transferable Business License

# **Midwest Sewer Services**

License # L2896

License Expires: 12/22/2021

Issued: 11/06/2020

# **Specialty Area(s):**

Installer Maintainer Service Provider Advanced Designer Advanced Inspector

# **Designated Certified Individual(s):**

Cert #	Name	Certification Expires
C5342	Brian L Humpal	10/15/2023
	Installer, Maintainer, Serv Prov,	Adv Designer, Adv Inspector
C9852	Christopher R Uebe	3/4/2024
	Designer, Inspector	



520 Lafayette Road North St. Paul, Minnesota 55155-4194

Mich Haig

Nick Haig, Supervisor Certification and Training Unit