Inspect Minnesota & Midwest Soil Testing

P.O. Box 383 Hugo, MN 55038

Brian Humpal

651-492-7550/Brian@midwestsoiltesting.com

MPCA Licensed Designer & Inspector

SUBSURFACE SEWAGE TREATMENT SYSTEM COMPLIANCE REPORT

Inspection Address: 6120 Lake Elmo Ave N, Grant, MN 55082

REPORT SUMMARY

I have performed an "MPCA Compliance Inspection" on this septic system and have reviewed the original design/permit records on file at Washington County. This older system consists of a pre-cast septic tank and a rock trench drainfield, which was installed in 1992. A third rock trench was added in 1997.

My inspection indicates that this system is presently "non-compliant" in accordance with MPCA rules 7080.1500 Subp.4(B)(D) because of the lack of the required three foot separation between the bottom of the drainfield and seasonally saturated soils. This system is also an imminent threat to public safety per MPCA rule 7080.1500 Subp. 4(A) because of the unsafe manhole cover on the septic tank. Washington County issued sewage treatment permit #87-92069 & 87-97086 for the installation of this septic system.

In accordance with MPCA rules, I am sending a copy of this complete report to Washington County. I cannot officially speak on behalf of the County relative to the upgrade requirements of these non-compliant systems. Please contact Washington County Environmental Specialist, Mr. Chris LeClair (651-430-4052), to verify the County's position.

Please advise buyer, agents, lender, etc. to contact me should they have any questions regarding this system.

Brian Humnal



St. Paul, MN 55155-4194

Compliance Inspection Form

Existing Subsurface Sewage Treatment Systems (SSTS)

Doc Type: Compliance and Enforcement

	, , , , , , , , , , , , , , , , , , ,				
nstructions: Inspection results based on Minnesota Pollution Control Agency (MPCA) requirements and attached forms – additional local requirements may also apply.					
Submit completed form to Local Unit of Government (LUG) and system owner within 15 days					
System Status					
System status on date (mm/dd/yyyy): 9/13/2016					
	mpliant – Notice of Noncompliance grade Requirements on page 3)				
Reason(s) for noncompliance (check all applicable)					
 Impact on Public Health (Compliance Component #1) – Imminent threat ☑ Other Compliance Conditions (Compliance Component #3) – Imminent th ☐ Tank Integrity (Compliance Component #2) – Failing to protect groundwa ☐ Other Compliance Conditions (Compliance Component #3) – Failing to protect groundwa ☑ Soil Separation (Compliance Component #4) – Failing to protect groundwa ☐ Operating permit/monitoring plan requirements (Compliance Component 	reat to public health and safety ater rotect groundwater vater				
Property Information Parcel ID# or Sec/Twp/Rar	nge:				
·	for inspection: Property Sale				
· · · · · · · · · · · · · · · · · · ·	phone: 651-235-7954				
or					
· · · · · · · · · · · · · · · · · · ·	ntative phone:				
· · · · · · · · · · · · · · · · · · ·	ory authority phone: 651-430-4052				
Brief system description: Pre-cast septic tank and rock trench drainfield. Comments or recommendations:					
Manhole does not currently fit the riser correctly and is unsafe.					
Certification					
I hereby certify that all the necessary information has been gathered to determine the determination of future system performance has been nor can be made due to unknown possible abuse of the system, inadequate maintenance, or future water usage.					
Inspector name: Brian Humpal Certifica	tion number: L5342				
	nse number: _L2896				
Inspector signature: Brian Humpal Ph	one number: 651-492-7550				
Necessary or Locally Required Attachments					
	r local ordinance				
☐ Other information (list): Report Summary, Property Information, Disclaimer, Li					

1.	lm	Impact on Public Health - Compliance component #1 of 5			
	Sy gro	stem discharge sewage to the bund surface. stem discharge sewage to drain tile surface waters. stem cause sewage backup into relling or establishment. ny "yes" answer above indicates a Imminent Threat to Public Heal of the above found.	_	Verification method(s): Searched for surface outlet Searched for seeping in yard/backup in home Excessive ponding in soil system/D-boxes Homeowner testimony (See Comments/Explanation) "Black soil" above soil dispersal system System requires "emergency" pumping Performed dye test Unable to verify (See Comments/Explanation) Other methods not listed (See Comments/Explanation)	
2.	Ta	ank Integrity — Compliance con	nponent #2 of 5		
3.	Sy ces Se con Se de If y Au Sy	stem consists of a seepage pit, sspool, drywell, or leaching pit. sepage pits meeting 7080.2550 may be impliant if allowed in local ordinance. wage tank(s) leak below their signed operating depth. yes, which sewage tank(s) leaks: ny "yes" answer above indicates the impliant is Failing to Protect Green is Failing to Protect Green is were an underwater camera into tank - leacher the compliance Conditions	oundwater. baffles and tank walls		
	a. Maintenance hole covers are damaged, cracked, unsecured, or appear to structurally unsound. ⊠ Yes* ☐ No ☐ Unknown				
	b. Other issues (electrical hazards, etc.) to immediately and adversely impact public health or safety. ☐ Yes* ☒ No ☐ Unknown *System is an imminent threat to public health and safety				
	C.	 Explain: c. System is non-protective of ground water for other conditions as determined by inspector ☐ Yes* ☒ No *System is failing to protect groundwater Explain: 			

Property address: 6120 Lake Elmo Ave N, Grant, MN 55082

Inspector initials/Date: 9/13/2016

www.pca.state.mn.us • 651-296-6300 • 800-657-3864 • 3 of TTY 651-282-5332 or 800-657-3864 • Available in alternative formats wq-wwists4-31 • 1/24/12 Page 2 of 3

1.	Soil Separation – Compliance compor	nent #4 of 5			
	Date of installation: 1992/1997	Unknown	Verification method(s):		
	Shoreland/Wellhead protection/Food Beverage Lodging?	⊠ Yes □ No S		Soil observation does not expire. Previous soil	
	Compliance criteria:		observations by two independent pa unless site conditions have been alt		
	For systems built prior to April 1, 1996, and not located in Shoreland or Wellhead Protection Area or not serving a food, beverage or lodging establishment:	☐ Yes ☐ No	requirements differ. Conducted soil observation(s) (Attach boring Two previous verifications (Attach boring log Not applicable (Holding tank(s), no drainfield)	h boring logs)	
	Drainfield has at least a two-foot vertical separation distance from periodically saturated soil or bedrock.		☐ Unable to verify (See Comments/b ☐ Other (See Comments/Explanation)	Explanation)	
	Non-performance systems built April 1, 1996, or later or for non-performance systems located in Shoreland or Wellhead Protection Areas or serving a food, beverage, or lodging establishment:	☐ Yes No	Comments/Explanation:		
	Drainfield has a three-foot vertical separation distance from periodically saturated soil or bedrock.*		_		
	"Experimental", "Other", or "Performance"	☐ Yes ☐ No	Indicate depths of elevations		
	systems built under pre-2008 Rules; Type IV or V systems built under 2008 Rules (7080. 2350 or 7080.2400 (Advanced Inspector License required)		A. Bottom of distribution media	See Attached Boring Log(s)	
	Drainfield meets the designed vertical separation distance from periodically saturated soil or bedrock.		B. Periodically saturated soil/bedrock C. System separation		
			D. Required compliance separation*		
	Any "no" answer above indicates the system is Failing to Protect Groundwater. *May be reduced up to 15 percent if allowed by Local Ordinance.				
5.	Operating Permit and Nitrogen B	MP* – Complianc	e component #5 of 5 Not appl	icable	
	Is the system operated under an Operating Permit?				
	Is the system required to employ a Nitrogen BMP?				
	BMP=Best Management Practice(s) specified in the system design				
	If the answer to both questions is "no", this section does not need to be completed.				
	Compliance criteria				
	a. Operating Permit number:	☐ Yes ☐ No			
	Have the Operating Permit requirements I				
b. Is the required nitrogen BMP in place and properly functioning?			?		
	Any "no" answer indicates Noncompliance.				

Property address: 6120 Lake Elmo Ave N, Grant, MN 55082

Upgrade Requirements (Minn. Stat. § 115.55) An imminent threat to public health and safety (ITPHS) must be upgraded, replaced, or its use discontinued within ten months of receipt of this notice or within a shorter period if required by local ordinance. If the system is failing to protect ground water, the system must be upgraded, replaced, or its use discontinued within the time required by local ordinance. If an existing system is not failing as defined in law, and has at least two feet of design soil separation, then the system need not be upgraded, repaired, replaced, or its use discontinued, notwithstanding any local ordinance that is more strict. This provision does not apply to systems in shoreland areas, Wellhead Protection Areas, or those used in connection with food, beverage, and lodging establishments as defined in law.

www.pca.state.mn.us • 651-296-6300 • wq-wwists4-31 • 1/24/12 Page 3 of 3

Inspector initials/Date: 9/13/2016

Inspect Minnesota & Midwest Soil Testing

Subsurface Sewage Treatment System Owner/Property Information This information will be used for the purpose of conducting an MPCA Compliance Inspection.

Date of Inspection: September 13, 2016	Time: 9:30 AM		
Property Address: 6120 Lake Elmo Ave N, Grant, MN	Zip: 55082		
Property Owner: Joe Plumbo	Phone: 651-235-7954		
Tank(s) Tank(s)Material Soil Treatment System Septic 1 Fiberglass ⊠Rock trench Aerobic Plastic Gravelless trench Lift Metal Chamber trench Holding ⊠Concrete Seepage bed Other: Block Mound Other At-grade	Other Alternative system Experimental system Cesspool system Other system		
Are the tank maintenance covers accessible? Yes No *If no, proper maintenance must be performed through the maintenance holes. Maintenance hole covers should be made accessible to the ground surface to facilitate access and proper maintenance of the system.			
	Γank size (gals.): 1200		
	sidents in home?		
Number of bedrooms? 3 Are all floors drained by g			
Garbage disposal? N Whirlpool bath?	Y		
More than one system (laundry, etc.)?			
Does this property have any footing drain tiles connected to the se	ptic system?		
Are any buildings on this property such as garages or out-buildings connected to this system?			
Are there any additional systems on this property serving other buildings?			
Location of septic system on lot? West Side			
	e well a deep well? Y		
Have you ever experienced any problems with the system such as: tree roots, sewage back-ups, surfacing of sewage onto the ground, septic tank overflowing, etc.; or have any repairs been made to the system? If yes, explain:			
When was the system last pumped? 2013 Name of pum	1		
	on a monitoring plan?		
Have you received notices from any government agency concerning this system?			
Is your property located in a shoreland management area? N			
Do you have any additional information that should be given to the new owner?			
I hereby certify that the above information is correct to the best of my knowledge. I also understand that if the system is considered "non-compliant/failing" per MPCA rules, that the inspector must by law submit a copy of this report to the local government unit within 15 days of the date of inspection completion. I also agree that unless otherwise noted in this report, that I/we are ultimately responsible for payment of all fees for all work performed relative to this inspection by Inspect Minnesota and Midwest Soil Testing.			
Owner/Occupant:	Date:		



* WASHINGTON COUNTY, MINNESOTA

Department of Health, Environment, and Land Management 612/430-6708

GRAHT CITY

PERMIT NUMBER

8797086

SEWAGE PERMIT

Owner :

JOSEPH/DONNA

PLUHBO

6120 LAKE ELMO AVE H

STILLWATER

101

55082

Applicant : JOSEPH/DONNA

PLUNBO

612-351-7194

DRAINFIELD REPLACEMENT PERMIT

Total Fees :

Total Paid :

Total Duo :

70.00 70.00

.00

70.00

PERMISSION IS HEREBY GRANTED

To execute the work specified in this permit on the following described property upon express condition that said persons and their agents, employees and workmen shall conform in all respects to the provisions of the Building Code, and/or Ordinances.

This permit may be revoked at any time upon the violation of any of the provisions of eald code and ordinances.

Project Address :

6120 LAKE ELNO AVE H

STILLWATER

55082

Flow Capacity

450 Gal/Day

Soil Conditions: Depth to Restriction

72 Inches

Perc Rate

9 Hin/Inch

Soil Treatment Area Type:

In Ground Y In Fill H Bod N Drain Field Y

Authorized Hork / Special Conditions

- Install individual sewage treatment cystom as per approved design in area tested and shown on site plan.
- THIS SYSTEM MUST BE INSTALLED BY A CERTIFIED/LICENSED SEWAGE TREATMENT SYSTEM INSTALLER HOLDING A CURRENT LICENSE WITH THE HIMMESOTA POLLUTION CONTROL AGENCY. (A list of installers is available at your request.)
- ~ Install additional 190 sq. ft. of drainfield to account added bedroom.

** Permit Expiration Dato :

Sewage Treatment : 6/12/98

A CERTIFICATE OF OCCUPANCY MUST BE REQUESTED AND ISSUED PRIOR TO USE OR OCCUPANCY OF WORK PERMITTED BY A BUILDING PERNIT.

** This pormit chall expire and be null and void if the work authorized by the Building Permit is not commenced within 60 days of the date of issuance or if work is abandoned or suspended for a period of 120 days. Term of the Building Permit is 12 months from date of issue. Term of sewage treatment permit is 6 months from date of issue.

Penalty for violation of any of the provisions of building code: Fino not to exceed five hundred dollars (\$500.00) or imprisionment for not more than ninety (90) days, or both.

Pormit Issue Date 6/12/97 Code Enforcement Officer



WASHINGTON COUNTY, MINNESOTA Department of Public Health

specific helder or

PERMIT NUMBER

ag tastija je bij onishi, a sadi i

Colorate religion and the Aris 1881

griphical American States Salata Ale

halver in their their are

paneagh theatheast grother promit

1011 1 200 B

'n Chair Parite S

reduct date

190,00

TO A STATE OF THE STATE OF THE

The property of the continue of the square party and the period of the more than the المسائلية والمناز والمنازات

the free month with the field of the fill of the tight of the son that he of

The first of the said of the first and containing Him grouped and to highward want to him to his on highly marked by

بأضبطه المطافلة أيجرأ أمطوه

ា សម្បីស្រាស់ ស្រាស់ ស្រាស់ស្រាស់ស្រាស់ errecipiest Schillerich.

Plant Shipped Max

don't complete process applicable to the comment with a

mest of historial areas a sufficient

The properties the reserve to be the top of the state of the

Stitutur grant problem of Figure April Williams Co.

े विकास की कार करते हुं होता कर दिलाई है कहा के ही हुन कर किया है कि साम कर कर कार सीमा है है है

made tell of moch that tober spraying miles

gration for gratition wind a then the a methodo delection

interestigate extra things of a completion

tote to new tetriff may reclediff trails for diffusions from others, compet

represent the interest and bunit beaths but here.

Three says full distribit to the transfer of the control of the said the इंदर्डिक प्रकार मुद्दाको देश गाले एक्ट्रेस्ट्राक प्रदासका की दे दास्त्राक्षण

Lagragian of the examination of country. The trace of the most

Paparit tope and area with the up rough from the

system though in done both althou you a builtage officianish !

scribban descripted the a schilleren house a frequency ij i

sageful this will have been down . .

and response Experience constitution of the Constitution of the Land

a excepted three for the country course, and proposition was related by before our play by considering an book a known will

BTO L BUILDING PERMITS . . .


to this mersuit whall expluit and the meet and send at the cents and book see by the dealding formet as hot commenced territo 50 days of the days of facinards to be and the boundaried or manufactor for a period of 120 days. Term of the forthis beingt of 12 months aron date of legite. Term of expanse treatment. poralt in 6 menths from direct bests of

Panalty for a folal tomat mix or the greathlone of hurlding cane; Fine and by execut fire limited districts (3500 our in amice mountains the min were that almost every differ her both

Paralle Trans Date 5717/07

Cotto Environment Office

7 of 11

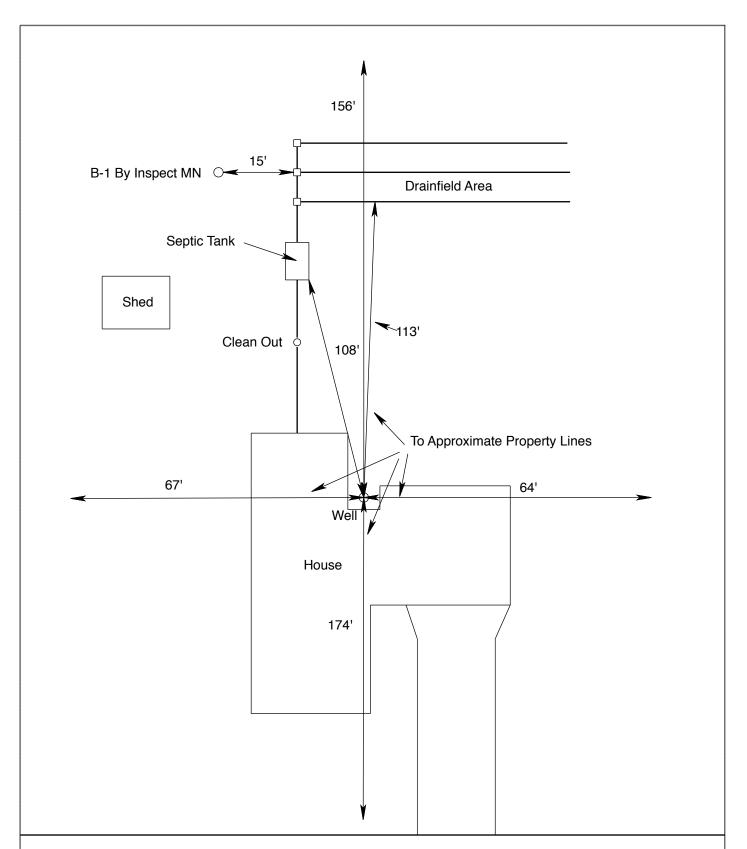

6120 Lake Elmo Ave N, Grant, MN 55082

Log Of Soil Borings

Loca	Location of Project: 6120 Lake Elmo Ave N, Grant, MN 55082				
	Borings Made By: Inspect Minnesota			Date:	9/13/16
	Auger Used:	Hand/Bucket	Classi	ification System:	USDA
E	Boring Number:	1		Boring Number:	
Surface Same ground surface as last drainfield trench		Surface Elevation Boring			
Depth In Inches	Soils E	ncountered	Depth In Inches	Soils Er	ncountered
	10YR 4/4 Sa 10YR 4/4 10YR 4/4 Mediu ≈10-15% 10YR 4/4 Medium S ≈10-15% And Sandy I 10YR 5/2 &	2 Sandy Loam ndy Loam (Moist) Medium Sand um Sand With Gravel Rock fragments Sand (Moist) With Gravel Rock Fragments Loam Pieces With 7.5YR 6/8 redox			
74" [Depth To End Of B	oring Or Redox		Depth To End Of Bo	oring Or Redox
Same Elevation Of Boring Relative To System			Elevation Of Boring	Relative To System	
-52" Depth To Bottom Of Distribution Media =22" Of Separation			Depth To Bottom C Of Separation	of Distribution Media	
E	End Of Boring At:	89"		End Of Boring At:	
	Redox Present At:	74"		Redox Present At:	
Standing V	Water Present At:	None	Standing	Water Present At:	

Bottom Of Distribution Medium At	:: 52 Inches

DISCLAIMER

Brian L. Humpal, Inc. dba. Inspect Minnesota, Midwest Soil Testing Relative to Subsurface Sewage Treatment System (SSTS) Compliance Inspections

- 1. This inspection/report is being performed for only the seller/owner of the property on which the SSTS is located. In such case that another party is paying for the inspection, the contract is between only said party and Brian L. Humpal, Inc.; there is no contract between Brian L. Humpal, Inc. and any other party unless otherwise noted.
- 3. Brian L. Humpal, Inc. has not been retained to warranty, guarantee, or certify the proper functioning of the SSTS for any period of time beyond the date of inspection or into the future. Because of the numerous factors (usage, maintenance, soil characteristics, previous failures, etc.) which may affect the proper operation of an SSTS, as well as the inability of Brian L. Humpal, Inc. to supervise or monitor the use or maintenance of the SSTS, the report shall not be construed as a warranty by Brian L. Humpal, Inc. that the SSTS will function properly for any particular party for any period of time.
- 4. Brian L. Humpal, Inc. is unable to verify the frequency and/or, quality of prior or future maintenance of the SSTS. Maintenance of the tank(s) must be performed through the tanks maintenance hole. The removal of solids from any location other than the maintenance hole is not a compliant method of maintenance. It is strongly recommended that maintenance covers be made accessible to the ground surface to facilitate proper maintenance.
- 5. Minimum Compliance Inspection requirements relative to this inspection and this report include <u>only</u> verification that the SSTS has tank(s) (septic tanks, lift tanks, dosing tanks, stilling tanks, etc.) which are watertight below the designed operating depth, the required separation between the bottom of the subsurface soil distribution medium and seasonally saturated soils, no back-ups of sewage into the dwelling, no discharge of sewage/effluent to the ground surface or surface waters, and no imminent safety hazards. Brian L. Humpal, Inc. does not inspect plumbing or pumps prior to the first SSTS component as these are plumbing components. The performance of exterior pumps and associated components are not inspected as they are considered to be maintenance items. Additionally, no indications relative to compliance with electrical code requirements have been made. It is recommended that any other applicable plumbing, electrical, housing, etc. inspections be performed by a qualified inspection business. Sewage back-up verification is limited to observing the floor drain area and/or the information supplied by the last occupants of the building prior to inspection. Brian L. Humpal, Inc. cannot guarantee that the information given to them by the last occupants of the building prior to inspection relative to back-ups is accurate.
- 4. Certification of this SSTS does not warranty future use beyond the date of the inspection. Any SSTS, old or new, can become hydraulically overloaded or discharge sewage/effluent to the ground surface as a result of more people moving into the house than were previously occupying the house, improper maintenance, heavy usage, leaking plumbing fixtures, groundwater infiltration, tree roots, freezing conditions, surface drainage problems, poor initial design, poor construction practices, or unsuitable materials used in constructing the system; the system can also simply stop working because of its age. An SSTS that has been properly designed and installed, properly maintained, and used in the manner for which the system was designed can be expected to provide service for twenty to twenty-five years on average. Some parts of the SSTS such as alarms, switches, pumps, filters, etc. will most likely have to be repaired or replaced over the lifetime of the system.
- 5. A Compliance Inspection is not meant to be a test or inspection for longevity of the system; a Compliance Inspection is strictly for the purpose of determining if the SSTS is protective of public health and safety, as well as the groundwater at the date and time the inspection was performed. This inspection is not intended to determine if the SSTS was originally designed or installed to past or present MPCA or other Local Government Unit code requirements. This inspection is not intended to determine if the SSTS was designed and/or installed to support the anticipated flow from the building as the use of the building may have changed since the design and construction of the SSTS due to the addition of bedrooms, occupants, etc. In addition, this inspection is not intended to determine the quality of the original SSTS design, the quality of the construction practices used while installing the SSTS, or the quality of the materials used in constructing the SSTS.
- 6. Brian L. Humpal, Inc. cannot guarantee the performance of SSTS products/components such as: gravelless pipe, chamber trenches, effluent filters, tanks, sewage pre-treatment components, piping, etc. Products such as gravelless pipe are no longer approved for installation in the State of Minnesota and may have a significantly reduced performance and/or life expectancy.
- 7. WINTER WORK: By accepting this report, it is understood that inspections conducted during winter months (approximately November 1st through April 1st) are more difficult to perform because of possible snow cover and/or ground frost. SSTS components such as tanks, maintenance covers, tank inspection pipes, subsurface distribution medium inspection pipes, and soil treatment areas are more difficult or impossible to locate due to snow cover and/or ground frost. In addition, soil borings are more difficult to perform due to snow cover and/or ground frost. Brian L. Humpal, Inc. will attempt to use the same level of standards when performing work during winter periods as when performing work during non-winter periods. However, the recipient of this report understands that because of the aforementioned considerations, the same level of standards may not be possible.
- 8. By accepting this report, the client understands that Brian L. Humpal, Inc. will not be responsible for any monetary damages exceeding the fee for the services provided.

Sulbsurface Sewage Treatment Systems

Non-transferable



License # L2896

Maintainer License Expires: Installer License Expires: Date of Issuance:

Adv Inspector License Expires:

Oct 28, 2015 Dec 22, 2016 Dec 22, 2016 Dec 22, 2016 Dec 22, 2016

Adv Designer License Expires:

Inspect Minnesota, Midwest Soil Testing

Certification

Expires

10/15/2017 10/15/2017 10/15/2017 10/15/2017 10/15/2017

tified	E
d Ce	9
gnate	vidua
Desi	Indi

Brian L. Humpal

Brian L. Humpal

Advanced Designer (Certified) Advanced Inspector (Certified)

Maintainer (Certified)

Certification Type

Brian L. Humpal

Brian L. Humpal

Christopher R. Uebe Brian L. Humpal

Christopher R. Uebe

Service Provider (Certified) Installer (Certified)

Designer (Certified)

Inspector (Certified)

03/04/2018 03/04/2018

Environmental Business Assistance Section Steven Giddings Manager



Minnesota Pollution Control Agency

520 Lafayette Road North St. Paul, Minnesota 55155-4194