

520 Lafayette Road North St. Paul, MN 55155-4194

## Compliance inspection report form

## Existing Subsurface Sewage Treatment System (SSTS)

Doc Type: Compliance and Enforcement

final determination of compliance or noncompliance. Instructions for filling out this form are located on the Minnesota Pollution Control Agency (MPCA) website at **Property information** Local tracking number: Parcel ID# or Sec/Twp/Range: 1102820340117 Sale of property Reason for Inspection Local regulatory authority info: Washington County Property address: 1877 QUASAR AVE S, CITY OF LAKE ST CROIX BEACH Owner's phone: 651-436-6272 Owner/representative: Linda Geare Brief system description: Two septic tanks gravity fed to drainfield System status System status on date (mm/dd/yyyy): 9/20/2023 Noncompliant - Notice of noncompliance □ Compliant – Certificate of compliance\* (Valid for 3 years from report date unless evidence of an Systems failing to protect ground water must be upgraded, replaced, or imminent threat to public health or safety requiring removal and use discontinued within the time required by local ordinance. abatement under section 145A.04, subdivision 8 is discovered or An imminent threat to public health and safety (ITPHS) must be a shorter time frame exists in Local Ordinance.) upgraded, replaced, or its use discontinued within ten months of receipt \*Note: Compliance indicates conformance with Minn. of this notice or within a shorter period if required by local ordinance or R. 7080.1500 as of system status date above and does not under section 145A.04 subdivision 8. guarantee future performance. Reason(s) for noncompliance (check all applicable) Impact on public health (Compliance component #1) - Imminent threat to public health and safety ☐ Tank integrity (Compliance component #2) – Failing to protect groundwater Other Compliance Conditions (Compliance component #3) – Imminent threat to public health and safety Other Compliance Conditions (Compliance component #3) - Failing to protect groundwater System not abandoned according to Minn. R. 7080.2500 (Compliance component #3) - Failing to protect groundwater Soil separation (Compliance component #5) - Failing to protect groundwater Operating permit/monitoring plan requirements (Compliance component #4) - Noncompliant - local ordinance applies Comments or recommendations Certification I hereby certify that all the necessary information has been gathered to determine the compliance status of this system. No determination of future system performance has been nor can be made due to unknown conditions during system construction, possible abuse of the system, inadequate maintenance, or future water usage. By typing my name below, I certify the above statements to be true and correct, to the best of my knowledge, and that this information can be used for the purpose of processing this form. Business name: SS Septic Solutions, LLC. Certification number: 9917 Inspector signature: License number: 4137 his document has been electronically signed) Phone: 651-343-9117 Necessary or locally required supporting documentation ☐ Soil observation logs ☐ System/As-Built ☐ Locally required forms ☐ Tank Integrity Assessment Operating Permit Other information (list):

Instructions: Inspector must submit completed form to Local Governmental Unit (LCU) and system such a 15 days

Compliance criteria:			Attached supporting documentation:
System discharges sewage to the ground surface	☐ Yes*	⊠ No	☐ Other: ☐ Not applicable
System discharges sewage to drain tile or surface waters.	☐ Yes	⊠ No	
System causes sewage backup into dwelling or establishment.	☐ Yes	⊠ No	
Any "ves" answer above indicates imminent threat to public health ar		em is an	
Describe verification methods and	l results:		
	7.0		
ank integrity — Compliance Compliance criteria:	7.0		
ank integrity — Compliance  Compliance criteria:  System consists of a seepage pit,	7.0	nent #2	of 5
ank integrity — Compliance Compliance criteria:	compo	nent #2	of 5  Attached supporting documentation:
ank integrity — Compliance  Compliance criteria:  System consists of a seepage pit, cesspool, drywell, leaching pit, or other pit?  Sewage tank(s) leak below their	compo	nent #2	of 5  Attached supporting documentation:  ⊠ Empty tank(s) viewed by inspector
ank integrity — Compliance Compliance criteria:  System consists of a seepage pit, cesspool, drywell, leaching pit, or other pit?	compo	nent #2	of 5  Attached supporting documentation:  ☑ Empty tank(s) viewed by inspector  Name of maintenance business:  Meyers
Compliance criteria:  System consists of a seepage pit, cesspool, drywell, leaching pit, or other pit?  Sewage tank(s) leak below their	compo	nent #2	of 5  Attached supporting documentation:  ⊠ Empty tank(s) viewed by inspector  Name of maintenance business:  License number of maintenance business:
Compliance criteria:  System consists of a seepage pit, cesspool, drywell, leaching pit, or other pit?  Sewage tank(s) leak below their designed operating depth?	compo	nent #2	Attached supporting documentation:  ☐ Empty tank(s) viewed by inspector  Name of maintenance business:  License number of maintenance business:  Date of maintenance:  9/20/2023  ☐ Existing tank integrity assessment (Attach)  Date of maintenance
Compliance criteria:  System consists of a seepage pit, cesspool, drywell, leaching pit, or other pit?  Sewage tank(s) leak below their designed operating depth?  If yes, which sewage tank(s) leaks:  Anv "ves" answer above indic	compose Yes	onent #2 d  No  No	Attached supporting documentation:  Empty tank(s) viewed by inspector  Name of maintenance business:  License number of maintenance business:  Date of maintenance:  Existing tank integrity assessment (Attach)  Date of maintenance (mm/dd/yyyy):  (See form instructions to ensure assessment complies)
Compliance criteria:  System consists of a seepage pit, cesspool, drywell, leaching pit, or other pit?  Sewage tank(s) leak below their designed operating depth?  If yes, which sewage tank(s) leaks:	compose Yes	onent #2 d  No  No	Attached supporting documentation:  Empty tank(s) viewed by inspector  Name of maintenance business:  License number of maintenance business:  Date of maintenance:  Existing tank integrity assessment (Attach)  Date of maintenance  (mm/dd/yyyy):  (must be within three years)
Compliance criteria:  System consists of a seepage pit, cesspool, drywell, leaching pit, or other pit?  Sewage tank(s) leak below their designed operating depth?  If yes, which sewage tank(s) leaks:  Anv "ves" answer above indic	compose Yes	onent #2 d  No  No	Attached supporting documentation:  Empty tank(s) viewed by inspector  Name of maintenance business:  License number of maintenance business:  Date of maintenance:  Existing tank integrity assessment (Attach)  Date of maintenance (mm/dd/yyyy):  (See form instructions to ensure assessment complies Minn. R. 7082.0700 subp. 4 B (1))
Compliance criteria:  System consists of a seepage pit, cesspool, drywell, leaching pit, or other pit?  Sewage tank(s) leak below their designed operating depth?  If yes, which sewage tank(s) leaks:  Anv "ves" answer above indic	compo	onent #2  ⊠ No  svstem	Attached supporting documentation:  Empty tank(s) viewed by inspector  Name of maintenance business:  License number of maintenance business:  Date of maintenance:  Existing tank integrity assessment (Attach)  Date of maintenance (mm/dd/yyyy):  (See form instructions to ensure assessment complies Minn. R. 7082.0700 subp. 4 B (1))  Tank is Noncompliant (pumping not necessary – explain be
Compliance criteria:  System consists of a seepage pit, cesspool, drywell, leaching pit, or other pit?  Sewage tank(s) leak below their designed operating depth?  If yes, which sewage tank(s) leaks:  Anv "ves" answer above indicus talling to protect groungwate	Yes Yes d results:	onent #2 (  ☑ No  ☑ No  svstem	Attached supporting documentation:  Empty tank(s) viewed by inspector  Name of maintenance business:  License number of maintenance business:  Date of maintenance:  Existing tank integrity assessment (Attach)  Date of maintenance (mm/dd/yyyy):  (See form instructions to ensure assessment complies Minn. R. 7082.0700 subp. 4 B (1))  Tank is Noncompliant (pumping not necessary – explain b  Other:
Compliance criteria:  System consists of a seepage pit, cesspool, drywell, leaching pit, or other pit?  Sewage tank(s) leak below their designed operating depth?  If yes, which sewage tank(s) leaks:  Anv "ves" answer above indicus ranna to protect arounawate.	Yes Yes d results:	onent #2 (  ☑ No  ☑ No  svstem	Attached supporting documentation:  Empty tank(s) viewed by inspector  Name of maintenance business:  License number of maintenance business:  Date of maintenance:  Existing tank integrity assessment (Attach)  Date of maintenance (mm/dd/yyyy):  (See form instructions to ensure assessment complies Minn. R. 7082.0700 subp. 4 B (1))  Tank is Noncompliant (pumping not necessary – explain b  Other:
Compliance criteria:  System consists of a seepage pit, cesspool, drywell, leaching pit, or other pit?  Sewage tank(s) leak below their designed operating depth?  If yes, which sewage tank(s) leaks:  Anv "ves" answer above indicus ranna to protect arounawate.	Yes Yes d results:	onent #2 (  ☑ No  ☑ No  svstem	Attached supporting documentation:  Empty tank(s) viewed by inspector  Name of maintenance business:  License number of maintenance business:  Date of maintenance:  Existing tank integrity assessment (Attach)  Date of maintenance (mm/dd/yyyy):  (See form instructions to ensure assessment complies Minn. R. 7082.0700 subp. 4 B (1))  Tank is Noncompliant (pumping not necessary – explain b  Other:

	Property Address: 1877 QUASAR AVE S, CITY OF LAKE ST CROIX BEACH Susiness Name: SS Septic Solutions, LLC.	Date: 9/20/2023
3.	Other compliance conditions – Compliance component #3 of 5	
	3a. Maintenance hole covers appear to be structurally unsound (damaged, cracked, etc.), or unse ☐ Yes* ☒ No ☐ Unknown	cured?
	3b. Other issues (electrical hazards, etc.) to immediately and adversely impact public health or safety	y? ☐ Yes ⊠ No ☐ Unknown
	*Yes to 3a or 3b - System is an imminent threat to public health and safety.	
	3c. System is non-protective of ground water for other conditions as determined by inspector?	☐ Yes* ⊠ No
	3d. System not abandoned in accordance with Minn. R. 7080.2500?	☐ Yes* ⊠ No
	"Yes to 3c or 3a - System is failing to protect groundwater.	
	Describe verification methods and results:	
		A.
	Attached supporting documentation:   Not applicable	
ł.	Operating permit and nitrogen BMP* - Compliance component #4 or	f 5 Not applicable
1.		
1.	Is the system operated under an Operating Permit? ☐ Yes ☐ No I	f "yes", A below is required
1.	Is the system operated under an Operating Permit? ☐ Yes ☐ No I Is the system required to employ a Nitrogen BMP specified in the system design? ☐ Yes ☐ No I	f "yes", A below is required
1.	Is the system operated under an Operating Permit?  Is the system required to employ a Nitrogen BMP specified in the system design?   BMP = Best Management Practice(s) specified in the system design	f "yes", A below is required f "yes", B below is required
	Is the system operated under an Operating Permit?  Is the system required to employ a Nitrogen BMP specified in the system design?   BMP = Best Management Practice(s) specified in the system design  If the answer to both questions is "no", this section does not need to be completed.	f "yes", A below is required f "yes", B below is required
	Is the system operated under an Operating Permit?  Is the system required to employ a Nitrogen BMP specified in the system design?   BMP = Best Management Practice(s) specified in the system design  If the answer to both questions is "no", this section does not need to be completed Compliance criteria:	f "yes", A below is required f "yes", B below is required
	Is the system operated under an Operating Permit?  Is the system required to employ a Nitrogen BMP specified in the system design?   BMP = Best Management Practice(s) specified in the system design  If the answer to both questions is "no", this section does not need to be completed.  Compliance criteria:  a. Have the operating permit requirements been met?	f "yes", A below is required f "yes", B below is required
	Is the system operated under an Operating Permit?  Is the system required to employ a Nitrogen BMP specified in the system design?   BMP = Best Management Practice(s) specified in the system design  If the answer to both questions is "no", this section does not need to be completed.  Compliance criteria:  a. Have the operating permit requirements been met?  DYES NO  SISTEM NO  SISTEM NO	f "yes", A below is required f "yes", B below is required
	Is the system operated under an Operating Permit?  Is the system required to employ a Nitrogen BMP specified in the system design?   BMP = Best Management Practice(s) specified in the system design  If the answer to both questions is "no", this section does not need to be completed.  Compliance criteria:  a. Have the operating permit requirements been met?  b. Is the required nitrogen BMP in place and properly functioning?   Yes   No  No  Anv "no" answer indicates noncompliance.	f "yes", A below is required f "yes", B below is required
	Is the system operated under an Operating Permit?  Is the system required to employ a Nitrogen BMP specified in the system design? Yes No I BMP = Best Management Practice(s) specified in the system design  If the answer to both questions is "no", this section does not need to be completed Compliance criteria:  a. Have the operating permit requirements been met? Yes No  b. Is the required nitrogen BMP in place and properly functioning? Yes No  Anv no answer indicates noncompliance.  Describe verification methods and results:	f "yes", A below is required f "yes", B below is required
	Is the system operated under an Operating Permit?  Is the system required to employ a Nitrogen BMP specified in the system design?  Yes No I BMP = Best Management Practice(s) specified in the system design  If the answer to both questions is "no", this section does not need to be completed Compliance criteria:  a. Have the operating permit requirements been met?  Yes No  b. Is the required nitrogen BMP in place and properly functioning?  Yes No  Anv no answer indicates noncompliance.  Describe verification methods and results:	f "yes", A below is required f "yes", B below is required.
	Is the system operated under an Operating Permit?	f "yes", A below is required f "yes", B below is required
	Is the system operated under an Operating Permit?  Is the system required to employ a Nitrogen BMP specified in the system design? Yes No I BMP = Best Management Practice(s) specified in the system design  If the answer to both questions is "no", this section does not need to be completed.  Compliance criteria:  a. Have the operating permit requirements been met? Yes No  b. Is the required nitrogen BMP in place and properly functioning? Yes No  Anv no answer indicates noncompliance.  Describe verification methods and results:	f "yes", A below is required f "yes", B below is required
	Is the system operated under an Operating Permit?  Is the system required to employ a Nitrogen BMP specified in the system design? Yes No I BMP = Best Management Practice(s) specified in the system design  If the answer to both questions is "no", this section does not need to be completed.  Compliance criteria:  a. Have the operating permit requirements been met? Yes No  b. Is the required nitrogen BMP in place and properly functioning? Yes No  Anv "no" answer indicates noncompliance.  Describe verification methods and results:	f "yes", A below is required f "yes", B below is required
	Is the system operated under an Operating Permit?  Is the system required to employ a Nitrogen BMP specified in the system design? Yes No I BMP = Best Management Practice(s) specified in the system design  If the answer to both questions is "no", this section does not need to be completed.  Compliance criteria:  a. Have the operating permit requirements been met? Yes No  b. Is the required nitrogen BMP in place and properly functioning? Yes No  Anv "no" answer indicates noncompliance.  Describe verification methods and results:	f "yes", A below is required f "yes", B below is required
	Is the system operated under an Operating Permit?	f "yes", A below is required f "yes", B below is required
	Is the system operated under an Operating Permit?	f "yes", A below is required f "yes", B below is required
	Is the system operated under an Operating Permit?	f "yes", A below is required f "yes", B below is required
	Is the system operated under an Operating Permit?	f "yes", A below is required f "yes", B below is required

Business Name: SS Septic Solutions, LLC.		Date: _	9/20/2023
Soil separation – Compliance co	mponent #5 o	f 5	
Date of installation 6/1/1993 (mm/dd/yyyy)	Unknown		
Shoreland/Wellhead protection/Food beverage lodging?  Compliance criteria (select one):	☐ Yes ⊠ No	Attached supporting documentation:  Soil observation logs completed for the Two provious verifications of requires	ne report
5a.For systems built prior to April 1, 1996, and not located in Shoreland or Wellhead Protection Area or not serving a food, beverage or lodging establishment:	Yes □ No	☐ Two previous verifications of required ☐ Not applicable (No soil treatment area ☐ ☐	-T
Drainfield has at least a two-foot vertical separation distance from periodically saturated soil or bedrock.			
5b. Non-performance systems built April 1, 1996, or later or for non- performance systems located in Shoreland or Wellhead Protection Areas or serving a food, beverage, or lodging establishment:  Drainfield has a three-foot vertical separation distance from periodically saturated soil or bedrock.*	☐ Yes ☐ No	A. Bottom of distribution media  B. Periodically saturated soil/bedrock  C. System separation  D. Required compliance separation*  *May be reduced up to 15 percent if allowed or separation.	2' 5' 3' 2' wed by Local
5c. "Experimental", "Other", or "Performance" systems built under pre-2008 Rules; Type IV or V systems built under 2008 Rules 7080. 2350 or 7080.2400 (Intermediate Inspector License required ≤ 2,500 gallons per day; Advanced Inspector License required > 2,500 gallons per day)  Drainfield meets the designed vertical separation distance from periodically saturated soil or bedrock.			

Describe verification methods and results:

Upgrade requirements: (Minn. Stat. § 115.55) An imminent threat to public health and safety (ITPHS) must be upgraded, replaced, or its use discontinued within ten months of receipt of this notice or within a shorter period if required by local ordinance. If the system is failing to protect ground water, the system must be upgraded, replaced, or its use discontinued within the time required by local ordinance. If an existing system is not failing as defined in law, and has at least two feet of design soil separation, then the system need not be upgraded, repaired, replaced, or its use discontinued, notwithstanding any local ordinance that is more strict. This provision does not apply to systems in shoreland areas, Wellhead Protection Areas, or those used in connection with food, beverage, and lodging establishments as defined in law.

## 000 vation Soil Obser


				1	
			67/15	÷ 40°	
			11.039	2	.5
		3	21000	7	2
		7		3	
	(2)		(	\$10	2000
	35		1000	-	ĝ
	Control of	16 549	315	E.	
3		200	31	WORLS.	
	0,000	14500		mess.	
	APPENDED.		97	FORT OF	r
	ng	2.7	唐 歲	4	
	-	34575	-		
		200	2		
		15:50	100	W.	
- 3	1200	3.	3		
	200As			斯等	
	(2004) 1 1 2 1 1 1 2 1			前等	
				<b>有</b> 等	
i de la companya de l		1			
Page 1					
de la companya de la					
i de					
10					
4		1			
4					
1					
7					
7					
3	1.54	- 1			
3	100	- 1	***	14	
70.00	19*	17.7		14	
70.00	19*	47	****	*	
3	19*	17.7	***	14	

13

	Action (Action)		AND COLUMN TO SERVICE AND ADDRESS OF THE PERSON OF THE PER					こうりてこ			v 03.15.2023
Client:			Linda Ge	are			Loc	ocation / Address:	1877	Ouasar Ave South.	8
Soil parent m	material(s): (C	(Check all t	that apply)	S Out	wash	Lacustrine	Loess	Alluvium	3edrock Or	Mather	VIO 10 10 10 10 10 10 10 10 10 10 10 10 10
Landscape Po	Position:	Back/Side	S		Slope %		Slope sha	Coul	inpar	- 1	
Vegetation:		Lawn		Soil su	urvey ma	p units:		51		Vation Dolativo	5   5
Date/Time of	f Day/Weather	er Conditions:	ons:	9/20	12	. #	Sunny warm		1	imiting lay	to Delicinal K.
Observation	#/Location:	See	Мар					Observati	tion Type:	الق	_
Depth (in)	Texture		Matrix	Color(s)	Mottle	Color(e)	Vind.	In diameter		I Structu	
		Frag. %			3		iles a	) Indicator(s)	Shane	do	Consistanc
0-22."	Medium Sandy Loam	0	7.5YR	3/3					Granular		Loose
23" - 60"	Medium	0	7.5YR	3/4					Granular		
	_								ś		בר בר בר בר בר בר בר בר בר בר בר בר בר ב
								A STATE OF THE PROPERTY OF THE			
Comme											
I hereby certify	that I have c	ompleted	this work	in accord	ance with	<u>=</u>	pplicable ordinances	, rules and law	S.		
Optional Verificati	saturated soil	r bedroo	that this soil	l observat	ion was w	ignature) erified accol	cording to Minn. Repersal site.	. 7082.0500 subp	(License #) 3 A. The signat	ure below represe	9/20/2023 (Date) nts an infield verification of
(LGU/Des	(Designer/Inspector)	orr)			(S)	ignature)			(Cert #)		(Date)

55



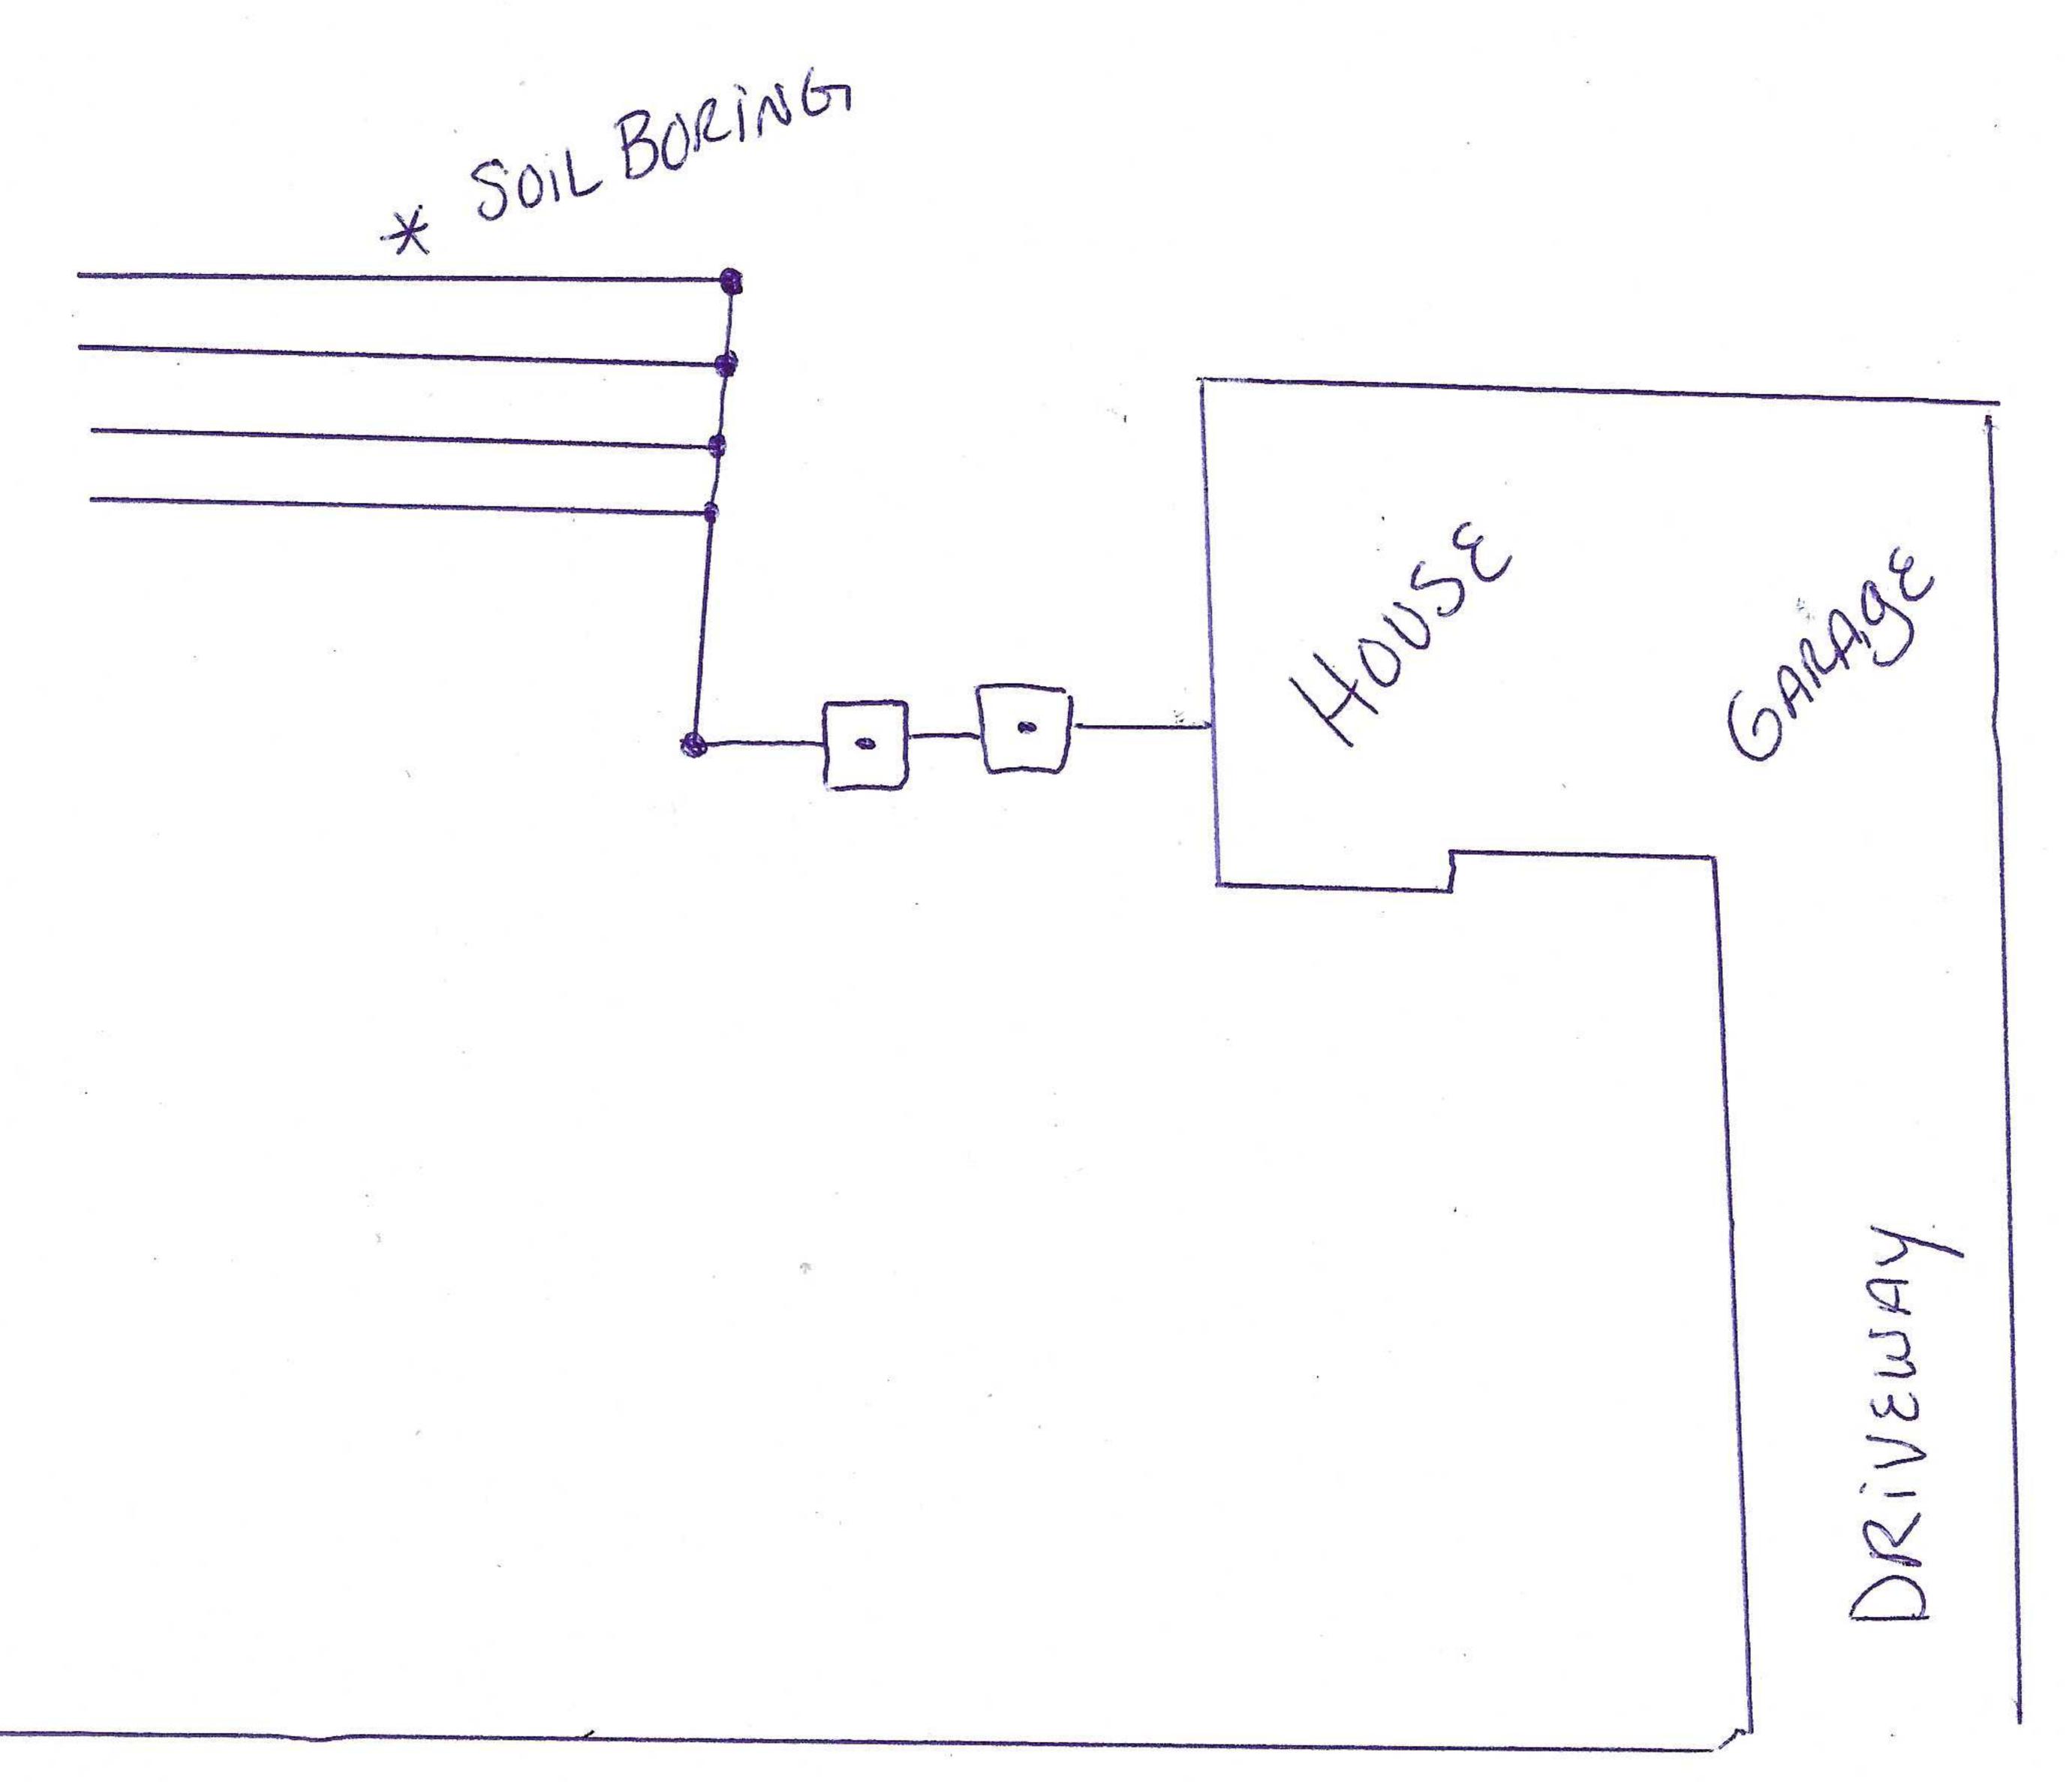

1877 QUASAR AVE.S.

## SS Septic Solutions, LLC additional terms and information.

- 1. SS Septic Solutions, LLC has not been retained to warrant, guarantee, or certify the proper functioning of the system for any period beyond the inspection date. Due to numerous factors (usage, maintenance, tank pumping, soil characteristics, previous failures, etc.) which may affect the proper operation of a septic system. The report shall not be construed as a warranty that the system will properly function for any period.
- 2. Minimum compliance inspection requirements relative to this inspection and this report include only verification that the septic system has a watertight septic tank(s) and lift tank, the required separation from the bottom of the drain field/mound distribution medium and saturated soils, no backup of sewage into the dwelling and no discharge of sewage onto the ground surface or surface water. SS Septic Solutions, LLC does not inspect basement sewage ejector pumps or exterior lift pumps as they are a maintenance item. Sewage backup verification is limited to the information supplied by the last occupants/owner if available. I cannot guarantee that the information given to me is accurate. Some people may attempt to hide or conceal signs of previous backups.
- 3. Certification of this system does not warranty any future use beyond the date of inspection. Any system, new or old, can be hydraulically overloaded because of more people moving into the house than were previously occupying it, improper maintenance, heavy usage, tree roots, freezing conditions, or surface drainage problems. The system could simply stop working due to age.
- 4. A compliance inspection is not meant to be a test of the longevity of the septic system. The inspection is strictly for the purpose of determining if the septic is polluting the environment at the date and time the inspection is performed. The inspection is not intended to determine if the system was originally designed or installed to past or present MPCA or local unit of government code requirements.
- 5. Winter Work Client understands that inspections conducted in winter weather conditions are more difficult to perform due to snow cover and frost. Septic system components like tanks, tank covers, drop boxes and soil treatment areas are more difficult to locate in these conditions. Soil borings and drain field locations are also more difficult to perform due to ground frost. The client needs to understand that due to the weather conditions, the same level of standards may not be possible compared to an inspection during the spring/summer/fall months.
- 6. If hired to perform the compliance inspection, the client hereby agrees that SS Septic Solutions, LLC will not be responsible for any monetary damages, claims or causes of action including attorney fees arising from the performance of this inspection.
- 7. Nothing other than gray water (laundry, showers, etc.) human waste and toilet tissue should be disposed of into the septic tanks. Garbage disposals are not recommended. Smaller amounts of laundry, soaps, dish soap, cleaning agents, etc. are better for the system. Antibacterial soaps and chlorine agents may kill the bacteria needed to treat effluent properly. Additives are not recommended and may be harmful to your system. Recommend to pump and clean your tanks by a certified pumper every other year if you have 1 tank and every 2-3 years if you have a 2-tank system to ensure proper maintenance.